A@ --> Arrandale use
E@ --> Discrete use
SW@ --> Switch use
IV@ --> UMA use

ZYB & ZYBA SYSTEM BLOCK DIAGRAM

GPU CORE PWR ISL6264 P44	CHARGER ISL88731 P38
GPU IO PWR ISL62827 P45	3/5V SYS PWR ISL6237 P39
DISCHARGER +3V,+5V,+1.5V,+1.05V,+1.1V_VTT P47	CPU CORE PWR ISL62882 P40
+1.0V/+1.5V G93334 + Linear P47	CPU VTT ARD: 1.05V CFD: 1.1V UP61111AQDD P41
CPU VGFX_AXG ISL62881 P46	VTT 1.05V UP61111AQDD P42
THERMAL PROTECTION P48	DDR3 PWR TPS5116 P43

CLOCK GENERATOR
SELGO: SLG8SP595V P3
X'TAL 14.318MHz

BCLK: 133MHz
PEG_CLK: 100MHz
DPLL_REF_SSCLK: 120MHz

DDR III
SO-DIMM 0
SO-DIMM 1
SO-DIMM 2
SO-DIMM 3 P14, 15 .16. 17

Dual Channel
800/ 1066 MHz
800 MT/s 1066 MT/s

DDR SYSTEM MEMORY

intel
<MCH Processor>
Clarksfield <Discrete only w/4 DIMM>*
Arrandale <UMA only>
Auburndale <UMA/SG>
rPGA 989
(37.5mm X 37.5mm)
P4.5.6.7
FDI
DMI
PCI-E X16

Fan Driver
(PWM Type) P36

CPU & PCH XDP Conn. P16

PCIE
2.5GT/s

AMD GPU
Broadway-Pro / Madison-Pro 1GB
P19,20,21,22,23,24,25,26

HDMI
CRT
LVDS

X'TAL 27.0MHz

*[Arrandale Only]

X4 DMI interface

LVDS_CRT_HDMI Switch Graphics
P25, 26

HDMI P26
CRT P25
LVDS P25

INT_HDMI *[Arrandale Only]
INT_CRT *[Arrandale Only]
INT_LVDS *[Arrandale Only]

Note:
HM55 does not support USB 6 & 7
HM55 does not support SATA 2 & 3

HDD (SATA) *2 P31
SATA0
SATA5

ODD (SATA) P31
SATA1

SATA4

USB 2.0

Azalia

intel
<PCH>
Graphics Interfaces
SATA
3.0 GT/s
Ibex Peak_M
PCI-E
USB
mBGA 676
(27mm X 25mm)
P8.9.10.11.12.13
HDA
RTC P9
SPI
LPC

X'TAL 32.768KHz

PS8101 LS

PCI-Express
2.5GT/s

USB Port x 4
USB 1, 3, 11, 12 (Debug) P34

Bluetooth
USB 4 P36

CCD
USB 8 P29

Alcor
CardReader
AU6437

P26
Card Reader Connector

Relteak
Audio CODEC
ALC669X P29

SPI ROM
4MB x1 (Basic ME+Braidwood) P9

Winbond
EC (WPC781) P37

SPI ROM P37

Touch Pad P36

Sub-Amplifier (TPA3111D1)
SUBWOOFER P30

Rear Audio Amp & Head phone
GMT G1453L P30
Main SPK P30
S/PDIF P30
Line in P30
MIC Jack P30
Int. D-MIC P125 P30

K/B COON. P36

PCIE-1 & 2
CLKOUT_PEG_1&3
PCIE-6
CLKOUT_PEG_B

Mini Card
WLAN / 2
USB 10 & 13 P32

USB10 & 13

Lan/B

Atheros
Giga-LAN
AR8151 P28

X'TAL 25MHz

Transformer P28

RJ45 Connector P28

SSID: DISCRETE: 030A
SSID: SWITCH GFX: 0308
SVID: 1025

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	ZYB Block Diagram	1A
Date: Tuesday, January 12, 2010	Sheet 1 of 51	

GPU PWR CTRL Option 1 (Default/ VDDR3 before VDDC)

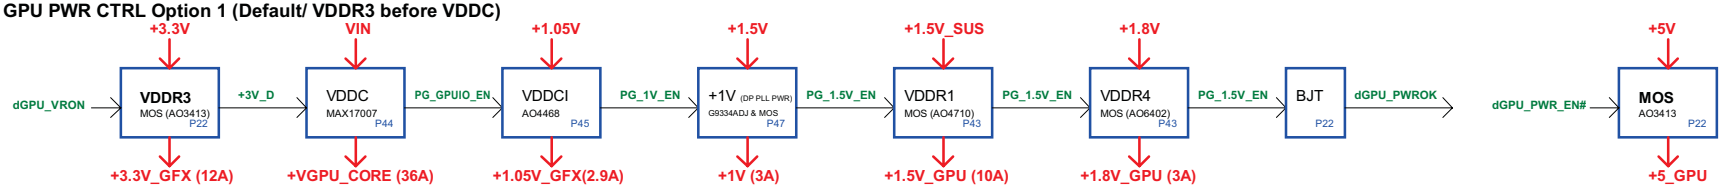

GPU PWR CTRL Option 2 (VDDR3 after VDDR1)

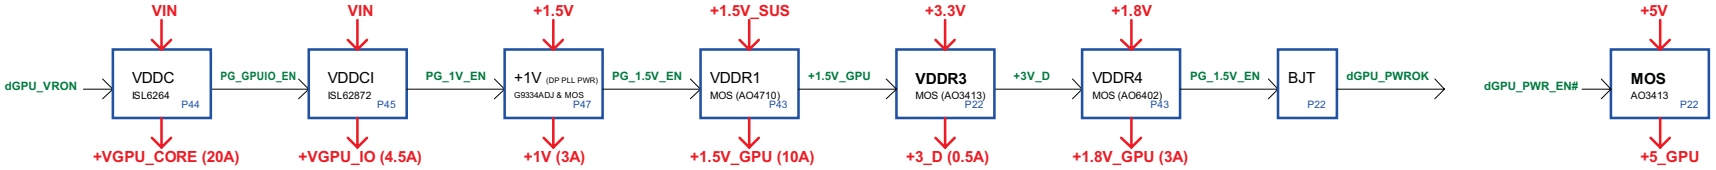

Power States

POWER PLANE	VOLTAGE	DESCRIPTION	CONTROL SIGNAL	ACTIVE IN
VIN	+10V~+19V	MAIN POWER	ALWAYS	ALWAYS
+VCCRTC	+3V~+3.3V	RTC POWER	ALWAYS	ALWAYS
+3VPCU	+3.3V	EC POWER	ALWAYS	ALWAYS
+5VPCU	+5V	CHARGE POWER	ALWAYS	ALWAYS
+15V	+15V	CHARGE PUMP POWER	ALWAYS	ALWAYS
+3V_S5	+3.3V	LAN/BT/CIR POWER	S5_ON	S0-S5
+5V_S5	+5V	USB POWER	S5_ON	S0-S5
+5V	+5V	HDD/ODD/Codec/TP/CRT/HDMI POWER	MAINON	S0
+3V	+3.3V	PCH/GPU/Peripheral component POWER	MAINON	S0
+1.5V_SUS	+1.5V	CPU/SODIMM CORE POWER	SUSON	S0-S3
+0.75V_DDR_VTT	+0.75V	SODIMM Termination POWER	MAINON	S0
+VGFX_AXG	variation	Internal GPU POWER	GFX_ON	S0
+1.8V	+1.8V	CPU/PCH/Braidwood POWER	MAINON	S0
+1.5V	+1.5V	MINI CARD/NEW CARD POWER	MAINON	S0
+1.1V_VTT	+1.05V or +1.1V	CPU VTT POWER	MAINON	S0
+1.05V	+1.05V	PCH CORE POWER	MAINON	S0
+VCC_CORE	variation	CPU CORE POWER	VRON	S0
LCDVCC	+3.3V	LCD POWER	LVDS_VDDEN	S0
+VGPUCORE	+0.9V~+1.1V	GPU CORE POWER	dGPU_VRON	Discrete enable
+1.05V_GFX	+0.9V~+1.1V	GPU I/O POWER	dGPU_VRON	Discrete enable
+1.5V_GFX	+1.5V	VRAM CORE POWER	dGPU_VRON	Discrete enable
+1.8V_VGA	+1.8V	LVDS/PLL POWER	dGPU_VRON	Discrete enable
+3.3V_GFX	+3.3V	PEG/HDMI/CRT POWER	dGPU_VRON	Discrete enable

Thermal Follow Chart

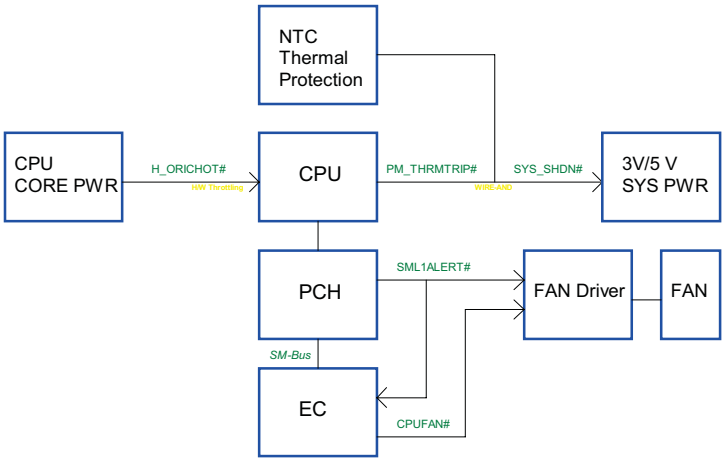

PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Size
Document Number
PWR Status & GPU PWR CRL & THRM
Rev 1A
Date: Tuesday, January 12, 2010
Sheet 2 of 51

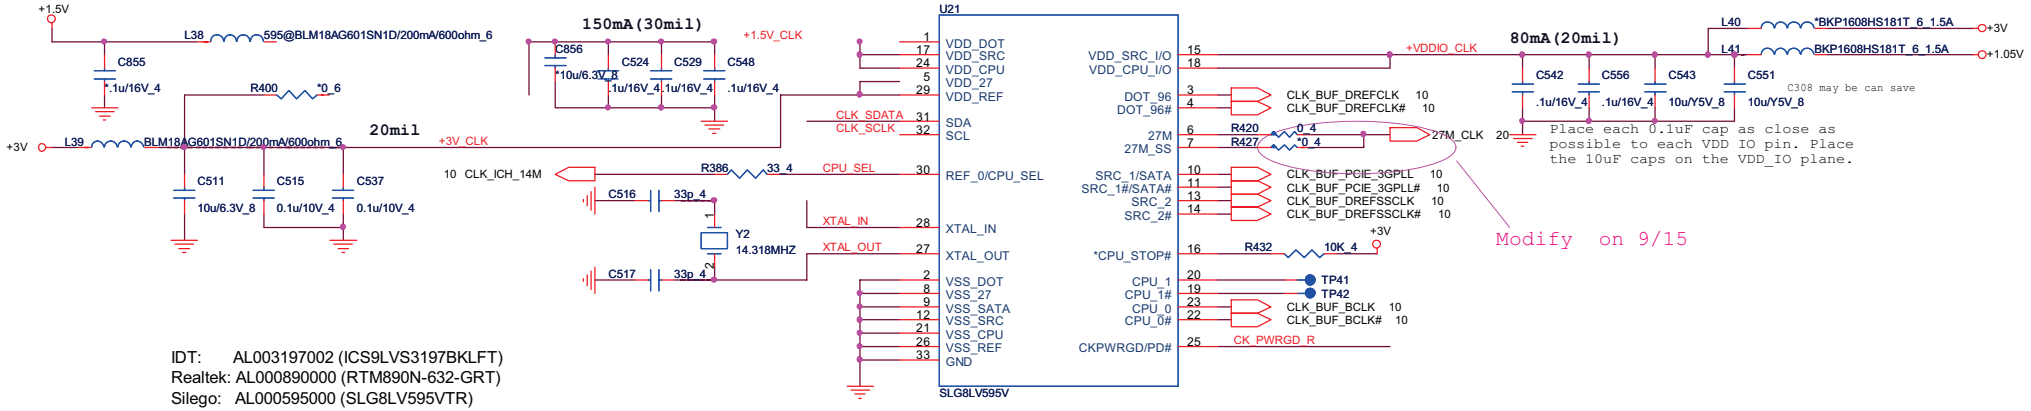

IDT: AL003197002 (ICS9LVS3197BKLFT)
Realtek: AL000890000 (RTM890N-632-GRT)
Silego: AL000595000 (SLG8LV595VTR)

CPU_CLK select

Modify on C test

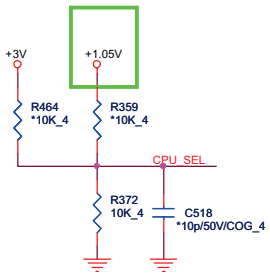

	0	1
CPU_SEL	CPU0/1=133MHz (default)	CPU0/1=100MHz

SMBus

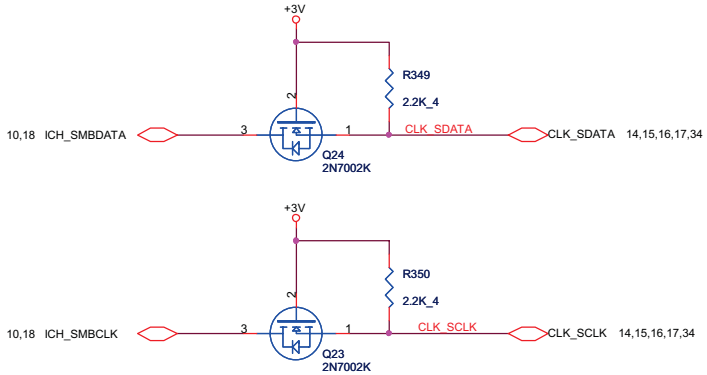

CLK Enable

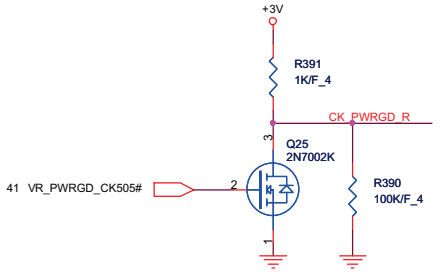

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Clock Generator	1A
Date: Tuesday, January 19, 2010	Sheet 3 of 51	

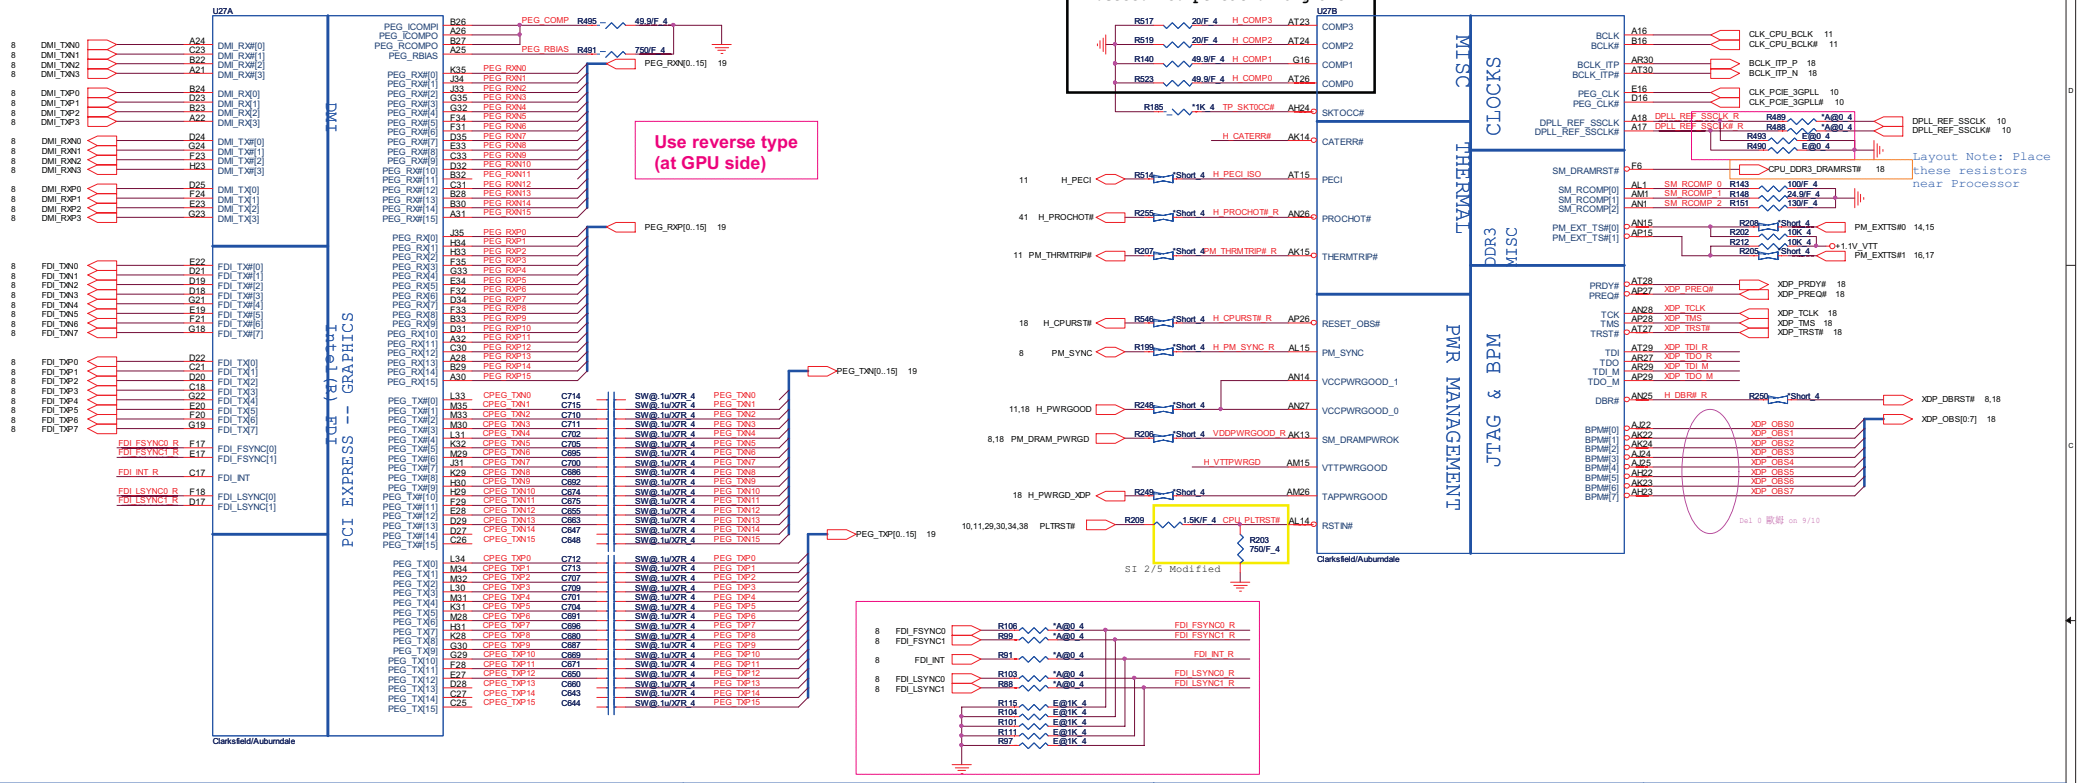

Thermaltrip protect

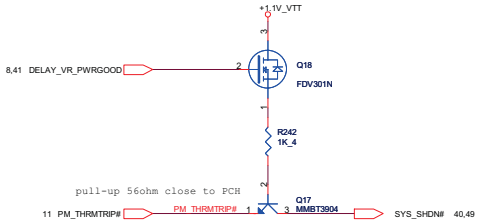

VTT PWR_Good

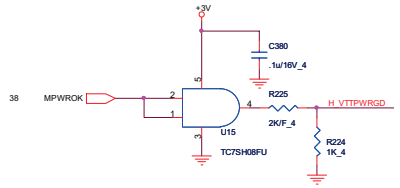

Processor pull-up

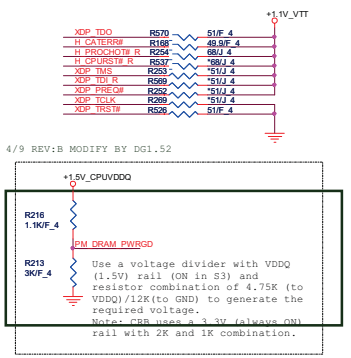

JTAG MAPPING

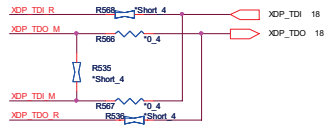

Scan Chain (Default)	STUFF -> R469, R491, R507 NO STUFF -> R489, R490
CPU Only	STUFF -> R490, R491 NO STUFF -> R469, R489, R507
GMCH Only	STUFF -> R489, R507 NO STUFF -> R491, R490, R469

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	AUBURNDA 1/4	1A
Date: Tuesday, January 19, 2010	Sheet 4 of 51	

AUBURNDALE/CLARKSFIELD PROCESSOR (DDR3)

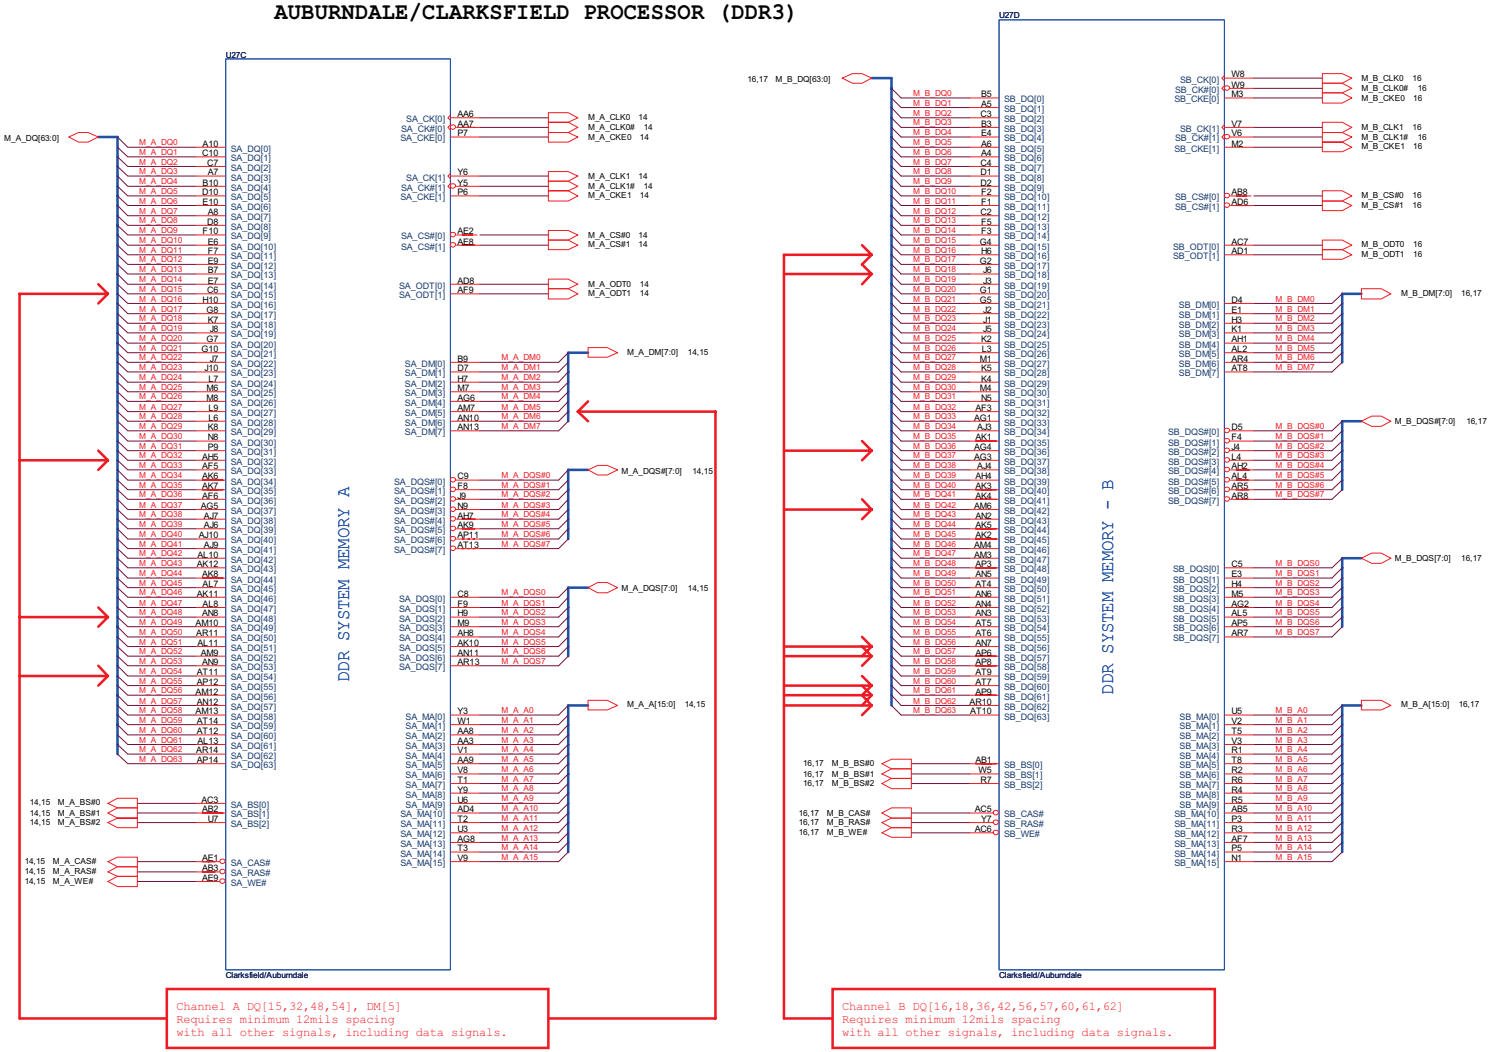

PROJECT : ZYB & ZYBA Quanta Computer Inc.		
Size	Document Number AUBURNDA 2/4	Rev 1A
Date: Tuesday, January 19, 2010	Sheet 5 of 51	

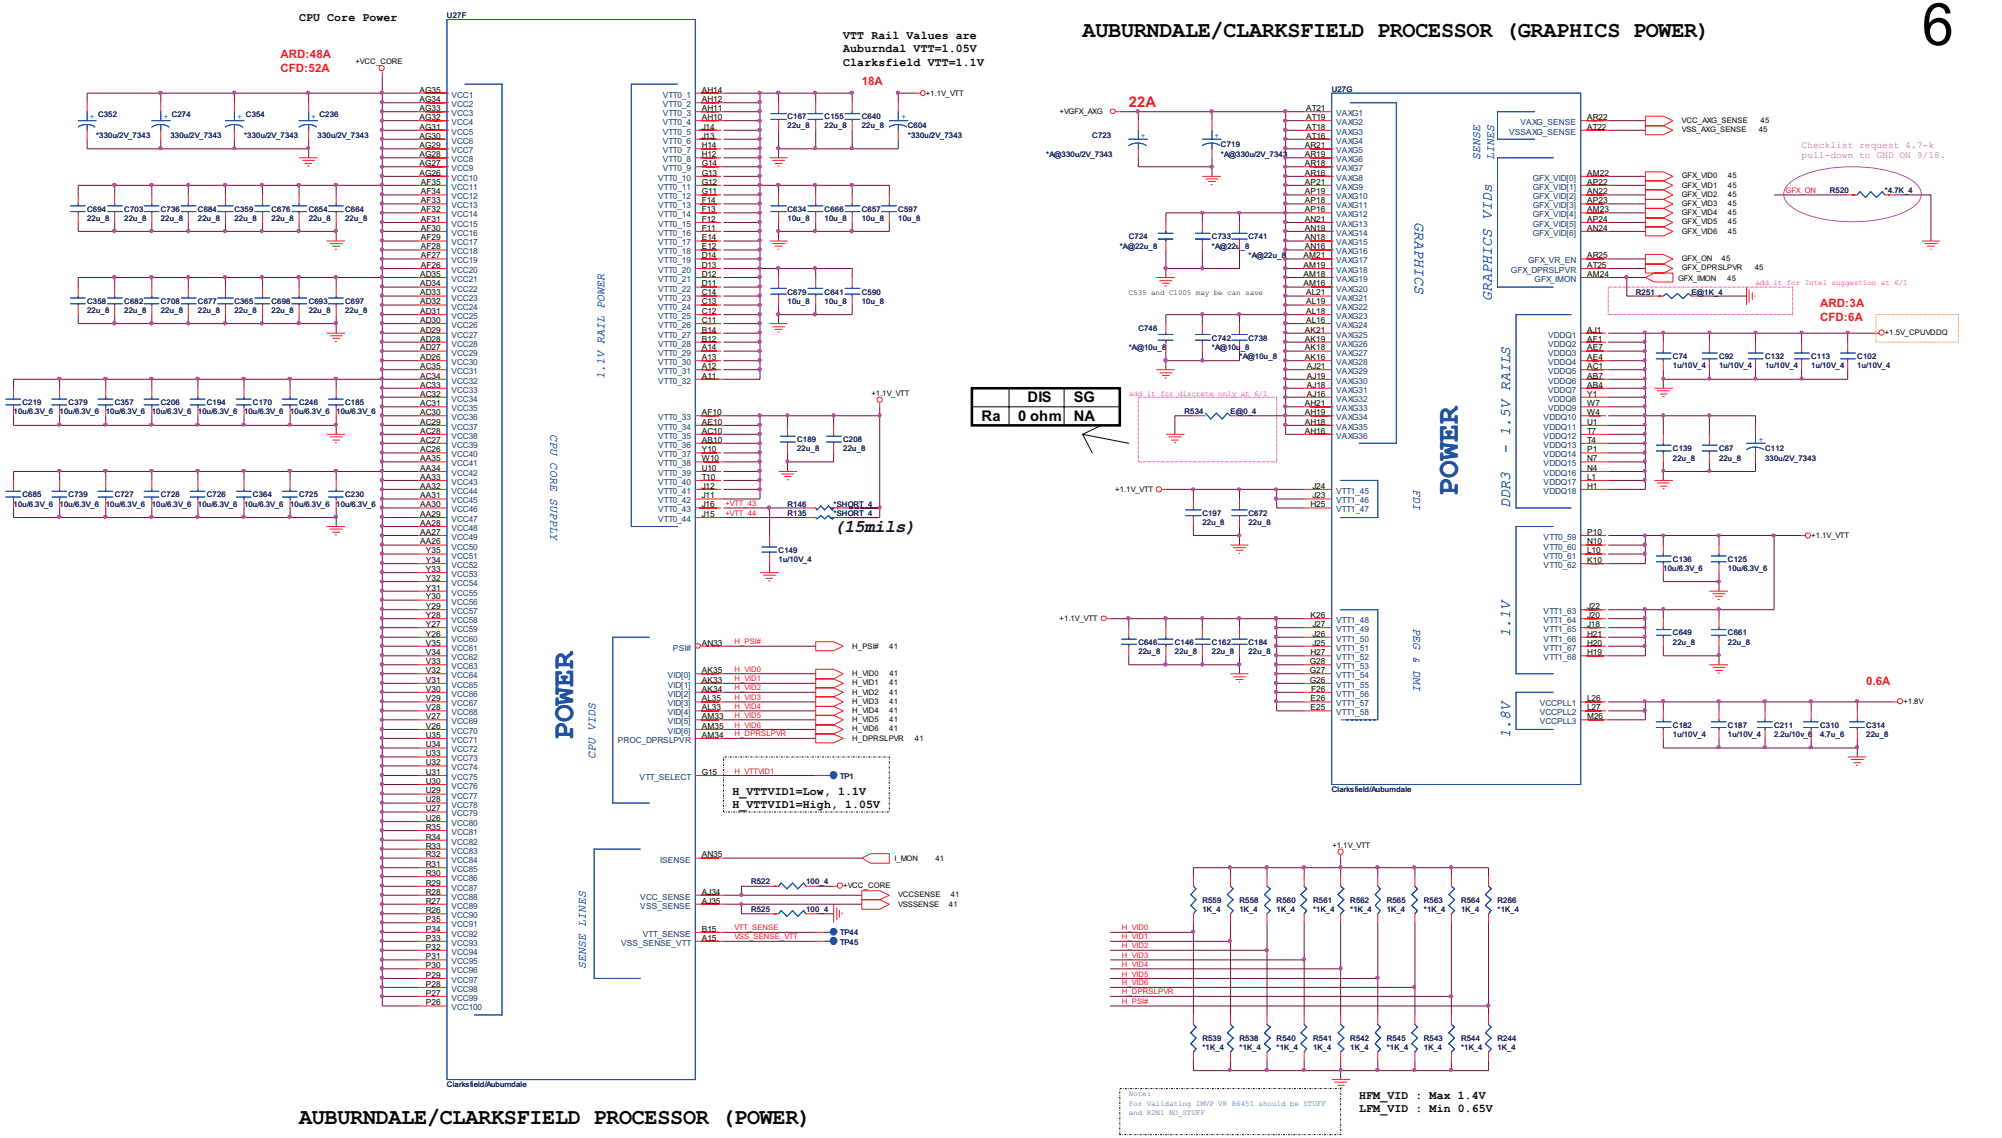

	DIS	SG
Ra	0 ohm	NA

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	AUBURNDA 3/4 (PWR)	1A
Date: Tuesday, January 19, 2010	Sheet 6 of 51	

AUBURNDALE/CLARKSFIELD PROCESSOR (GND)

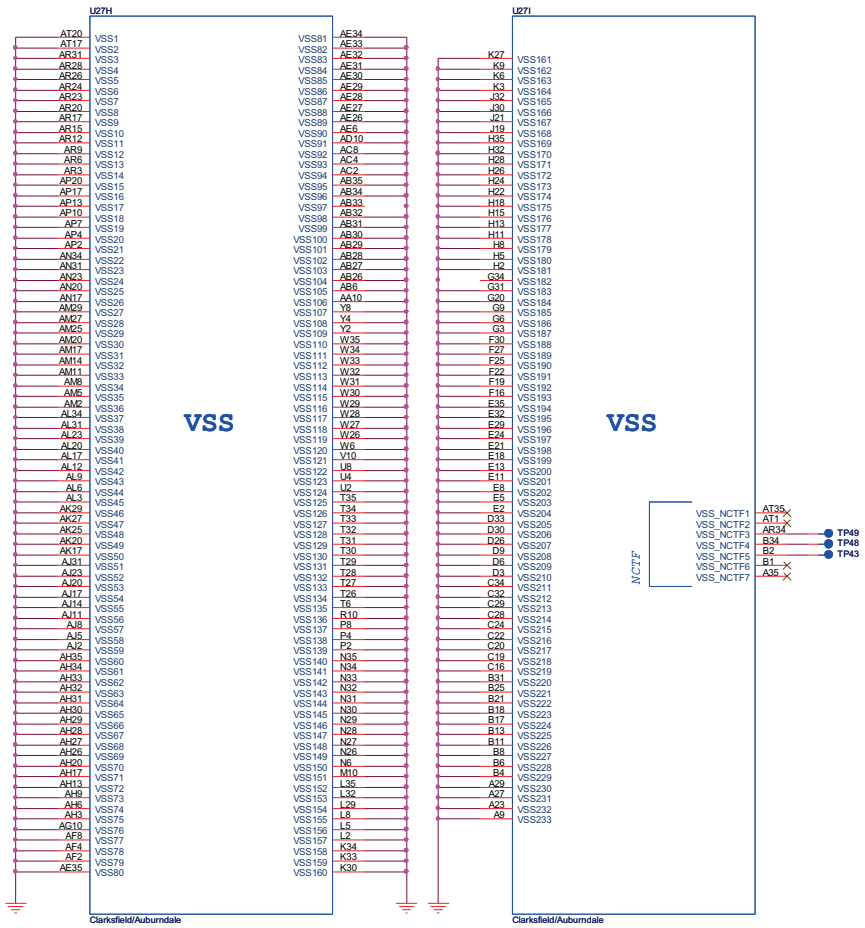

AUBURNDALE/CLARKSFIELD PROCESSOR(RESERVED, CFG)

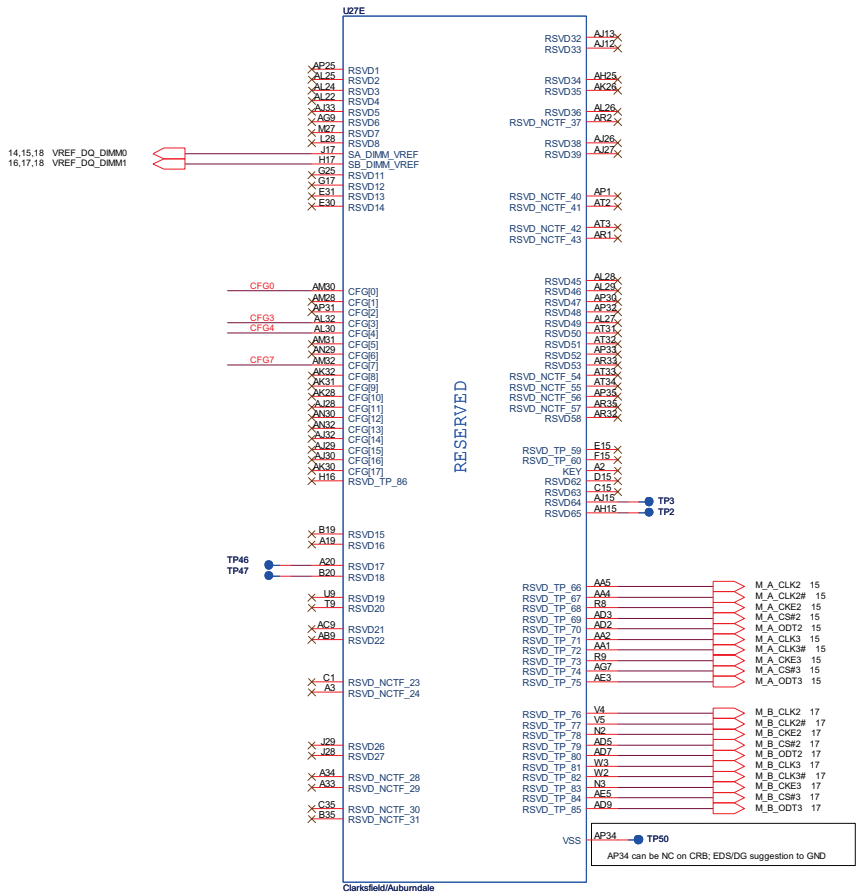

Processor Strapping

	1	0
CFG4 (Display Port Presence)	Disabled; No Physical Display Port attached to Embedded Diplay Port	Enabled; An external Display port device is connected to the Embedded Display port
CFG0 (PCI-Epress Configuration Select)	Single PEG	Bifurcation enabled
CFG3 (PCI-Epress Static Lane Reversal)	Normal Operation	Lane Numbers Reversed

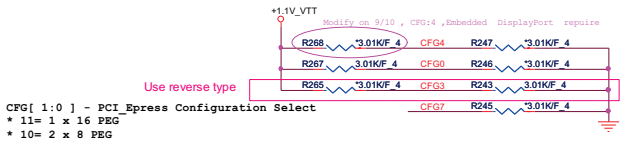

CFG[1:0] - PCI_Epress Configuration Select
* 11= 1 x 16 PEG
* 10= 2 x 8 PEG

The Clarkfield processor's PCI Express interface may not meet PCI Express 2.0 jitter specifications. Intel recommends placing a 3.01K +/- 5% pull down resistor to VSS on CFG[7] pin for both rPGA and BGA components. This pull down resistor should be removed when this issue is fixed.(ES1 only)

PROJECT : ZYB & ZYBA		
Quanta Computer Inc.		
Size	Document Number: AUBURNDA 4/4	Rev: 1A
Date: Tuesday, January 19, 2010	Sheet 7 of 51	

IBEX PEAK-M (DMI,FDI,GPIO)

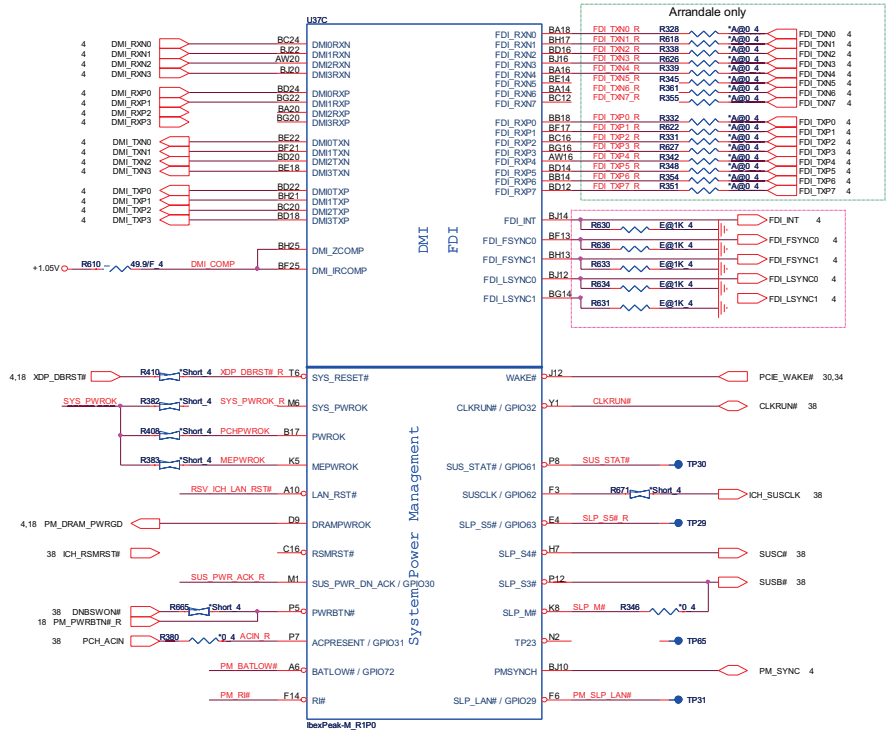

IBEX PEAK-M (LVDS,DDI)

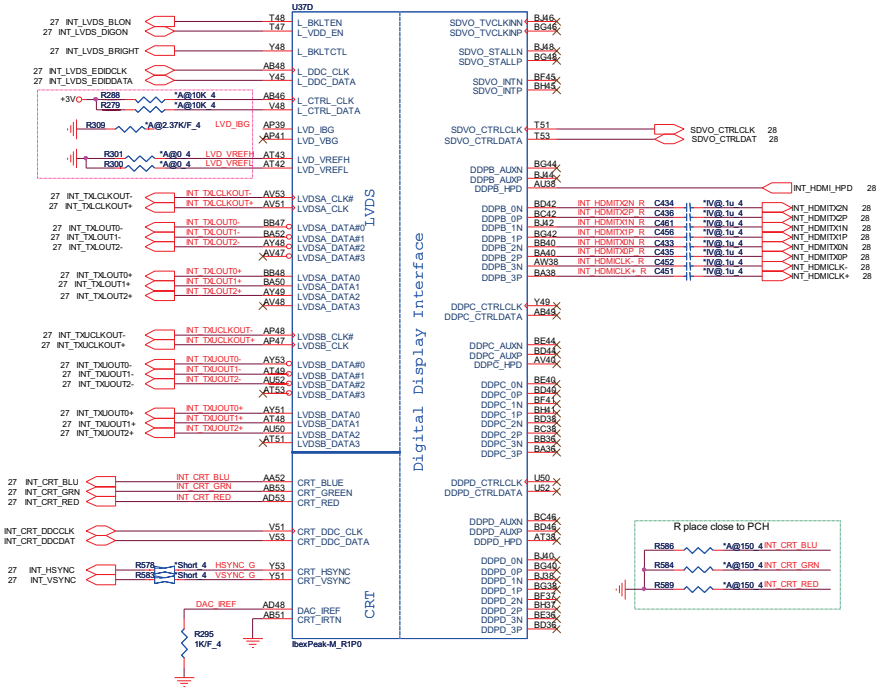

PCH Pull-high/low

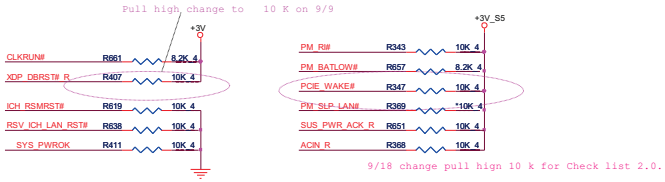

System PWR_OK

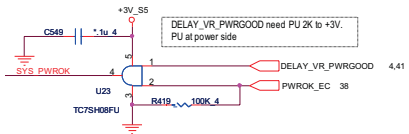

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	IBEX PEAK-M 1/6	1A
Date: Tuesday, January 19, 2010	Sheet 8 of 51	

RTC Circuitry

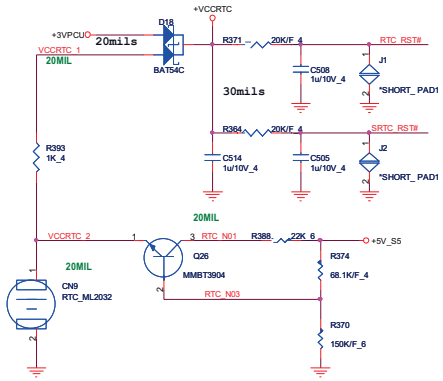

HDA Bus

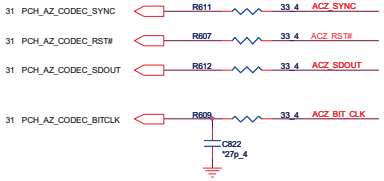

Place all series terms close to PCH except for SDIN input lines,which should be close to source.Placement of R773, R775, R776 & R777 should equal distance to the T split trace point. Basically, keep the same distance from T for all series termination resistors.

HDA Bus for Modem(CLG)

HDA Bus for Modem(CLG)

PCH SPI

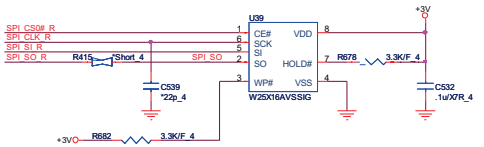

IBEX PEAK-M (HDA,JTAG,SATA)

9

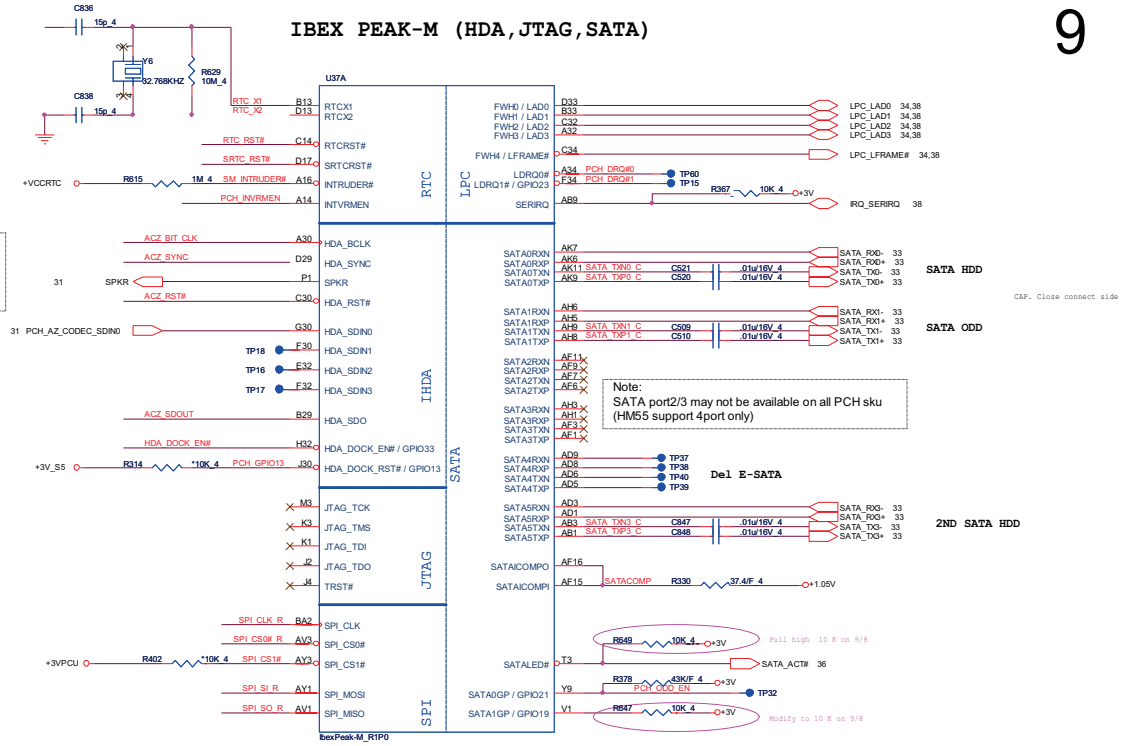

PCH Strap Table

Pin Name	Strap description	Sampled	Configuration	ZY9B note
SPKR	No reboot mode setting	PWROK	0 = Default (weak pull-down 20K) 1 = Setting to No-Reboot mode	+3V R650 *10K_4 SPKR
INIT3_3V	Reserved	PWROK	1 = Default (weak pull-up 20K) Should not be pull-down	
GNT3# / GPIO55	Top-Block Swap Override	PWROK	0 = "top-block swap" mode 1 = Default (weak pull-up 20K)	R582 *10K_4 PCI_GNT3# 10
INTVRMEN	Integrated 1.05V VRM enable	ALWAYS	Should be always pull-up	+VCCRTC R625 330K_4 PCH_INVRMEN
GNT1# / GPIO51	Boot BIOS Selection 1 [bit-1]	PWROK	GNT1# / GNT0# / Boot Location 1 / 1 / SPI 1 / 0 / PCI 0 / 0 / LPC	Default weak pull-up on GNT0/1# [Need external pull-down for LPC BIOS] +3V R293 *1K_4 R305 *1K_4 R298 1K_4 R299 1K_4 PCI_GNT0# 10 PCI_GNT1# 10
GNT0#	Boot BIOS Selection 0 [bit-0]	PWROK		
GNT2# / GPIO53	ESI strap (Server only)	PWROK	Should not be pull-down (weak pull-up 20K)	USE GPIO PIN
NV_ALE	Intel Anti-Theft HDD protection	PWROK	0 = Disable (Internal pull-down 32ohm)	+1.8V R373 *1K_4 NV_ALE NV_ALE 10
NV_CLE	DMI Termination voltage	PWROK	weak pull-down 32ohm	+1.8V R366 *1K_4 NV_CLE NV_CLE 10
HDA_DOCK_EN#/GPIO33	Flash Descriptor Security	PWROK	0 = Override 1 = Default (weak pull-up 20K)	+3V R307 *1K_4 R303 *10K_4 HDA_DOCK_EN#
SPI_MOSI	iTPM function Disable	MEPWROK	0 = Default (weak pull-down 20K) 1 = Enable	+3V R392 *1K_4 SPI_SI_R
HDA_SDO	Reserved	RSMRST#	Should not be pull-up (weak pull-down 20K)	
GPIO8	Reserved	RSMRST#	Should not be pull-down (weak pull-up 20K)	+3V_S5 R357 10K_4 RSV_GPIO8 11
GPIO27	On-die PLL Voltage Regulator	RSMRST#	0 = Disable 1 = Enable (weak pull-up 20K)	
HDA_SYNC	On-die PLL PWR supply select	RSMRST#	0 = 1.8V supply (weak pull-down 20K) 1 = 1.5V supply	use defaul (0 = 1.8V supply)
GPIO15	Reserved	RSMRST#	0 = TLS no Confidentiality (weak pull-down 20K) 1 = TLS Confidentiality	+3V_S5 R365 1K_4 CR_WAKE# 11

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	IBEX PEAK-M 2/6	1A
Date: Tuesday, January 19, 2010	Sheet 9 of 51	

IBEX PEAK-M (PCI,USB,NVRAM)

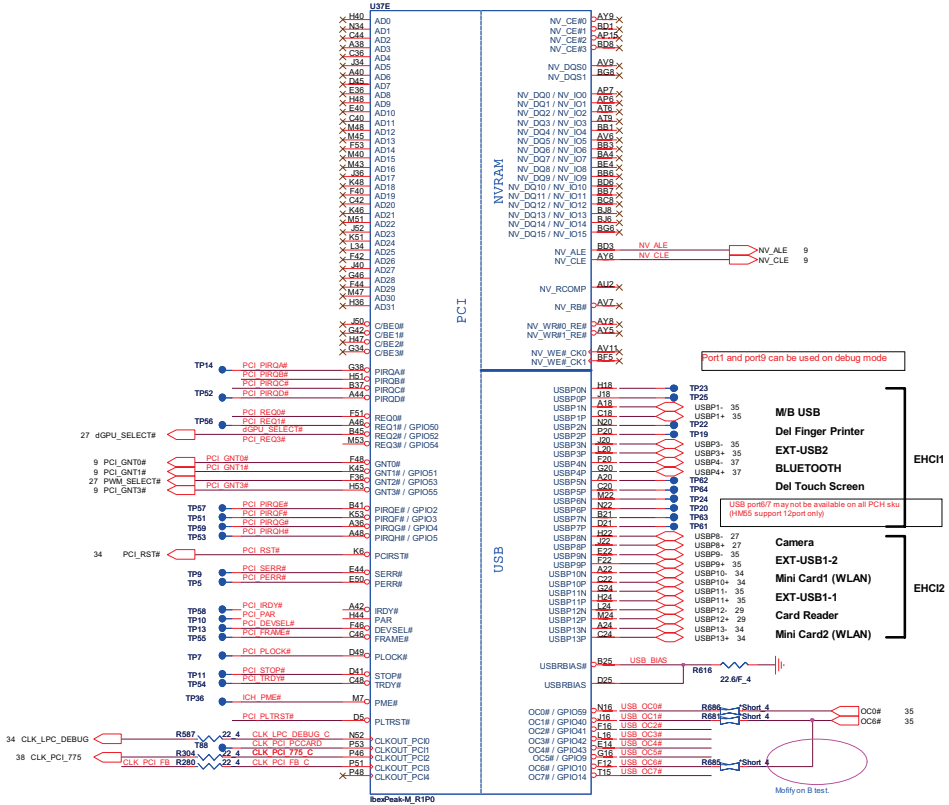

IBEX PEAK-M (PCI-E,SMBUS,CLK)

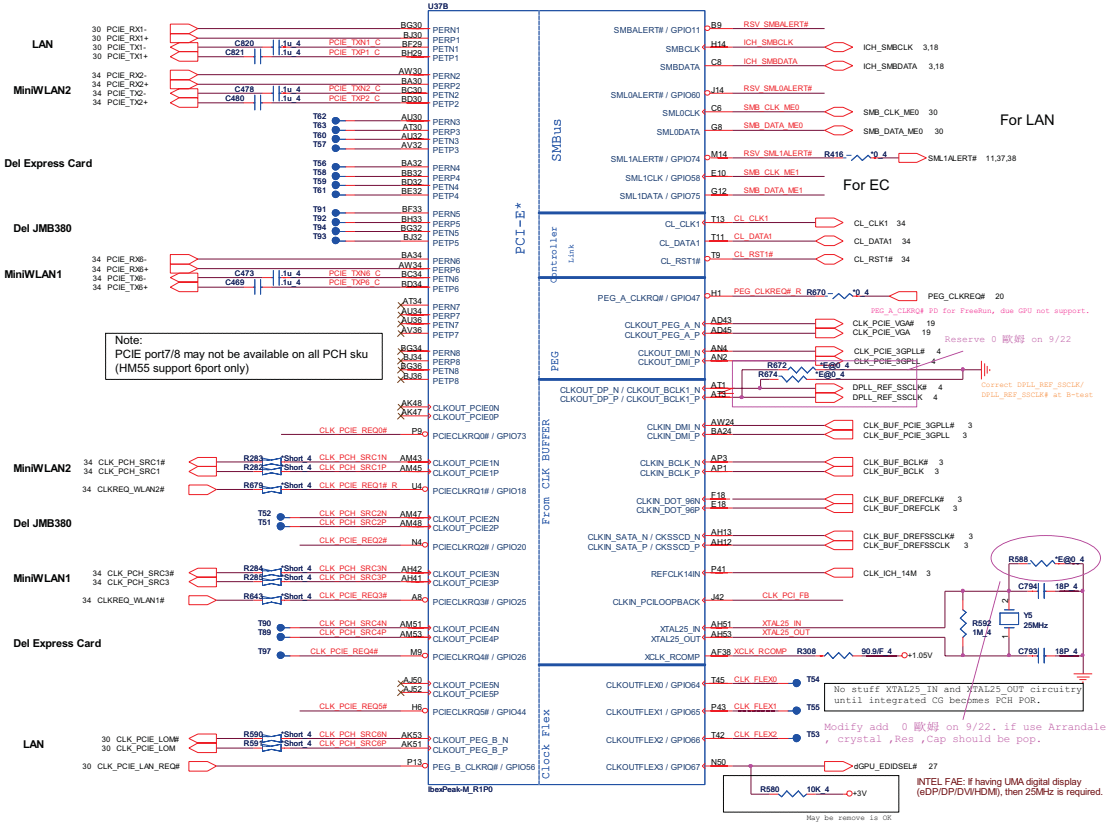

PLTRST#

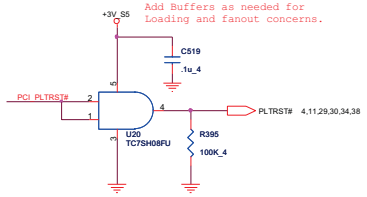

PCI/USBOC# Pull-up

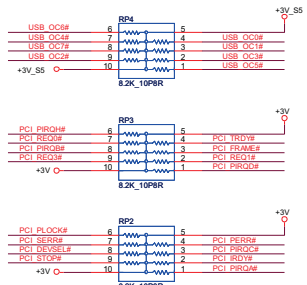

CLK_REQ/Strap Pin

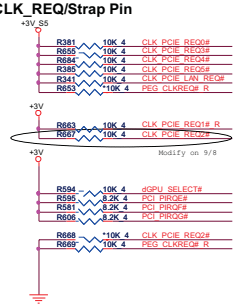

PEG_A_CLKRQ# PD for FreeRun, due GPU not support.

A16 swap override Strap/Top-Block Swap Override jumper

PCI_GNT3#	Low = A16 swap override/Top-Block Swap Override enabled High = Default

Boot BIOS Strap

GNT0#	GNT1#	Boot BIOS Location
0	0	LPC
0	1	Reserved (NAND)
1	0	PCI
1	1	SPI

Danbury Technology Enabled

NV_ALE	High = Enable Low = Disable

DMI Termination Voltage

NV_CLE	Set to Vcc when LOW Set to Vcc/2 when HIGH

SMBus/Pull-up

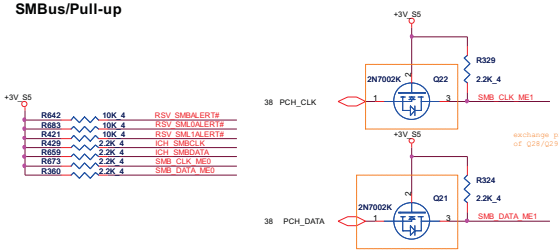

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	IBEX PEAK-M 3/6	1A
Date: Tuesday, January 19, 2010	Sheet 10 of 51	

IBEX PEAK-M (GPIO,VSS_NCTF,RSVD)

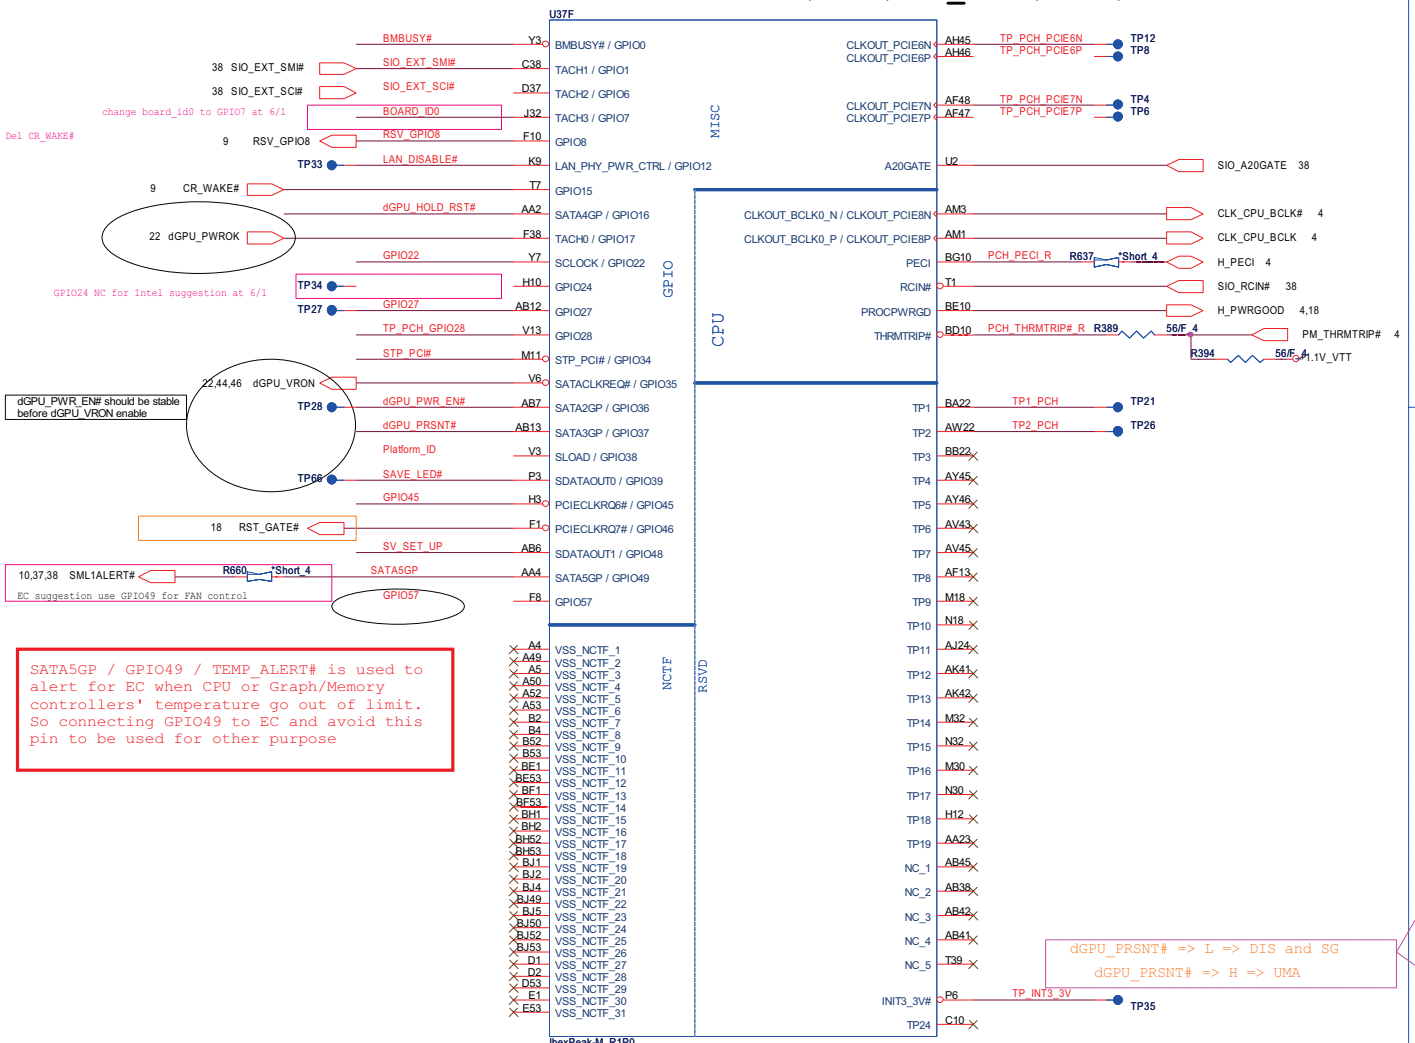

SATA5GP / GPIO49 / TEMP_ALERT# is used to alert for EC when CPU or Graph/Memory controllers' temperature go out of limit. So connecting GPIO49 to EC and avoid this pin to be used for other purpose

GPU RST#

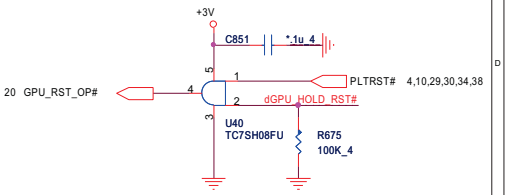

GPIO Pull-up/Pull-down

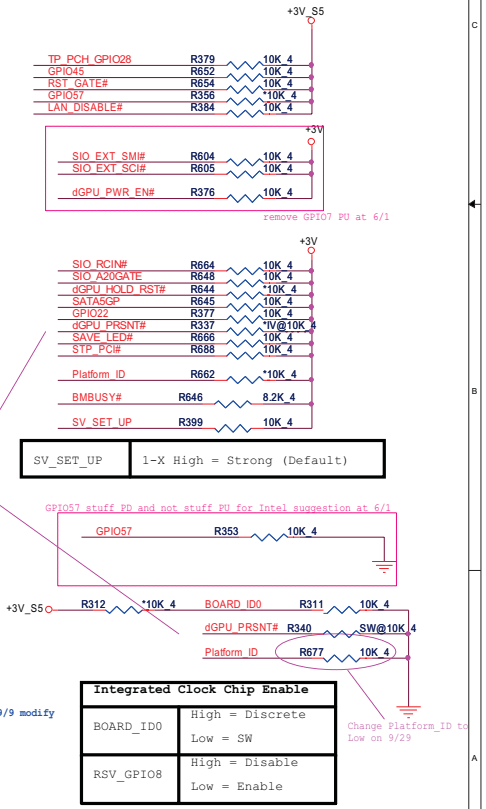

SV_SET_UP	1-X High = Strong (Default)

Integrated Clock Chip Enable	
BOARD_ID0	High = Discrete Low = SW
RSV_GPIO8	High = Disable Low = Enable

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	IBEX PEAK-M 4/6	1A
Date: Tuesday, January 19, 2010	Sheet 11 of 51	

IBEX PEAK-M (POWER)

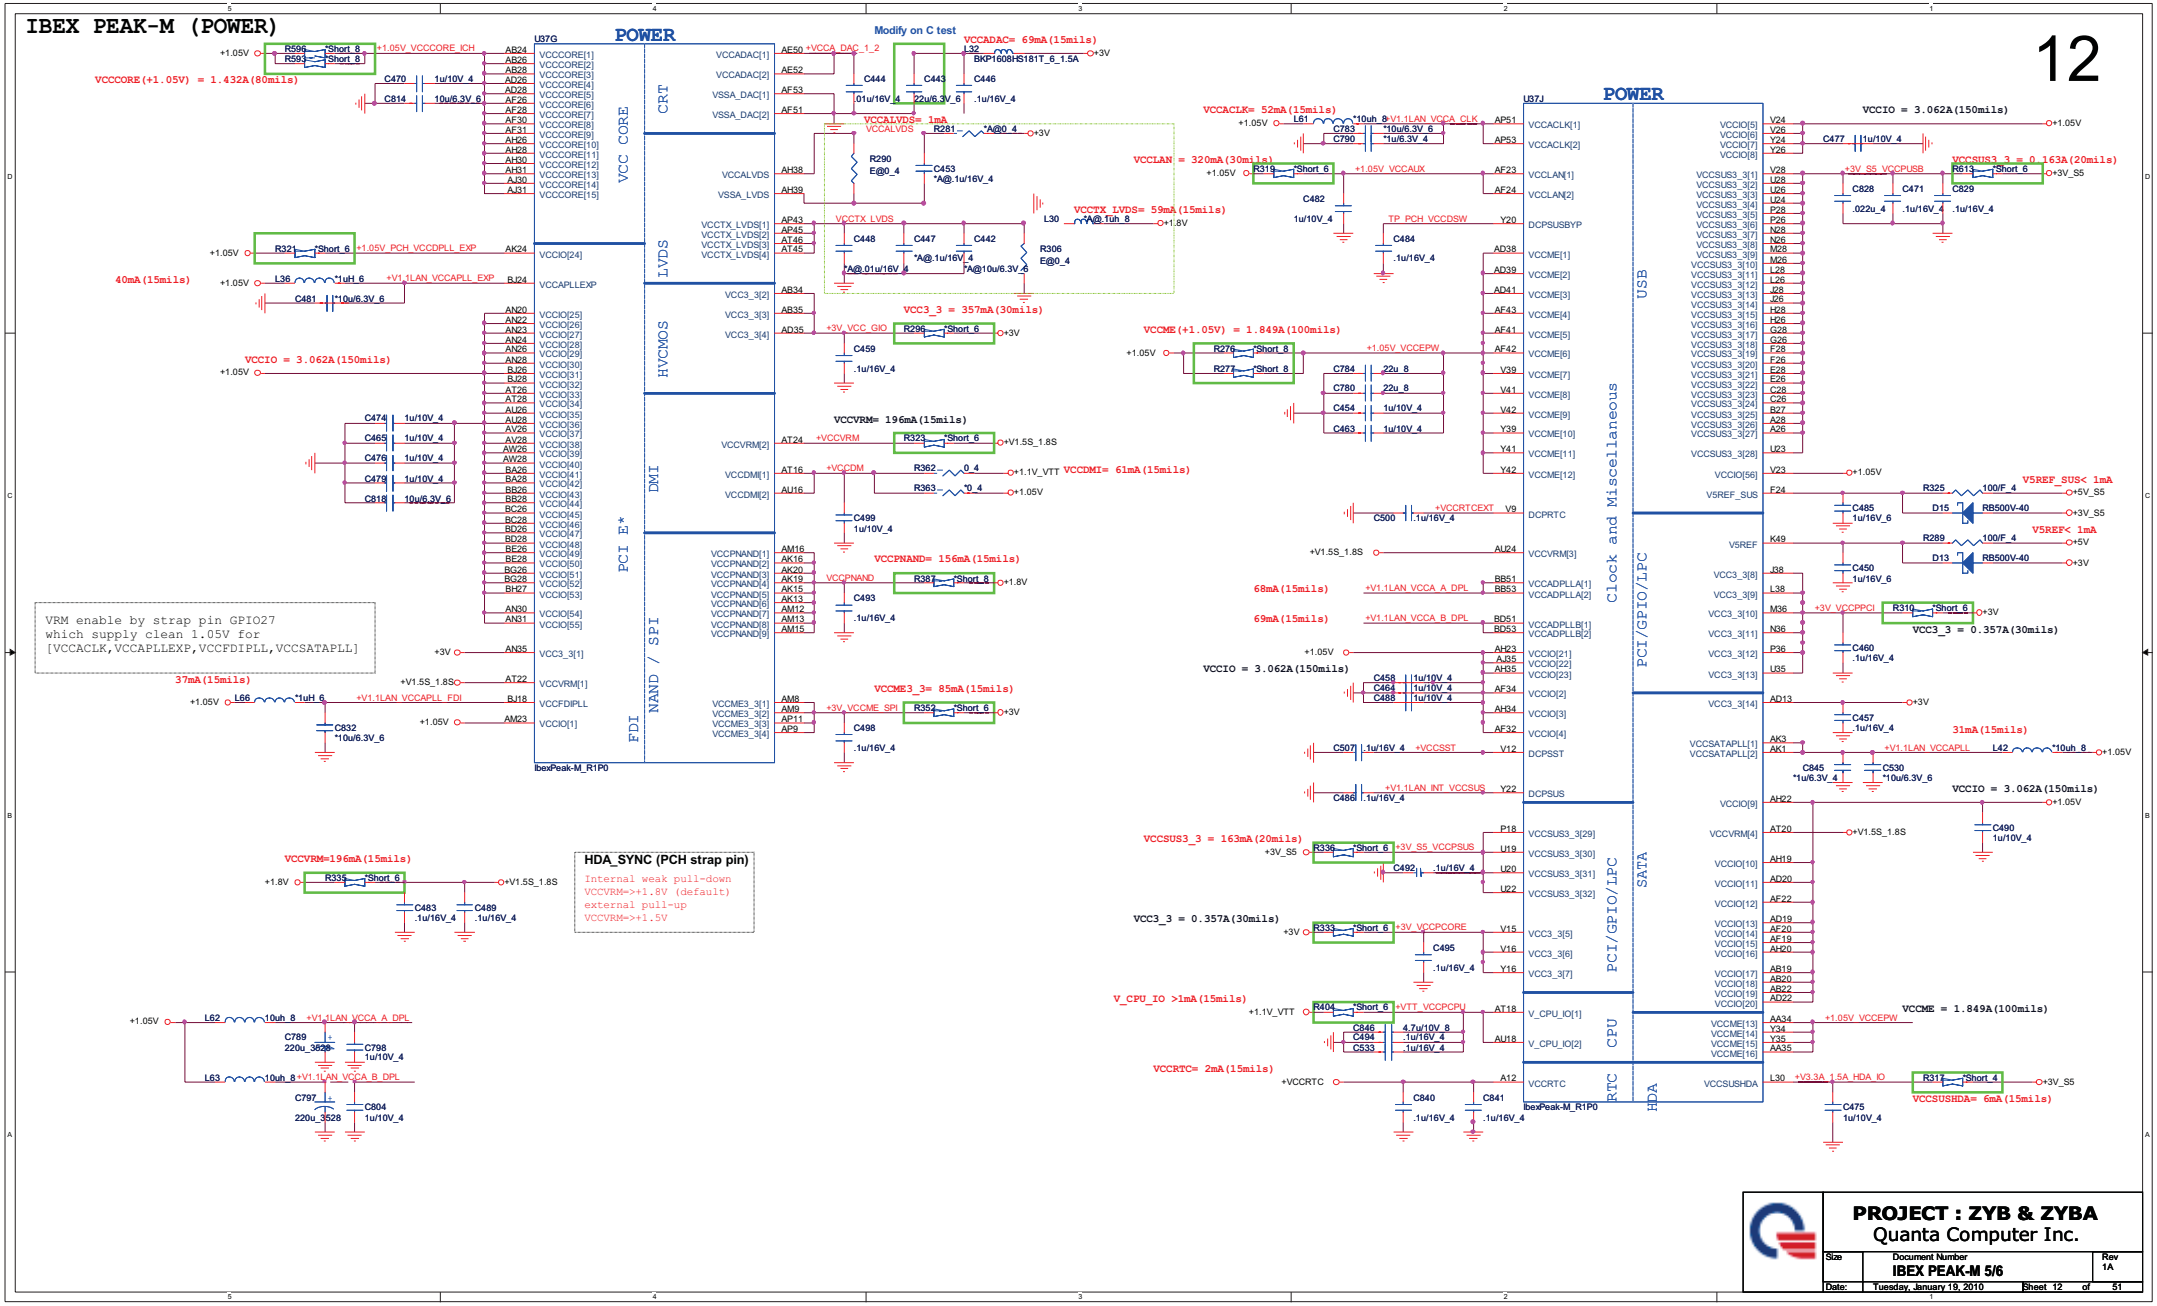

IBEX PEAK-M (GND)

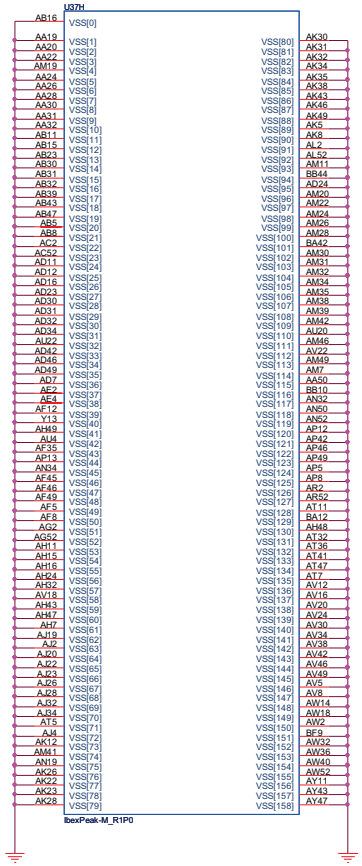

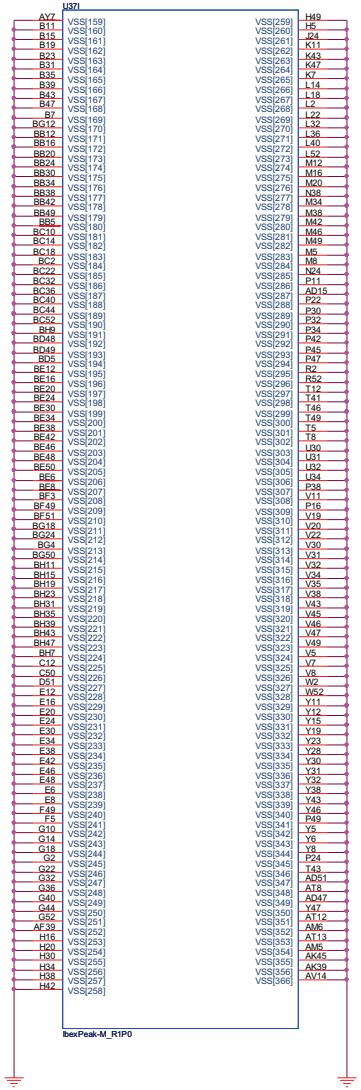

PROJECT : ZYB & ZYBA		
Quanta Computer Inc.		
Size	Document Number: IBEX PEAK-M 6/6	Rev: 1A
Date: Tuesday, January 12, 2010	Sheet 13 of 51	

DDR_RVS (DDR)

	SA1	SA0
CHA0	0	0
CHA1	0	1
CHB0	1	1
CHB1	1	0

JDIM1A

PC2100 DDR3 SDRAM SO-DIMM (204P)

DDR3-DIMM0_H=5.2_RVS

JDIM1B

PC2100 DDR3 SDRAM SO-DIMM (204P)

DDR3-DIMM0_H=5.2_RVS

2.48A

Place these Caps near So-Dimm0.

DM signals are not present on Clarksfield processor. All DM signals can be left as No Connect on Clarksfield and connected directly to GND on SO-DIMM side for Clarksfield only designs.

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	DDRIII SO-DIMM-0	1A
Date: Tuesday, January 19, 2010	Sheet 14 of 51	

DDR_RVS (DDR)

	SA1	SA0
CHA0	0	0
CHA1	0	1
CHB0	1	1
CHB1	1	0

JDIM2A

PC2100 DDR3 SDRAM SO-DIMM (204P)

E@DDR3-DIMM0_H=9.2_RVS

JDIM2B

PC2100 DDR3 SDRAM SO-DIMM (204P)

2.48A

E@DDR3-DIMM0_H=9.2_RVS

Place these Caps near So-Dimm0.

maybe can save

Close to SO-DIMM

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	DDRIII SO-DIMM-0	1A
Date: Tuesday, January 19, 2010	Sheet 15 of 51	

DDR_RVS (DDR)

	SA1	SA0
CHA0	0	0
CHA1	0	1
CHB0	1	0
CHB1	1	1

JDIM4A

PC2100 DDR3 SDRAM SO-DIMM (204P)

DDR3-DIMM1_H=5.2_RVS

JDIM4B

PC2100 DDR3 SDRAM SO-DIMM (204P)

DDR3-DIMM1_H=5.2_RVS

2.48A

Place these Caps near So-Dimm1.

PROJECT : ZYB & ZYBA

Quanta Computer Inc.

Size	Document Number	Rev
	DDRIII SO-DIMM-1	1A
Date: Tuesday, January 19, 2010	Sheet 16 of 51	

DDR_RVS (DDR)

	SA1	SA0
CHA0	0	0
CHA1	0	1
CHB0	1	0
CHB1	1	1

JDIM3A

PC2100 DDR3 SDRAM SO-DIMM (204P)

E@DDR3-DIMM1_H=9.2_RVS

JDIM3B

PC2100 DDR3 SDRAM SO-DIMM (204P)

E@DDR3-DIMM1_H=9.2_RVS

2.48A

Place these Caps near So-Dimm1.

maybe can save

Close to SO-DIMM

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	DDRIII SO-DIMM-1	1A
Date: Tuesday, January 19, 2010	Sheet 17 of 51	

Del CPU XDP Connector

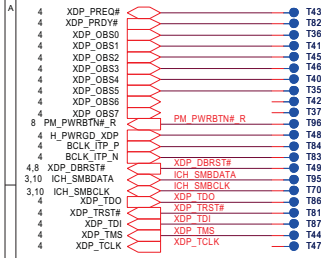

Del Braidwood

18

S3 leakage solution(CLG)

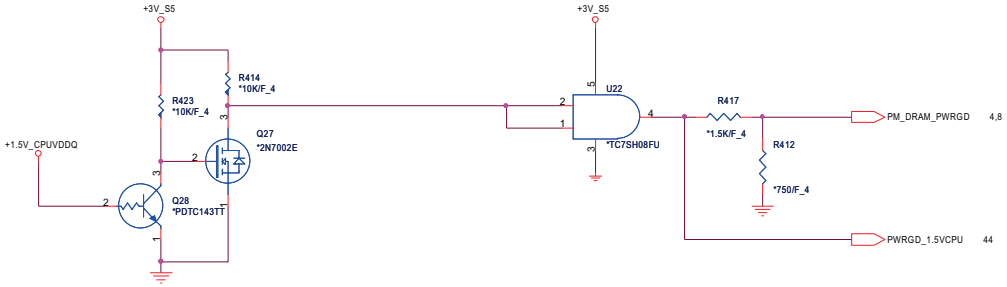

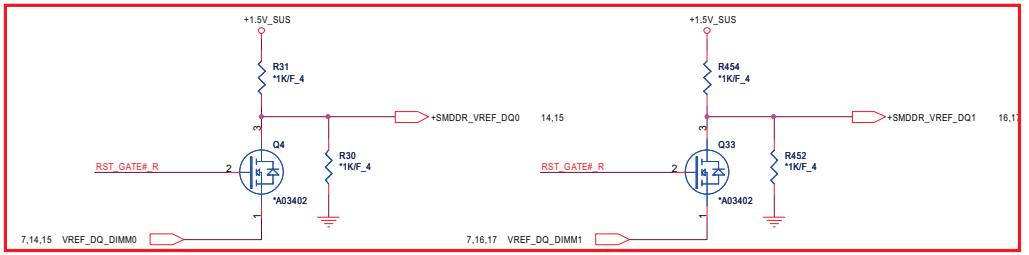

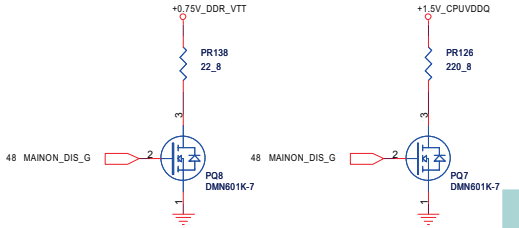

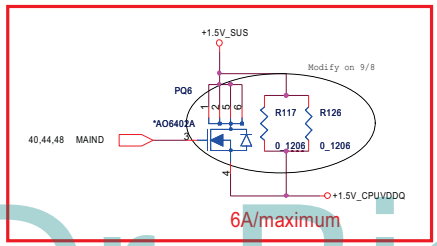

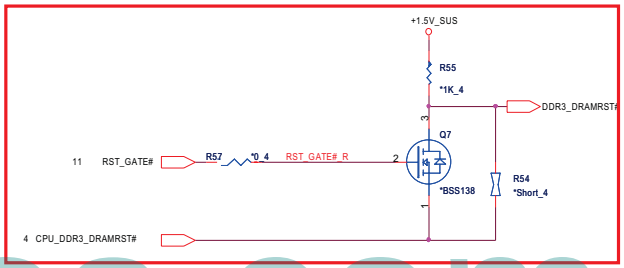

PROJECT : ZYB & ZYBA Quanta Computer Inc.		
Size	Document Number XDP	Rev 1A
Date: Tuesday, January 19, 2010	Sheet 18 of 51	

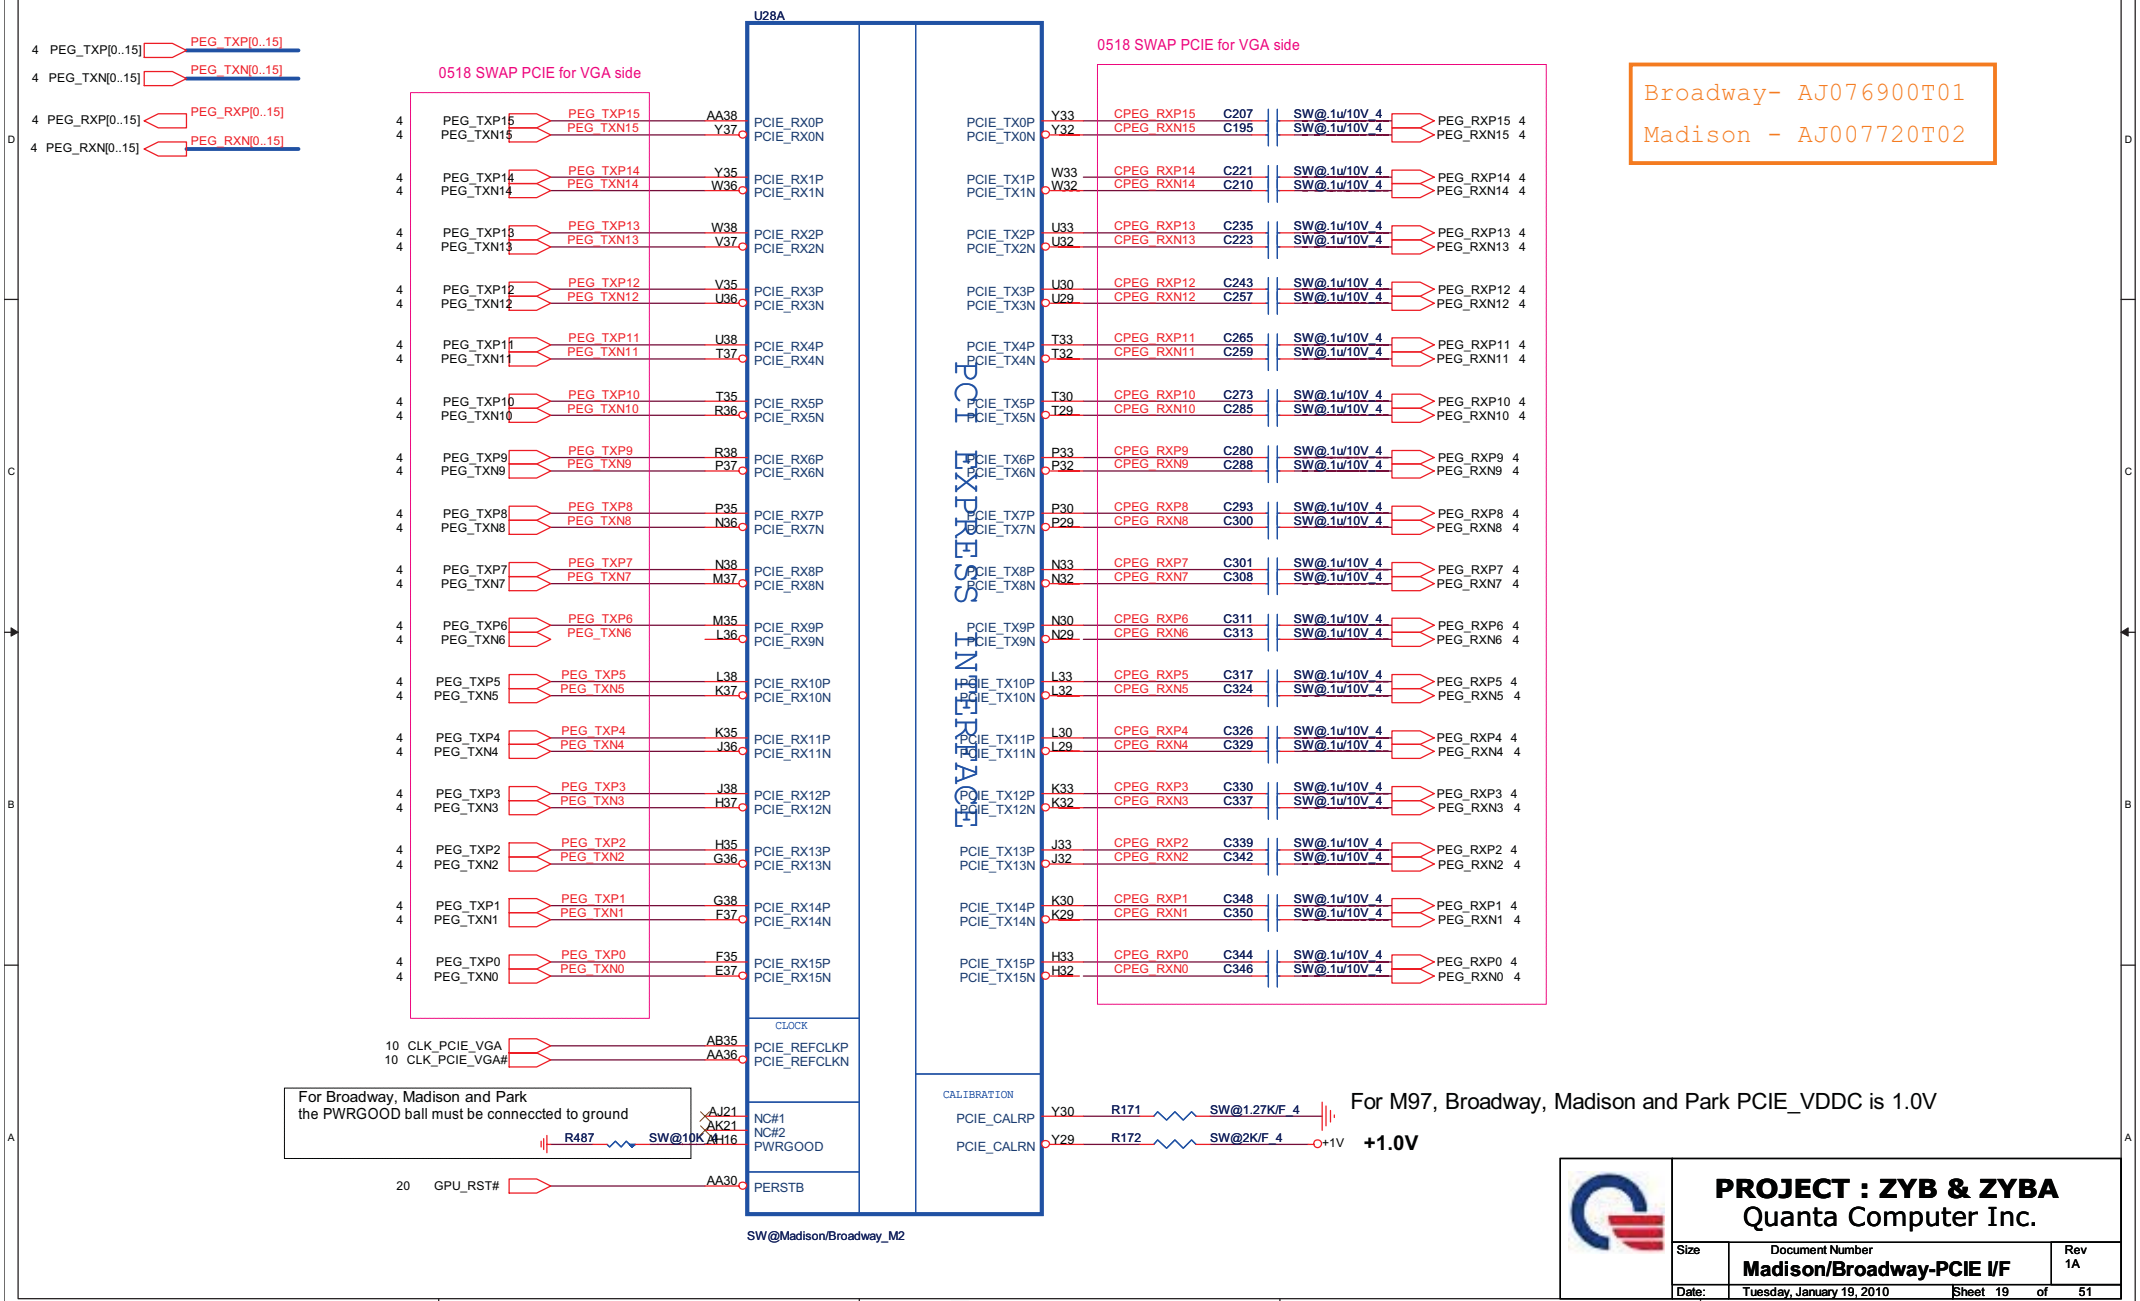
U28A
0518 SWAP PCIE for VGA side
0518 SWAP PCIE for VGA side
PCI EXPRESS INTERFACE
CLOCK
CALIBRATION
PERSTB
PWRGOOD
NC#1
NC#2
SW@Madison/Broadway_M2
For Broadway, Madison and Park
the PWRGOOD ball must be connecctd to ground
R487
SW@10K/F_4
For M97, Broadway, Madison and Park PCIE_VDDC is 1.0V
+1.0V
Broadway- AJ076900T01
Madison - AJ007720T02
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Madison/Broadway-PCIE I/F
Rev 1A
Tuesday, January 19, 2010
Sheet 19 of 51

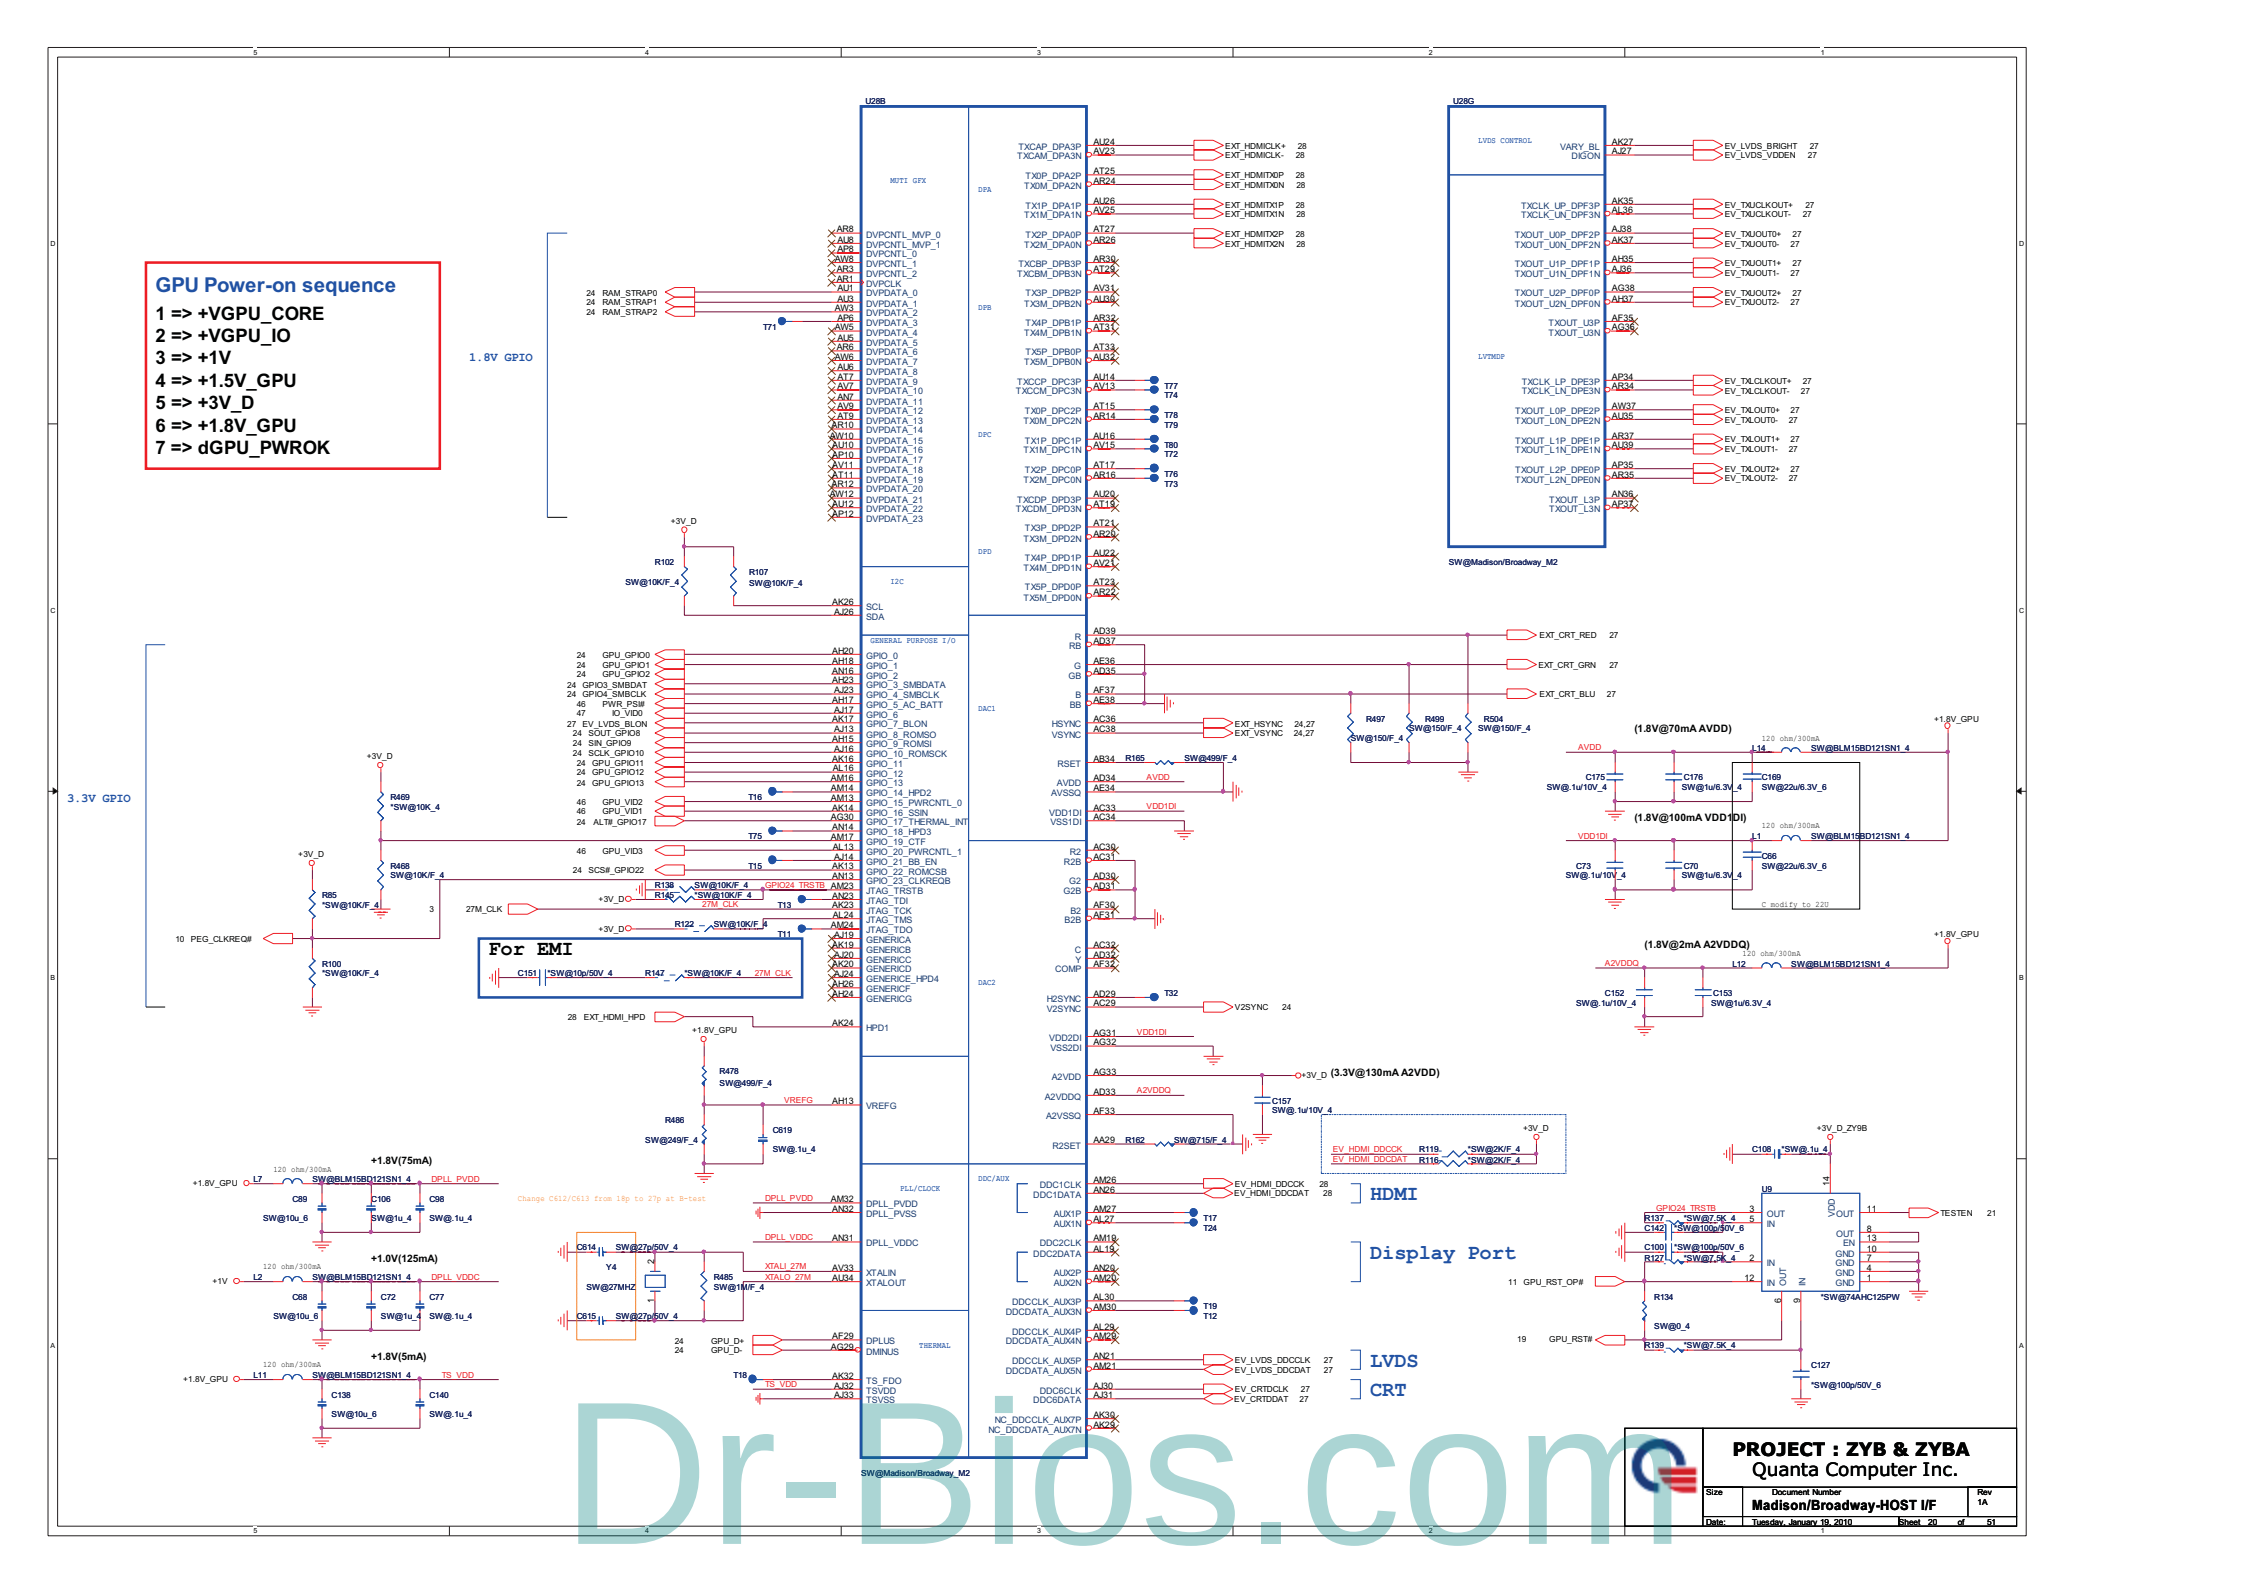
GPU Power-on sequence
1 => +VGPU_CORE
2 => +VGPU_IO
3 => +1V
4 => +1.5V_GPU
5 => +3V_D
6 => +1.8V_GPU
7 => dGPU_PWROK
1.8V GPIO
3.3V GPIO
U28B
MUTI GPX
I2C
GENERAL PURPOSE I/O
PLL/CLOCK
THERMAL
DDC/AUX
DPA
DPB
DPC
DPD
DAC1
DAC2
HPD1
VREFG
SW@Madison/Broadway_M2
U28G
LVDS CONTROL
LVTMDP
SW@Madison/Broadway_M2
For EMI
HDMI
Display Port
LVDS
CRT
(1.8V@70mA AVDD)
(1.8V@100mA VDD1DI)
(1.8V@2mA A2VDDQ)
(3.3V@130mA A2VDD)
+1.8V(75mA)
+1.0V(125mA)
+1.8V(5mA)
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Madison/Broadway-HOST I/F
Rev 1A
Tuesday, January 19, 2010
Sheet 20 of 51

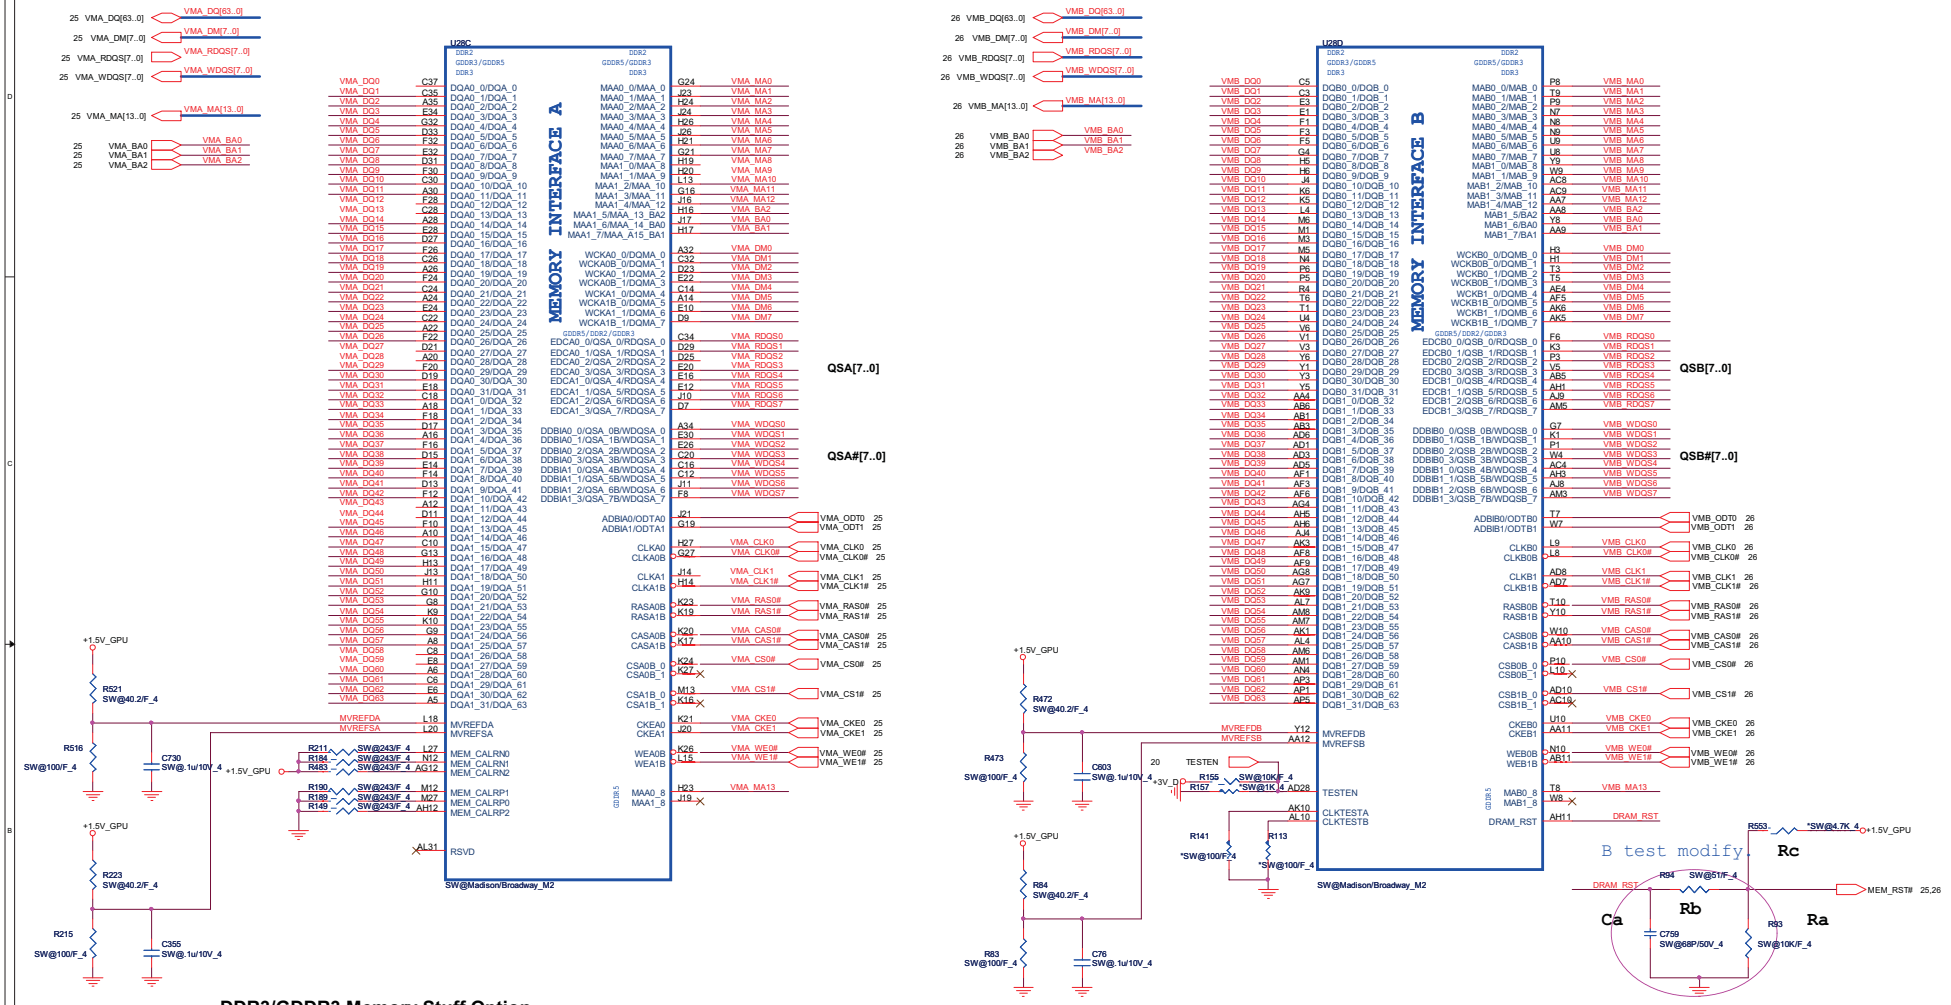

DDR3/GDDR3 Memory Stuff Option

	GDDR5	GDDR3	DDR3
+1.5V_VGA	1.5V	1.8V/1.5V	1.5V
Ra	40.2R	40.2R	40.2R
Rb	100R	100R	100R

Designator	For M97-M2	For Mannhatton
Ra	10K	10K
Rb	0R/Short	51R
Rc	DNI	DNI
Ca	2.2nF	68pF

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Madison/Broadway-MEM I/F	1A
Date: Tuesday, January 19, 2010	Sheet 21 of 51	

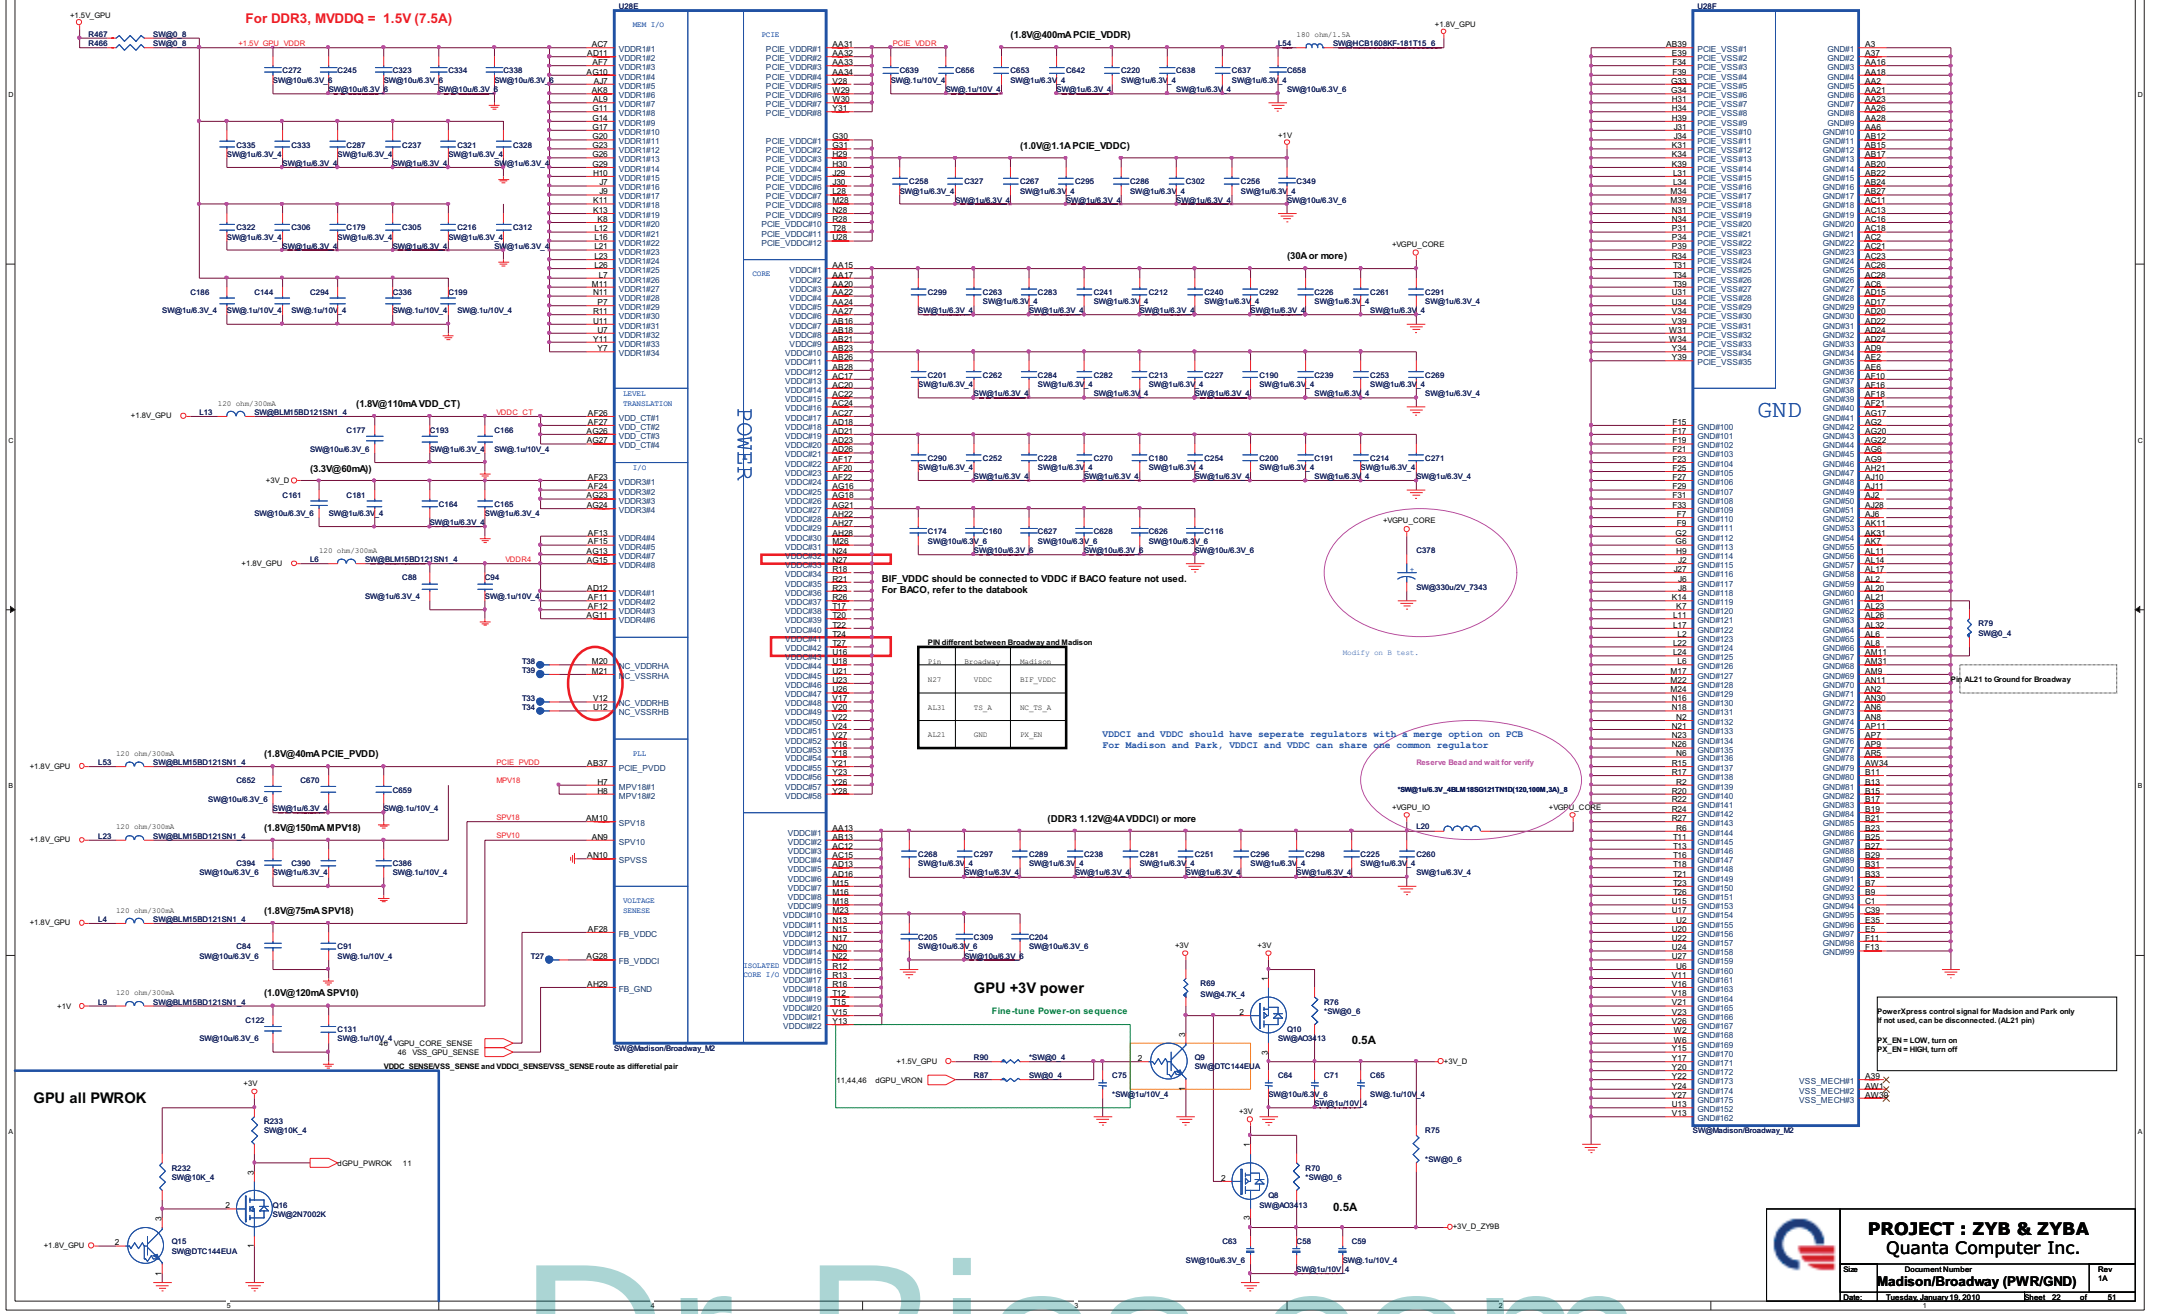
For DDR3, MVDDQ = 1.5V (7.5A)
(1.8V@110mA VDD_CT)
(3.3V@60mA))
(1.8V@40mA PCIE_PVDD)
(1.8V@150mA MPV18)
(1.8V@75mA SPV18)
(1.0V@120mA SPV10)
(1.8V@400mA PCIE_VDDR)
(1.0V@1.1A PCIE_VDDC)
(30A or more)
(DDR3 1.12V@4A VDDCI) or more
BIF_VDDC should be connected to VDDC if BACO feature not used.
For BACO, refer to the databook
PIN different between Broadway and Madison
VDDCI and VDDC should have seperate regulators with a merge option on PCB
For Madison and Park, VDDCI and VDDC can share one common regulator
GPU +3V power
Fine-tune Power-on sequence
GPU all PWROK
VDDC_SENSE/VSS_SENSE and VDDCI_SENSE/VSS_SENSE route as differetial pair
Pin AL21 to Ground for Broadway
PowerXpress control signal for Madison and Park only
If not used, can be disconnected. (AL21 pin)
PX_EN = LOW, turn on
PX_EN = HIGH, turn off
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Madison/Broadway (PWR/GND)
Tuesday, January 19, 2010

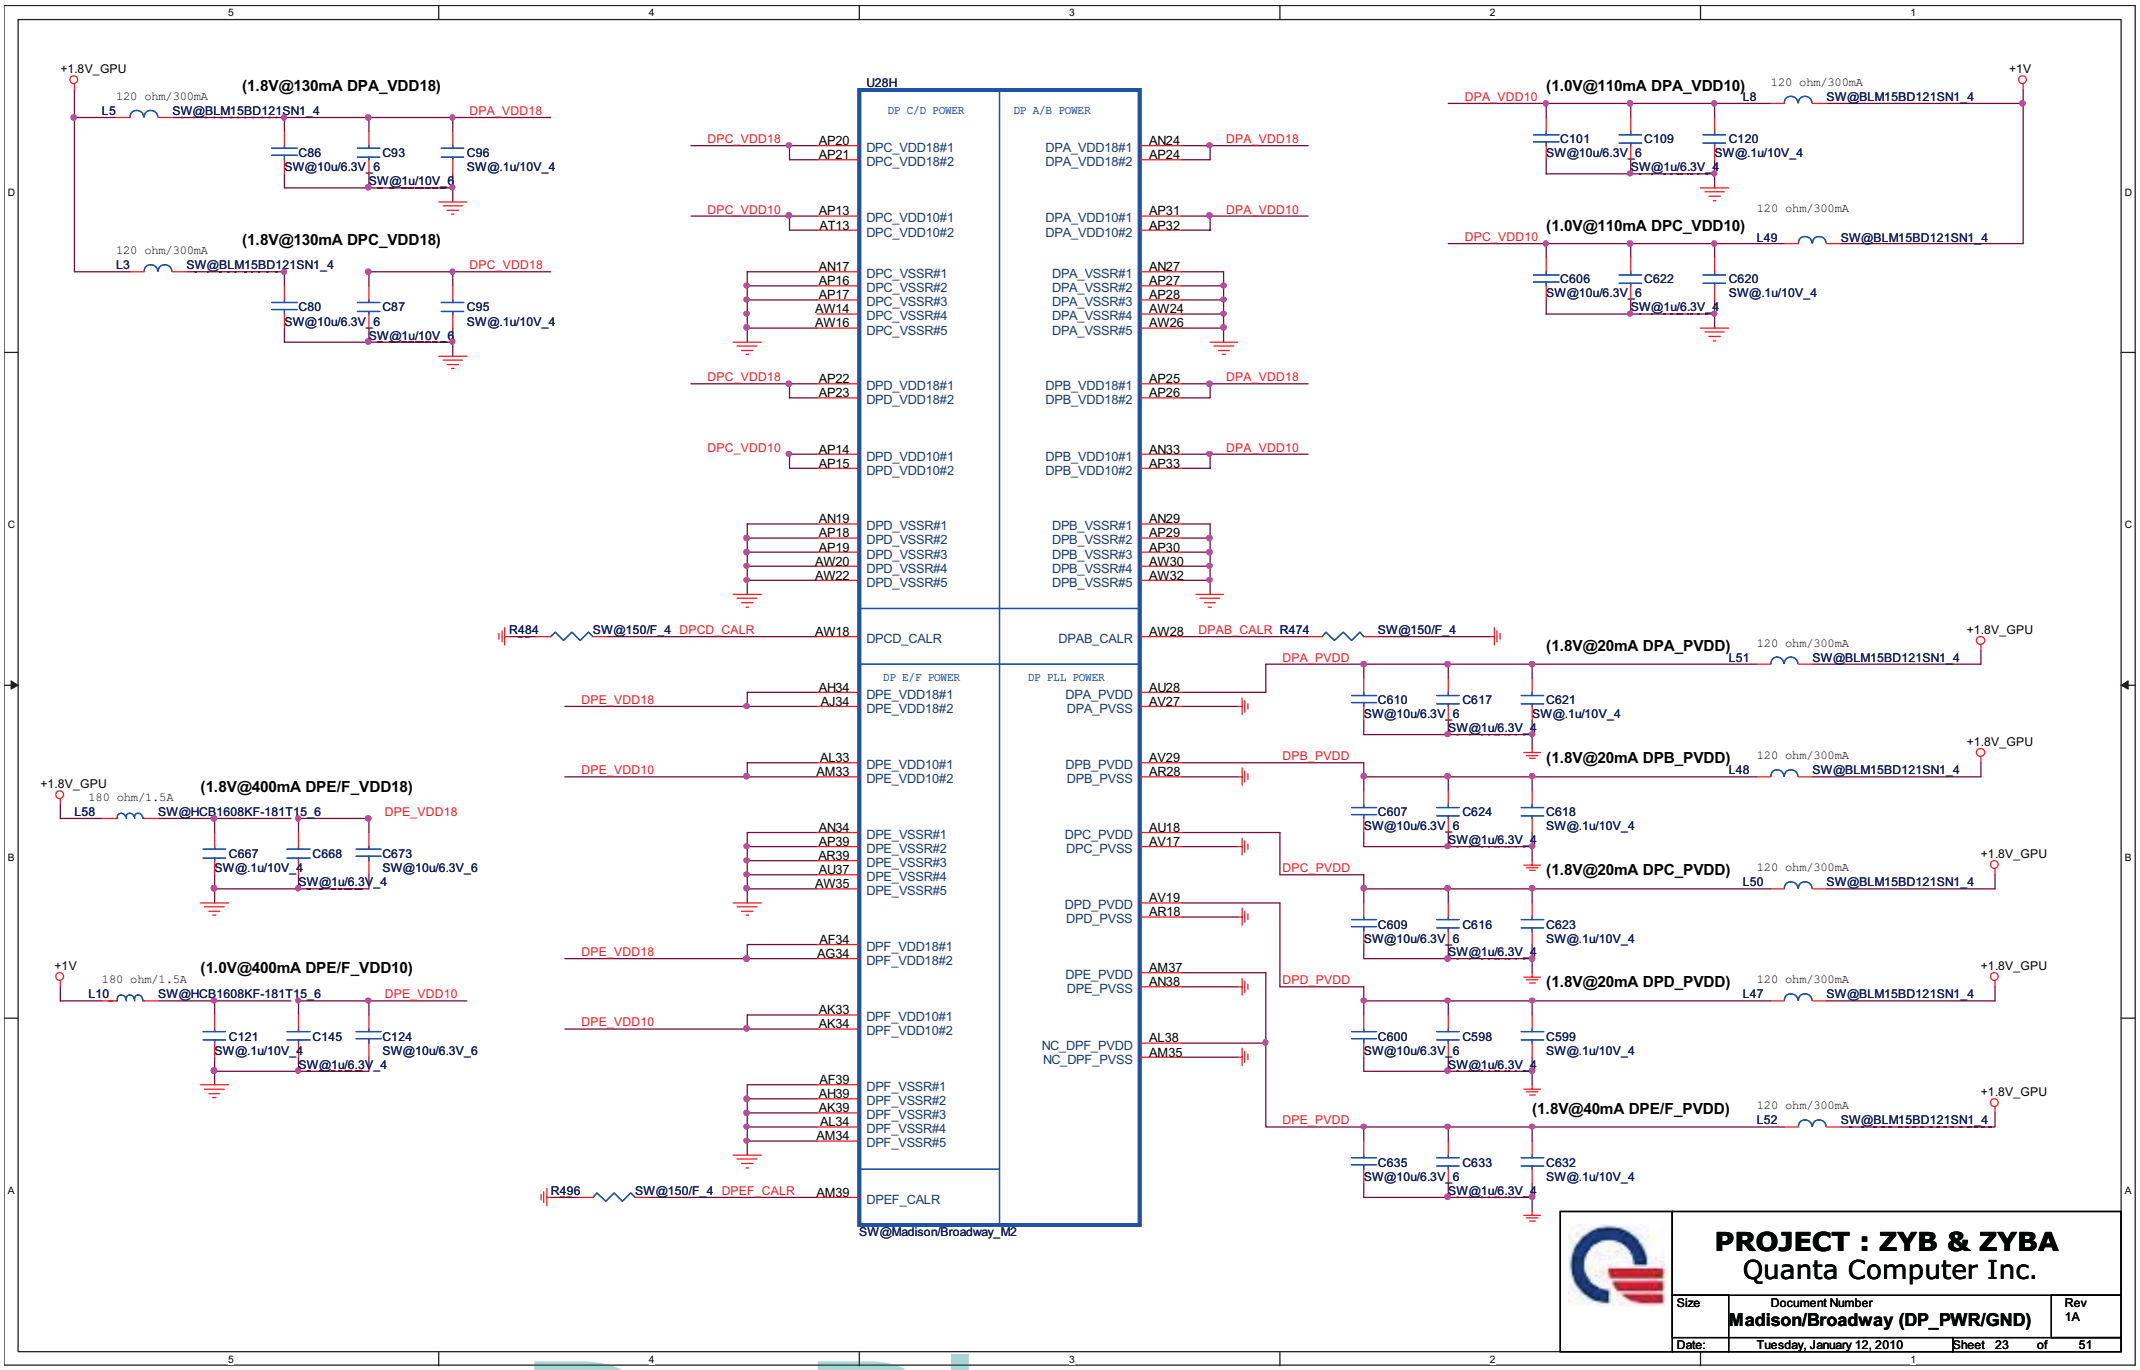
+1.8V_GPU
(1.8V@130mA DPA_VDD18)
120 ohm/300mA
L5 SW@BLM15BD121SN1_4
DPA_VDD18
C86 SW@10u/6.3V_6
C93 SW@1u/10V_6
C96 SW@.1u/10V_4
(1.8V@130mA DPC_VDD18)
L3 SW@BLM15BD121SN1_4
DPC_VDD18
C80 SW@10u/6.3V_6
C87 SW@1u/10V_6
C95 SW@.1u/10V_4
+1.8V_GPU
(1.8V@400mA DPE/F_VDD18)
180 ohm/1.5A
L58 SW@HCB1608KF-181T15_6
DPE_VDD18
C667 SW@.1u/10V_4
C668 SW@1u/6.3V_4
C673 SW@10u/6.3V_6
+1V
(1.0V@400mA DPE/F_VDD10)
180 ohm/1.5A
L10 SW@HCB1608KF-181T15_6
DPE_VDD10
C121 SW@.1u/10V_4
C145 SW@1u/6.3V_4
C124 SW@10u/6.3V_6
U28H
DP C/D POWER
DP A/B POWER
DPC_VDD18
AP20 DPC_VDD18#1
AP21 DPC_VDD18#2
DPA_VDD18#1 AN24
DPA_VDD18#2 AP24
DPA_VDD18
DPC_VDD10
AP13 DPC_VDD10#1
AT13 DPC_VDD10#2
DPA_VDD10#1 AP31
DPA_VDD10#2 AP32
DPA_VDD10
AN17 DPC_VSSR#1
AP16 DPC_VSSR#2
AP17 DPC_VSSR#3
AW14 DPC_VSSR#4
AW16 DPC_VSSR#5
DPA_VSSR#1 AN27
DPA_VSSR#2 AP27
DPA_VSSR#3 AP28
DPA_VSSR#4 AW24
DPA_VSSR#5 AW26
DPC_VDD18
AP22 DPD_VDD18#1
AP23 DPD_VDD18#2
DPB_VDD18#1 AP25
DPB_VDD18#2 AP26
DPA_VDD18
DPC_VDD10
AP14 DPD_VDD10#1
AP15 DPD_VDD10#2
DPB_VDD10#1 AN33
DPB_VDD10#2 AP33
DPA_VDD10
AN19 DPD_VSSR#1
AP18 DPD_VSSR#2
AP19 DPD_VSSR#3
AW20 DPD_VSSR#4
AW22 DPD_VSSR#5
DPB_VSSR#1 AN29
DPB_VSSR#2 AP29
DPB_VSSR#3 AP30
DPB_VSSR#4 AW30
DPB_VSSR#5 AW32
R484 SW@150/F_4 DPCD_CALR
AW18 DPCD_CALR
DPAB_CALR AW28
DPAB_CALR R474 SW@150/F_4
DP E/F POWER
DP PLL POWER
DPE_VDD18
AH34 DPE_VDD18#1
AJ34 DPE_VDD18#2
DPA_PVDD AU28
DPA_PVSS AV27
DPE_VDD10
AL33 DPE_VDD10#1
AM33 DPE_VDD10#2
DPB_PVDD AV29
DPB_PVSS AR28
AN34 DPE_VSSR#1
AP39 DPE_VSSR#2
AR39 DPE_VSSR#3
AU37 DPE_VSSR#4
AW35 DPE_VSSR#5
DPC_PVDD AU18
DPC_PVSS AV17
DPD_PVDD AV19
DPD_PVSS AR18
DPE_VDD18
AF34 DPF_VDD18#1
AG34 DPF_VDD18#2
DPE_PVDD AM37
DPE_PVSS AN38
DPE_VDD10
AK33 DPF_VDD10#1
AK34 DPF_VDD10#2
NC_DPF_PVDD AL38
NC_DPF_PVSS AM35
AF39 DPF_VSSR#1
AH39 DPF_VSSR#2
AK39 DPF_VSSR#3
AL34 DPF_VSSR#4
AM34 DPF_VSSR#5
R496 SW@150/F_4 DPEF_CALR
AM39 DPEF_CALR
SW@Madison/Broadway_M2
+1V
(1.0V@110mA DPA_VDD10)
120 ohm/300mA
DPA_VDD10
L8 SW@BLM15BD121SN1_4
C101 SW@10u/6.3V_6
C109 SW@1u/6.3V_4
C120 SW@.1u/10V_4
(1.0V@110mA DPC_VDD10)
DPC_VDD10
L49 SW@BLM15BD121SN1_4
C606 SW@10u/6.3V_6
C622 SW@1u/6.3V_4
C620 SW@.1u/10V_4
+1.8V_GPU
(1.8V@20mA DPA_PVDD)
DPA_PVDD
L51 SW@BLM15BD121SN1_4
C610 SW@10u/6.3V_6
C617 SW@1u/6.3V_4
C621 SW@.1u/10V_4
(1.8V@20mA DPB_PVDD)
DPB_PVDD
L48 SW@BLM15BD121SN1_4
C607 SW@10u/6.3V_6
C624 SW@1u/6.3V_4
C618 SW@.1u/10V_4
(1.8V@20mA DPC_PVDD)
DPC_PVDD
L50 SW@BLM15BD121SN1_4
C609 SW@10u/6.3V_6
C616 SW@1u/6.3V_4
C623 SW@.1u/10V_4
(1.8V@20mA DPD_PVDD)
DPD_PVDD
L47 SW@BLM15BD121SN1_4
C600 SW@10u/6.3V_6
C598 SW@1u/6.3V_4
C599 SW@.1u/10V_4
(1.8V@40mA DPE/F_PVDD)
DPE_PVDD
L52 SW@BLM15BD121SN1_4
C635 SW@10u/6.3V_6
C633 SW@1u/6.3V_4
C632 SW@.1u/10V_4
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Size
Document Number
Madison/Broadway (DP_PWR/GND)
Rev
1A
Date: Tuesday, January 12, 2010
Sheet 23 of 51

PIN STRAPS

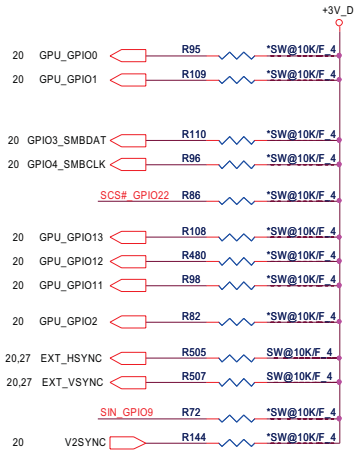

Memory Aperture size	
GPIO[13:11]	Size
000	128MB
001	256MB
010	64MB
011	32MB

Audio Table		
EXT_HSYNC	EXT_VSYNC	Discription
0	0	No Audio
0	1	Any one by dectec
1	0	DP only
1	1	Both DP & HDMI

CONFIGURATION STRAPS

ALLOW FOR PULLUP PADS FOR THESE STRAPS AND IF THESE GPIOS ARE USED, THEY MUST NOT CONFLICT DURING RESET

STRAPS	PIN	DESCRIPTION OF DEFAULT SETTINGS	DEFAULT	REMARK
TX_PWRS_ENB	GPIO0	0 = 50% TX OUTPUT SWING 1 = FULL TX OUTPUT SWING	0	
TX_DEEMPH_EN	GPIO1	PCIE TRANSMITTER DE-EMPHASIS ENABLED 0 = TX DE-EMPHASIS DISABLED 1 = TX DE-EMPHASIS ENABLED	0	
BIOS_ROM_EN	GPIO_22_ROMCSB	ENABLE EXTERNAL BIOS ROM 0 = DISABLE 1 = ENABLE	0	
ROMIDCFG(2:0)	GPIO[13:11]	SERIAL ROM TYPE OR MEMORY APERTURE SIZE SELECT	000	See Memory Aperture size
BIF_GEN2_EN_A	GPIO2	0 = PCIE DEVICE AS 2.5GT/S CAPABLE 1 = PCIE DEVICE AS 5GT/S CAPABLE	0	
GPIO_8_ROMSO H2SYNC GPIO_21_BB_EN	GPIO8 H2SYNC GPIO21	Reserved Only	0	
AUD[1] AUD[0]	HSYNC VSYNC	AUD[1:0] 00: NO AUDIO FUNCTION. 01: AUDIO FOR DISPLAYPORT AND HDMI IF ADAPTER IS DETECTED. 10: AUDIO FOR DISPLAYPORT ONLY. 11: AUDIO FOR BOTH DISPLAYPORT AND HDMI.	11	See Audio table
GPIO_9_ROMSI	GPIO9	0 = VGA controller capacity enable	0	
VIP_DEVICE_STRAP_ENA	V2SYNC	0 = DRIVER would ignore the value sample on VHAD_0 during RESET.	0	

EEPROM

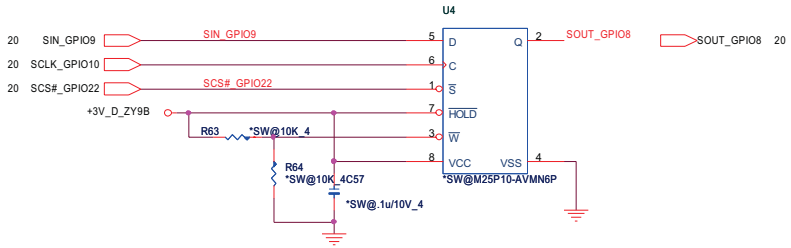

Thermal Sensor

Vendor	P/N
WINDBOND	AL83L771K01
GMT	AL000780000

USD0.16

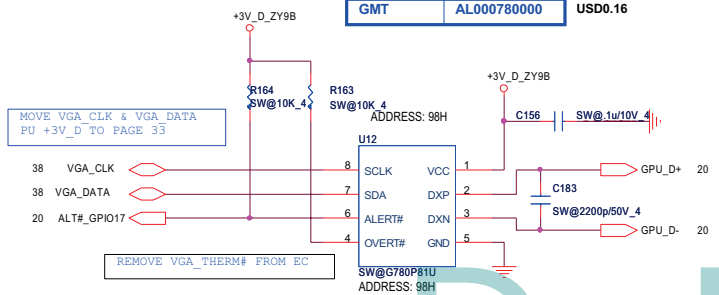

DDR3 VRAM SIZE Strap

DDR3 VRAM size						
Vendor	Vendor P/N	STN B/S P/N	Size	RAM_STRAP2 DVPDATA_2	RAM_STRAP1 DVPDATA_1	RAM_STRAP0 DVPDATA_0
Hynix			512MB	1	1	0
	H5TQ1G63BFR-12C	AKD5LZGTW04 (64M*16)	1GB	1	0	0
			2GB	1	0	1
Samsung			512MB	0	1	0
	K4W1G1646E-HC12	AKD5LGGT506 (64M*16)	1GB	0	0	0
	K4W2G1646B-HC12	AKD5MGGT500	2GB	0	0	1
AMD	23EY2387MA-12	AKD5LGGT700		0	1	0

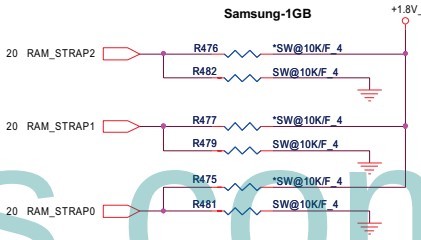

RAM_STRAP2 SET DDR3 Vendor
RAM_STRAP[1:0] SET SIZE.

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Strip/Thermal	1A
Date: Tuesday, January 19, 2010	Sheet 24 of 51	

CHANNEL A: 512MB DDR3 (64M*16*4pcs)

Park, M92M Use Channel B Memory Interface Only

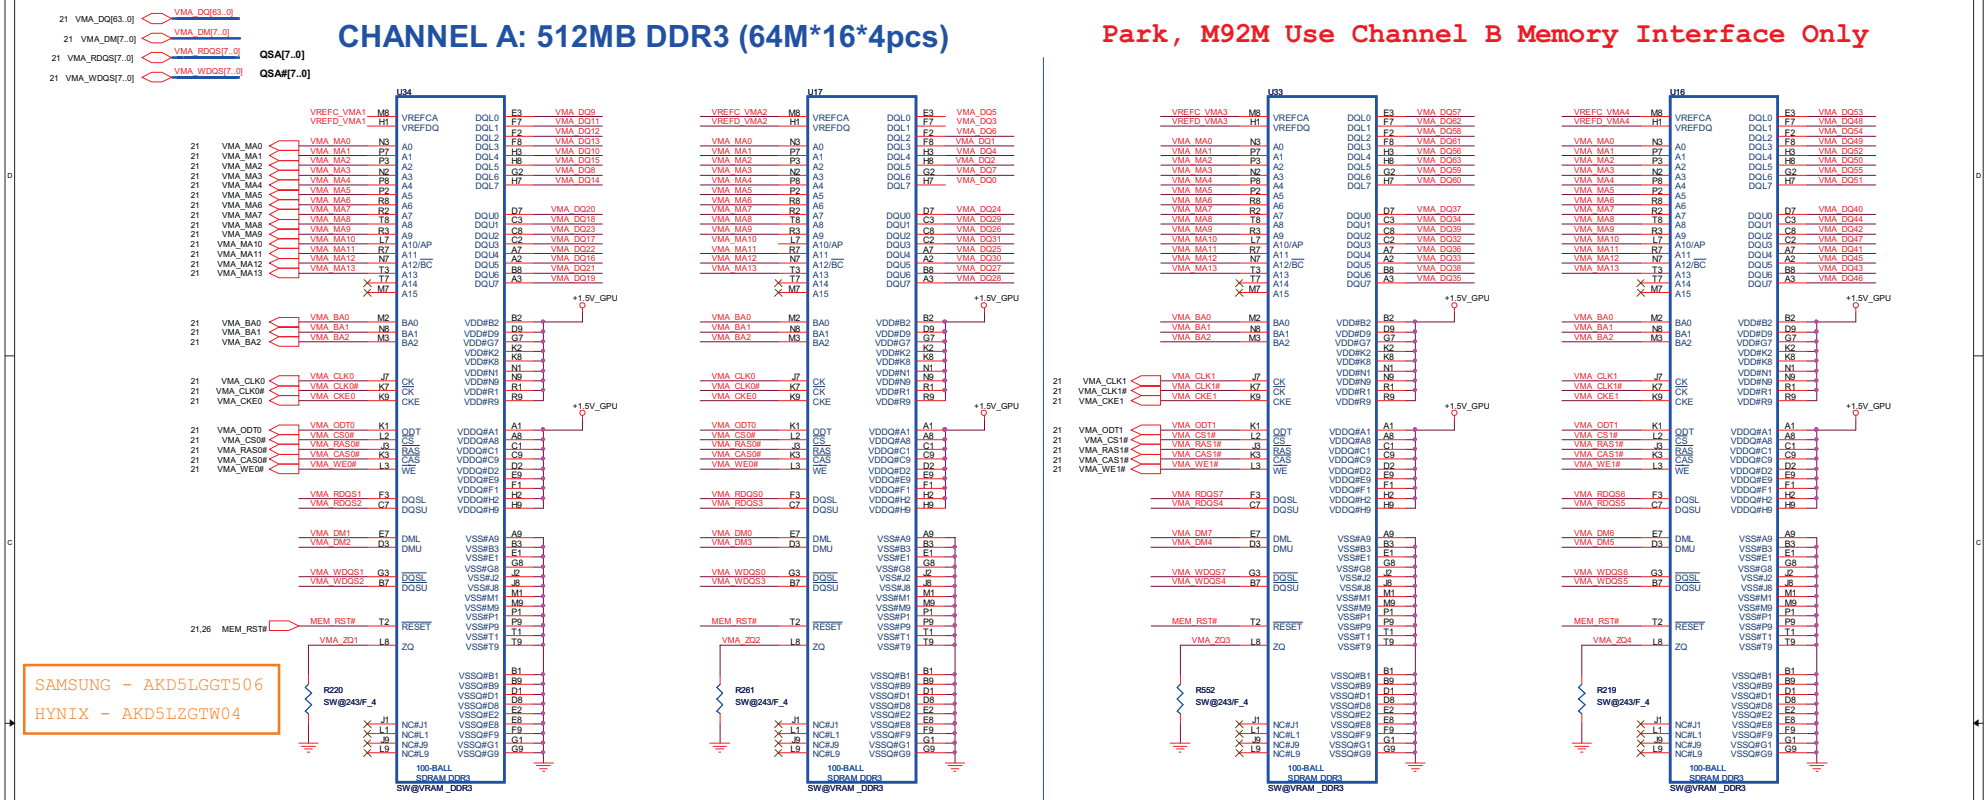

Group-A0 VREF

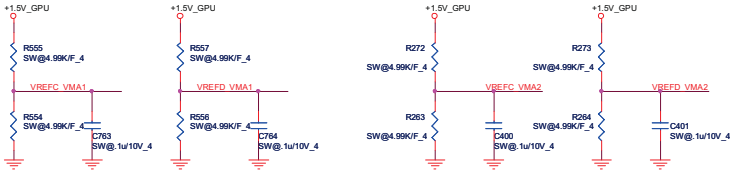

Group-A1 VREF

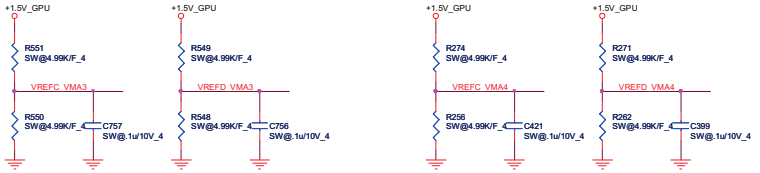

MEM_A0 CLK

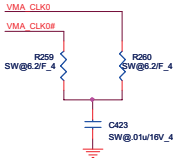

Group-A0 decoupling CAP

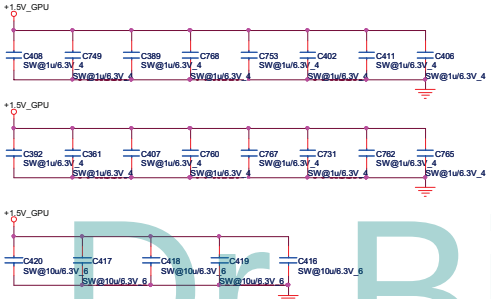

Group-A1 decoupling CAP

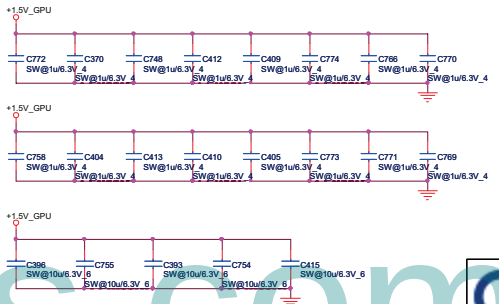

MEM_A1 CLK

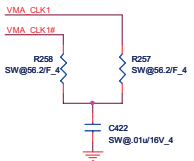

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	MEMORY 1 channel A	1A
Date: Tuesday, January 19, 2010	Sheet 25 of 51	

CHANNEL B: 512MB DDR3 (64M*16*4pcs)

Park, M92M Use Channel B Memory Interface Only

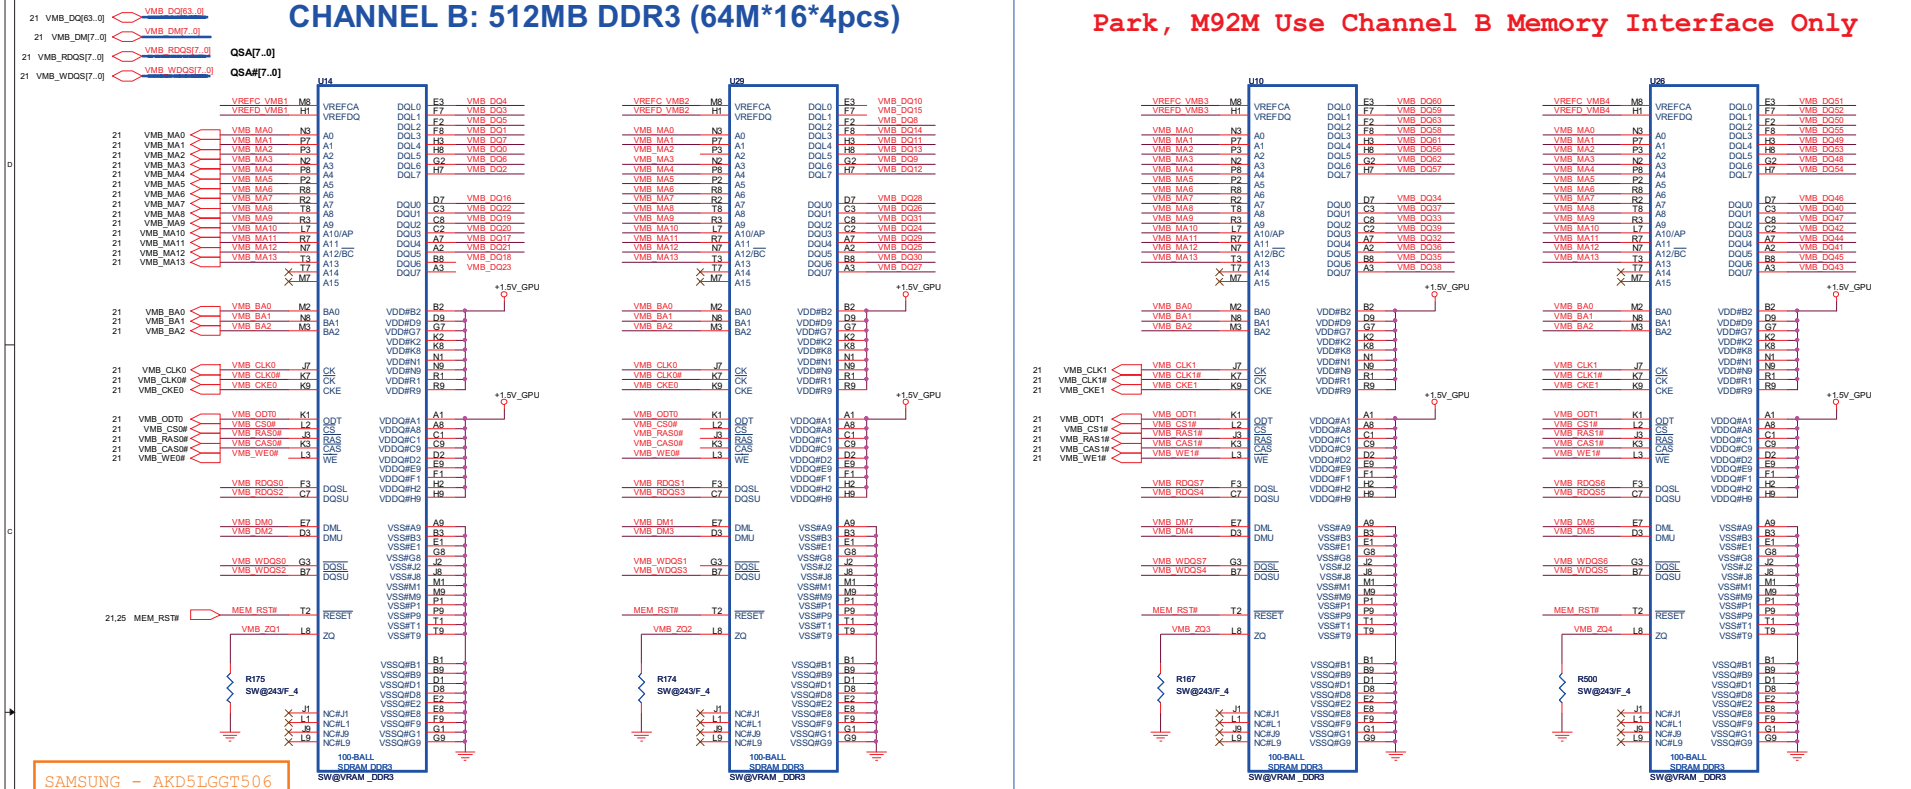

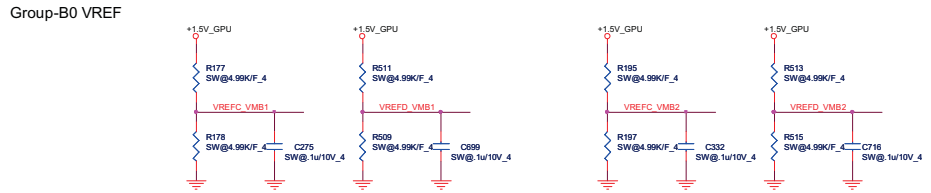

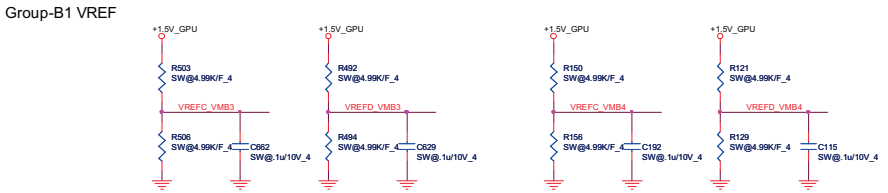

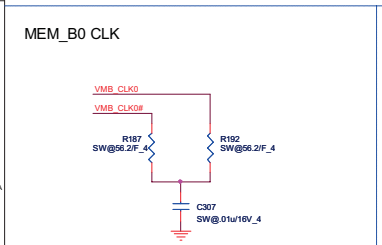

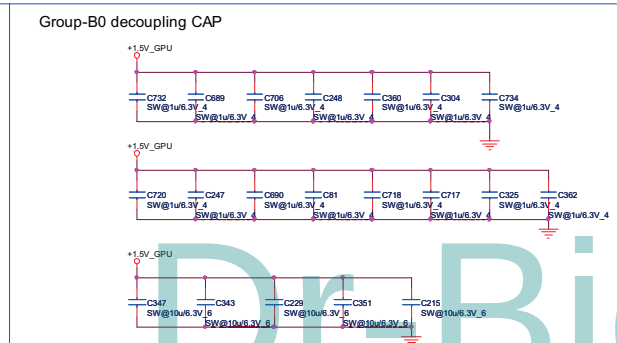

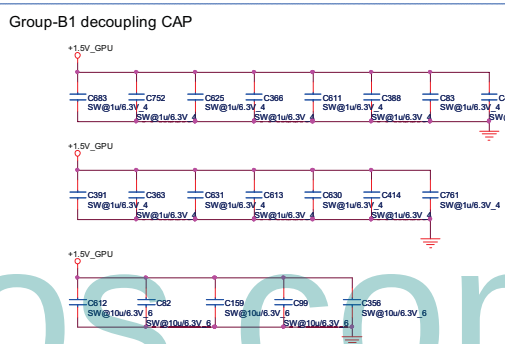

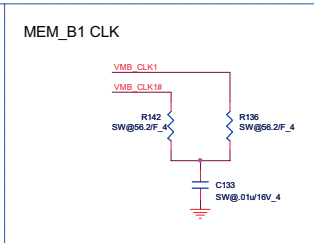

PROJECT : ZYB & ZYBA		
Quanta Computer Inc.		
Size	Document Number: MEMORY 2 channel B	Rev: 1A
Date: Tuesday, January 19, 2010	Sheet 26 of 51	

CRT SWITCH(CRT)

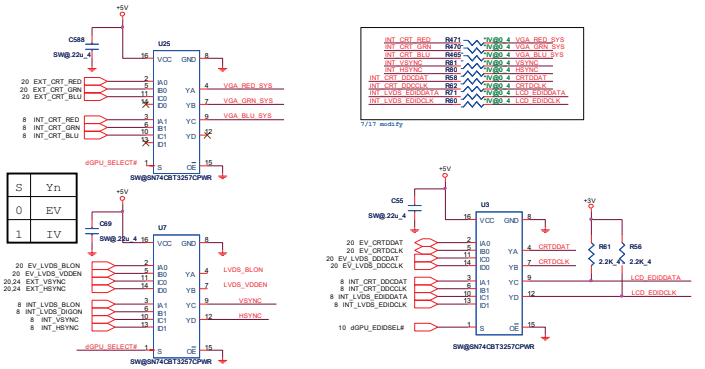

S	Yn
0	EV
1	IV

CRT(CRT)

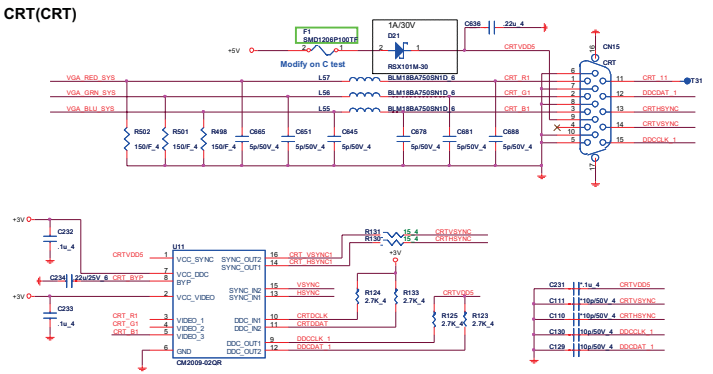

LVDS(LDS)

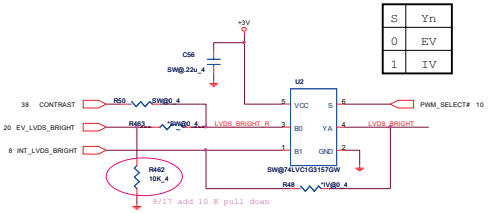

S	Yn
0	EV
1	IV

LCD Power(LDS)

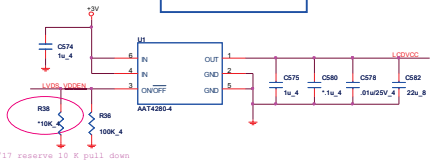

Backlight Control(LDS)

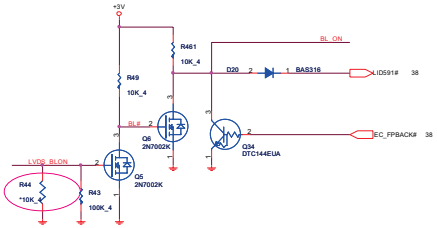

LVDS SW1

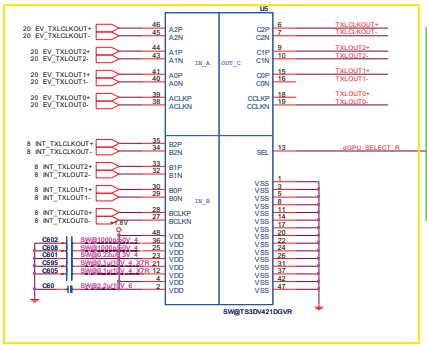

LVDS SW2

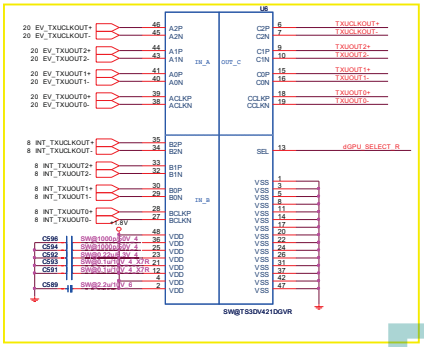

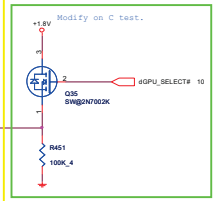

dGPU_SELECT#	Output
L	EV_LVDS
H	INT_LVDS

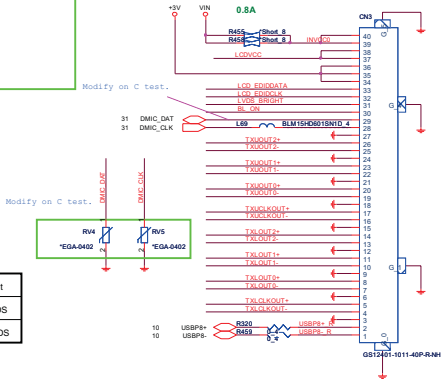

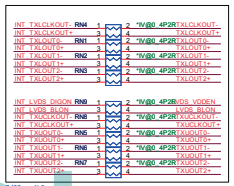

Lid Switch (HSR)

12/29
Add R1 and C5 prevent S3 issue.

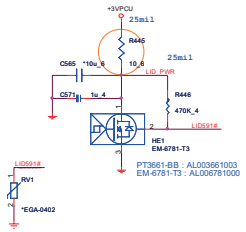

PT3661-BB : AL003661003
EM-6781-T3 : AL006781000

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	CRT/LVDS/LID	1A

Date: Tuesday, January 19, 2010 Sheet 27 of 51

HDMI HPD(HDM)

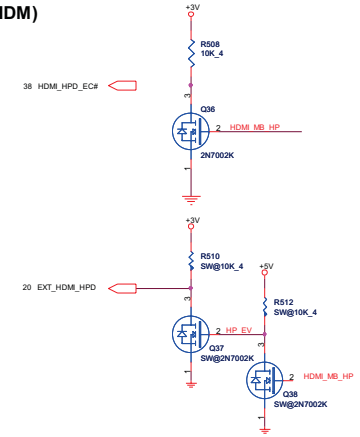

(HDM)

From EXT VGA

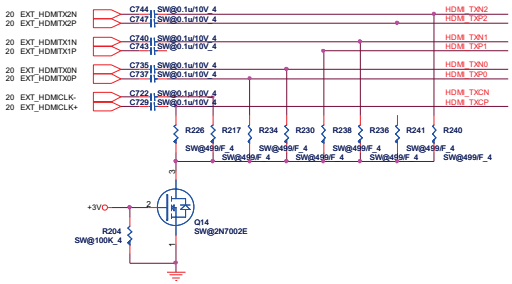

HDMI LEVEL SHIFTER(HDM)

PS8101 :: AL008101000

UMA => PS8101 Exist
SG and Dis only => PS8101 del

28

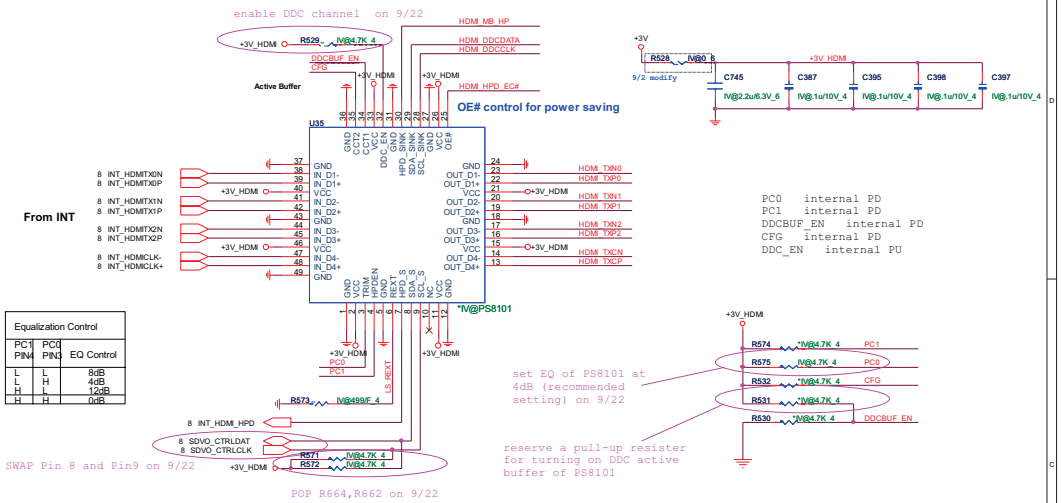

Equalization Control		
PC1 PIN4	PC0 PIN3	EQ Control
L	L	8dB
L	H	4dB
H	L	12dB
H	H	0dB

EMI reserve for HDMI(HDM)

Close connector

ESD Protect

close to HDMI connector

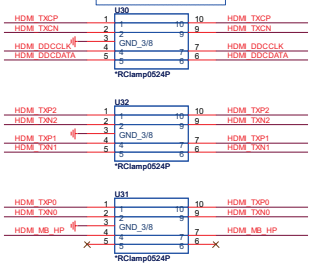

HDMI connector(HDM)

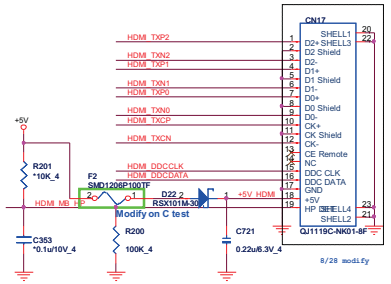

(HDM)

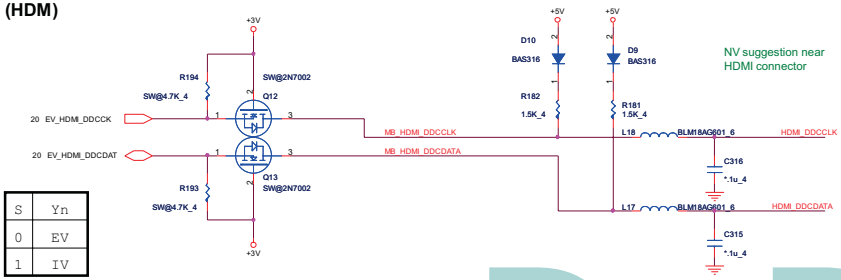

S	Yn
0	EV
1	IV

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	HDMI/DP	1A
Date: Tuesday, January 19, 2010	Sheet 28 of 51	

AU6433 CardReader(MMC)

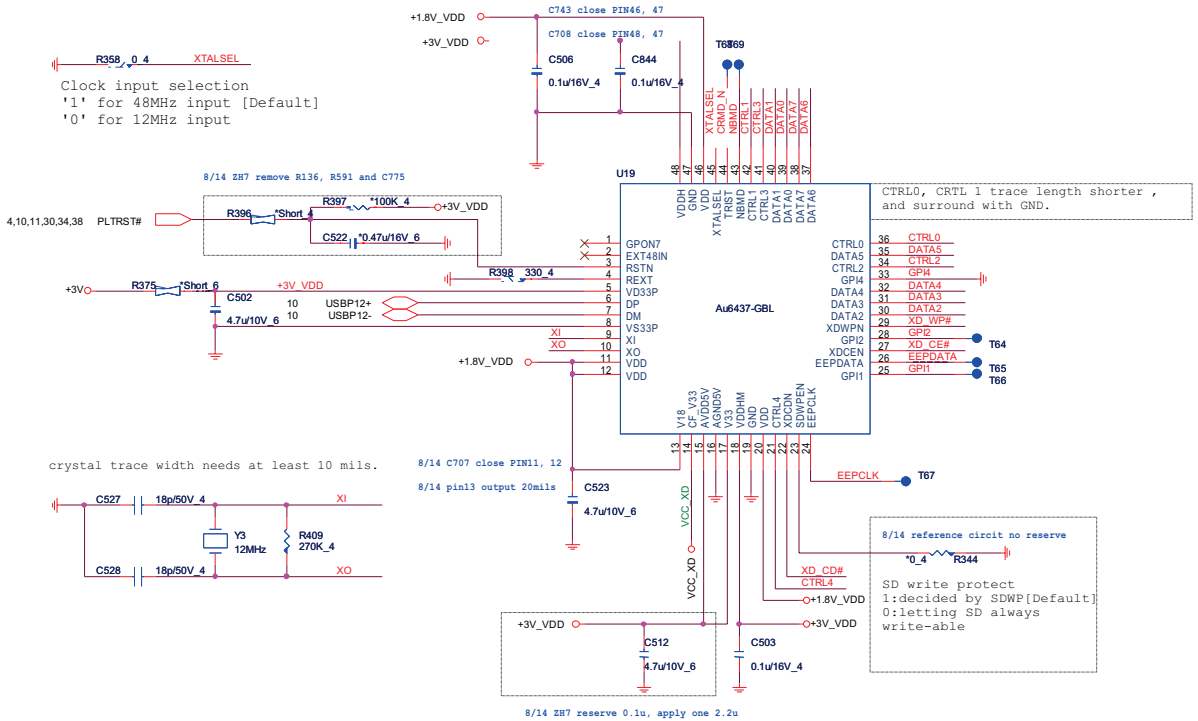

4 IN 1 CARD READER (MMC)

29

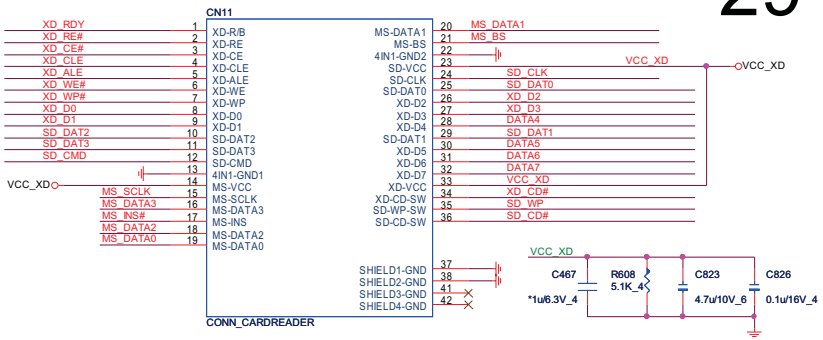

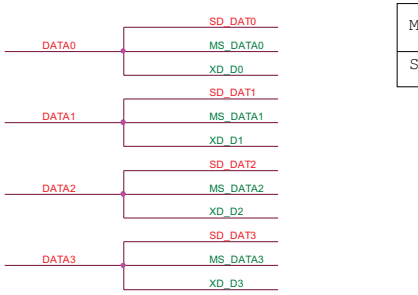

Main	DFHD36MS017
Second	DFHD38MS013

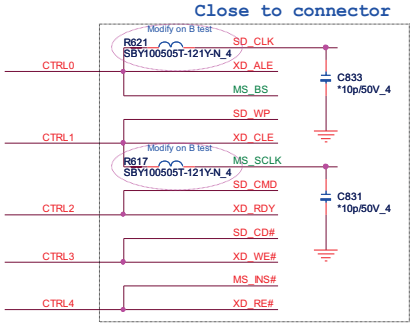

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	AU6433 CardReader	1A
Date: Tuesday, January 19, 2010	Sheet 29 of 51	

Lan/B(LAN)

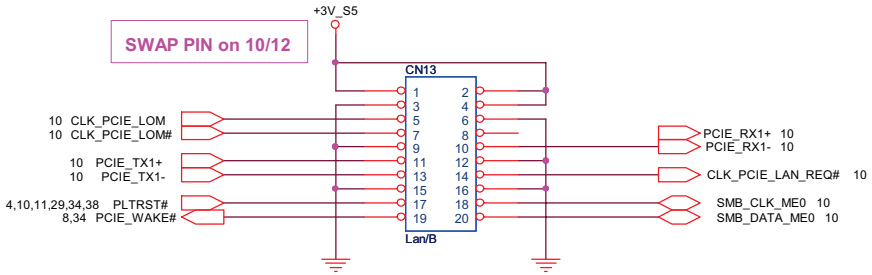

Hole(OTH)

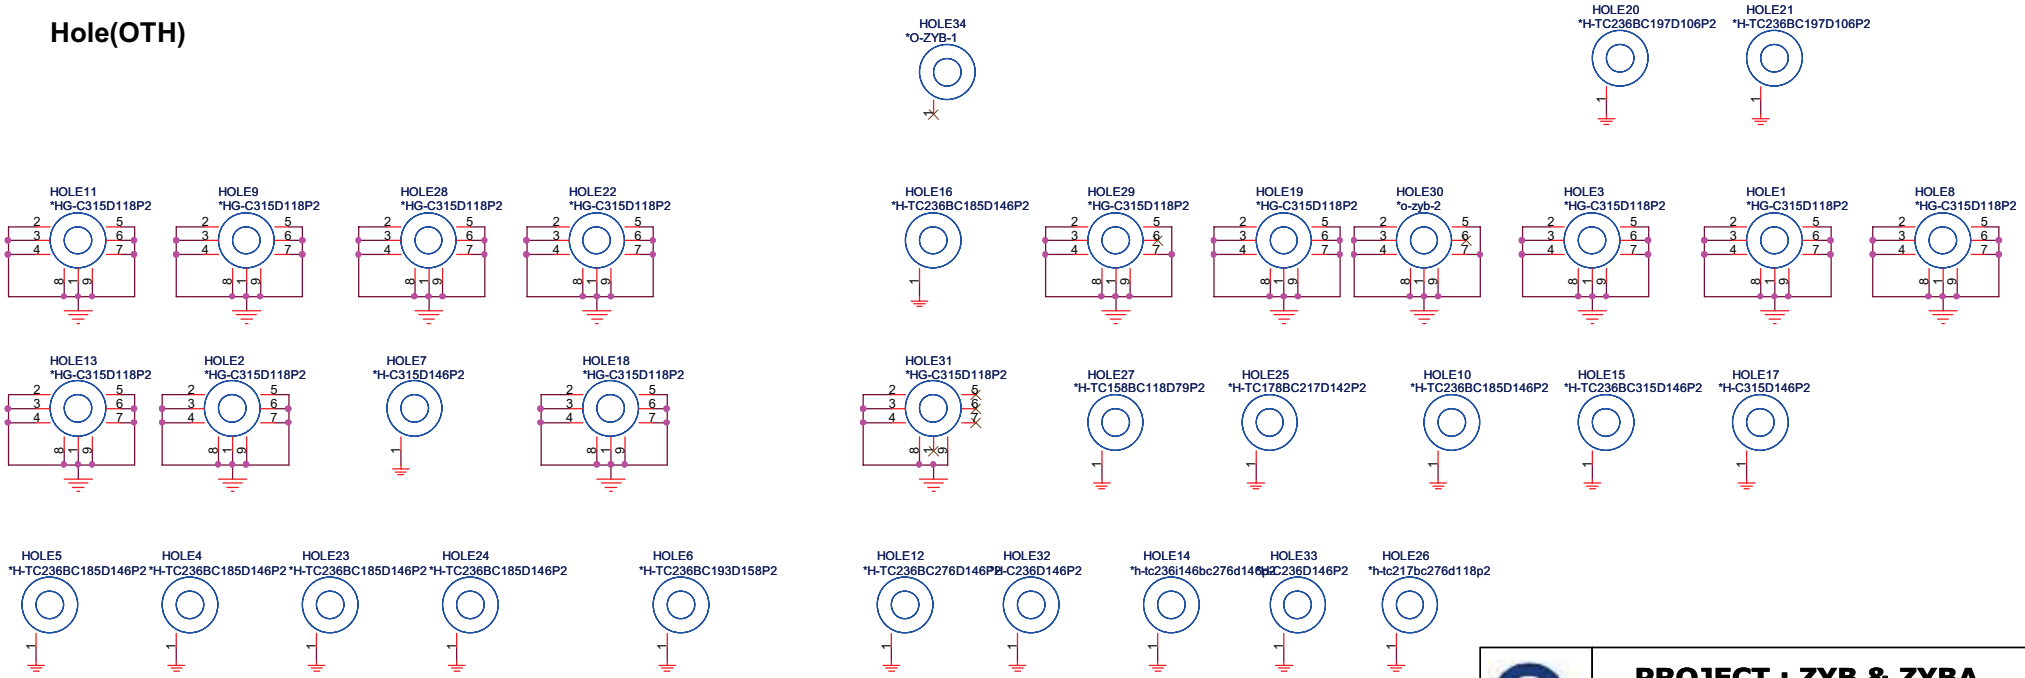

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Lan/B & Hole	1A
Date: Tuesday, January 19, 2010	Sheet 30 of 51	

CODEC(ADO)

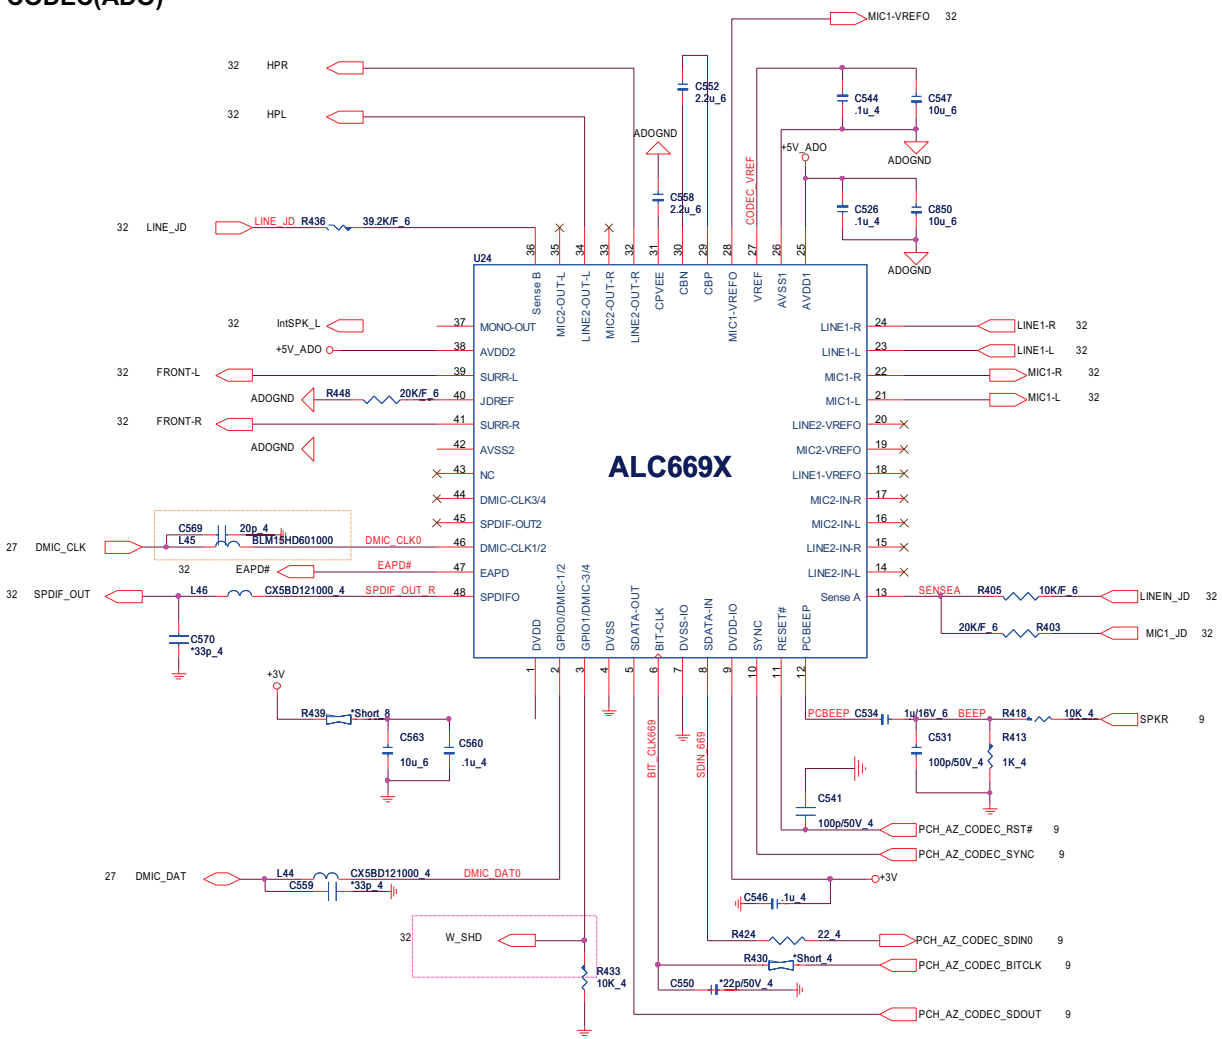

CODEC/AMP Power(ADO)

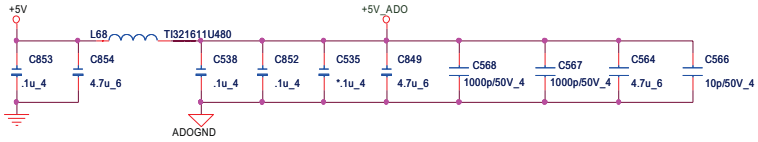

PROJECT : ZYB & ZYBA	
Quanta Computer Inc.	
Size	Document Number: REALTEK ALC669X
Rev	1A
Date: Tuesday, January 19, 2010	Sheet 31 of 51

SPEAKER AMP(AMP)

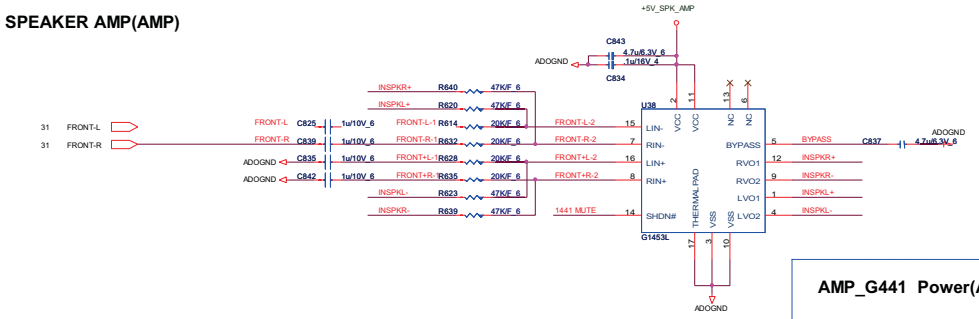

AMP_G441 Power(ADO)

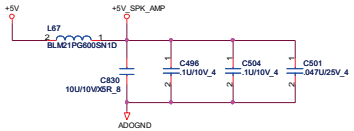

LINE-OUT/SPDIFO(AMP)

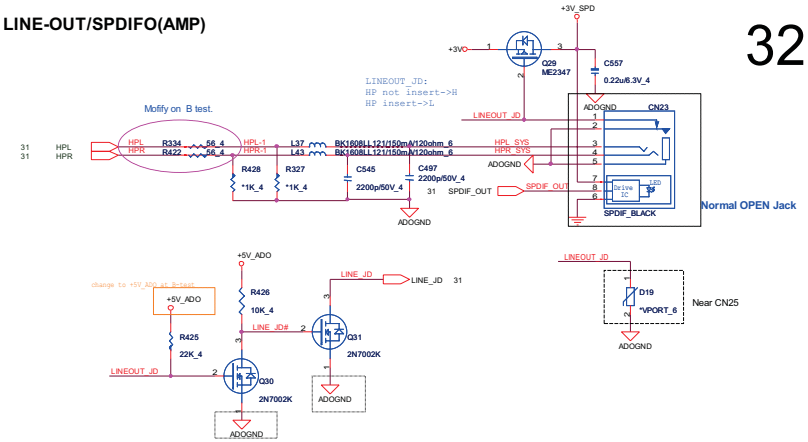

Modify on B test

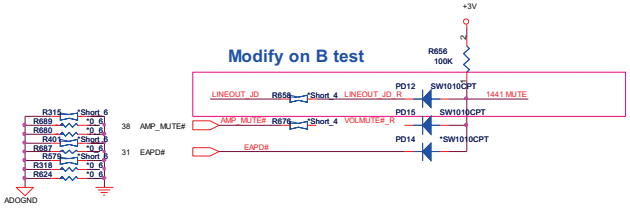

Main SPK and SUBWOOFER(AMP)

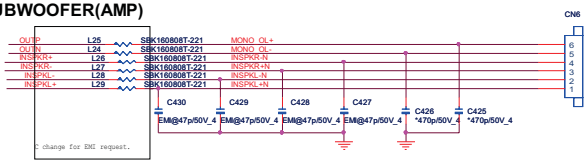

SUBWOOFER(AMP)

LPF for fc(-3dB)=500Hz

SDZ ::shutdown signal for IC<LOW-disable , HIGH-enable>

SHUTDOWN	TPA3110D1
L (0V~0.8V)	SHUTDOWN
H (2V ~ VDD)	ACTIVE

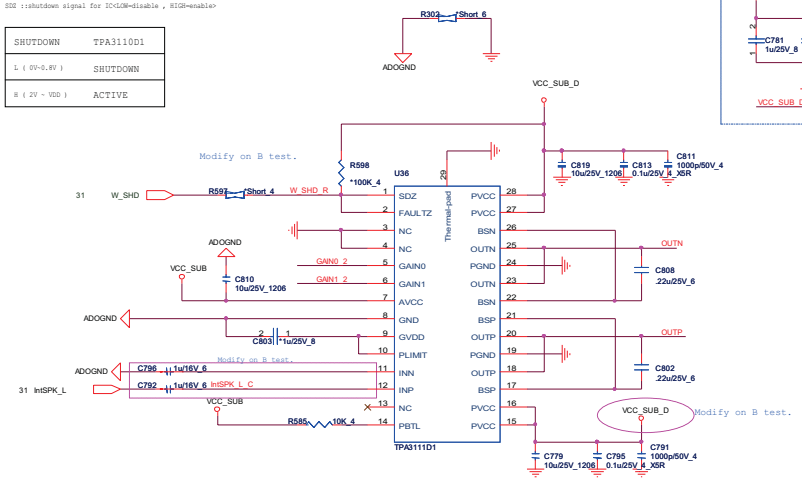

SUBWOOFER Power(AMP)

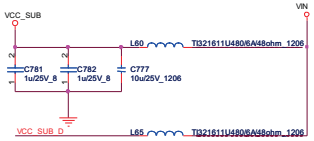

AMO GAIN(AMP)

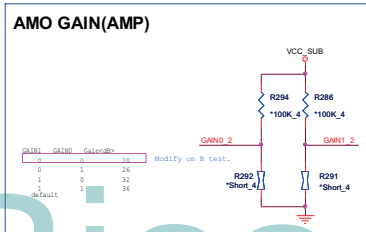

MIC(AMP)

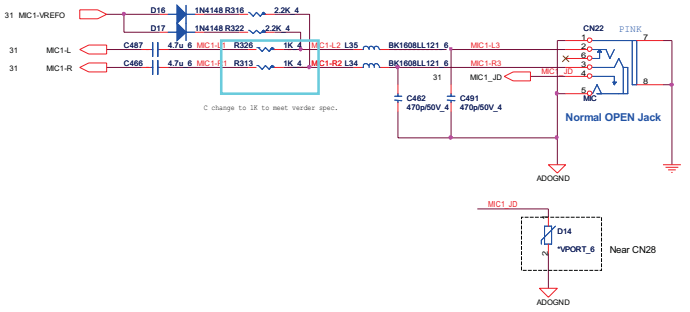

LINE IN(AMP)

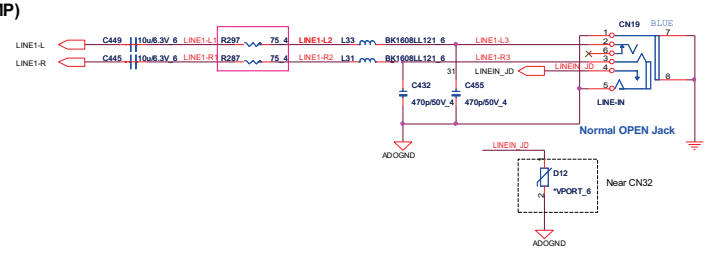

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	AMP/AUDIO JACK/WOOFER	1A
Date: Tuesday, January 19, 2010	Sheet 32 of 51	

2nd SATA HDD (HDD)

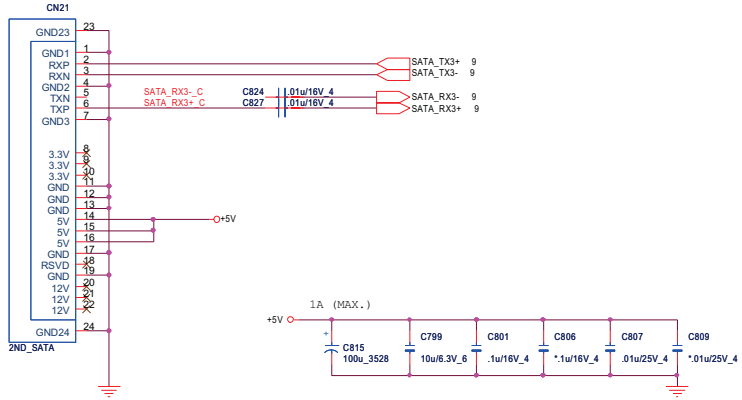

MAIN SATA HDD(HDD)

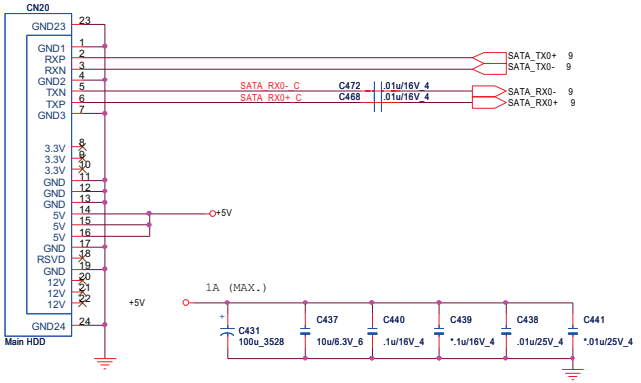

ODD SATA(ODD)

This ODD must be use eSATA Port

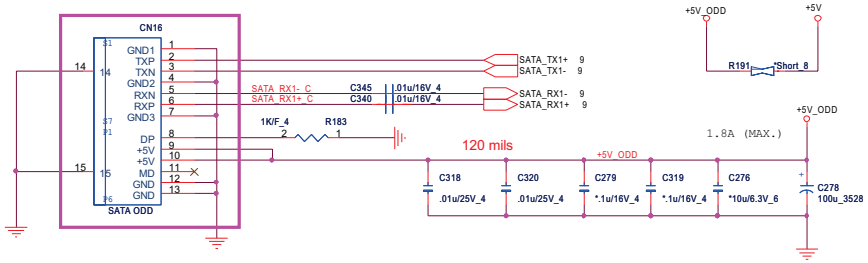

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	SATA-HDD/ODD	1A
Date: Tuesday, January 19, 2010	Sheet 33 of 51	

Wireless 1(MPC)

+3.3V: 1000mA
+3.3Vaux:330mA
+1.5V:500mA

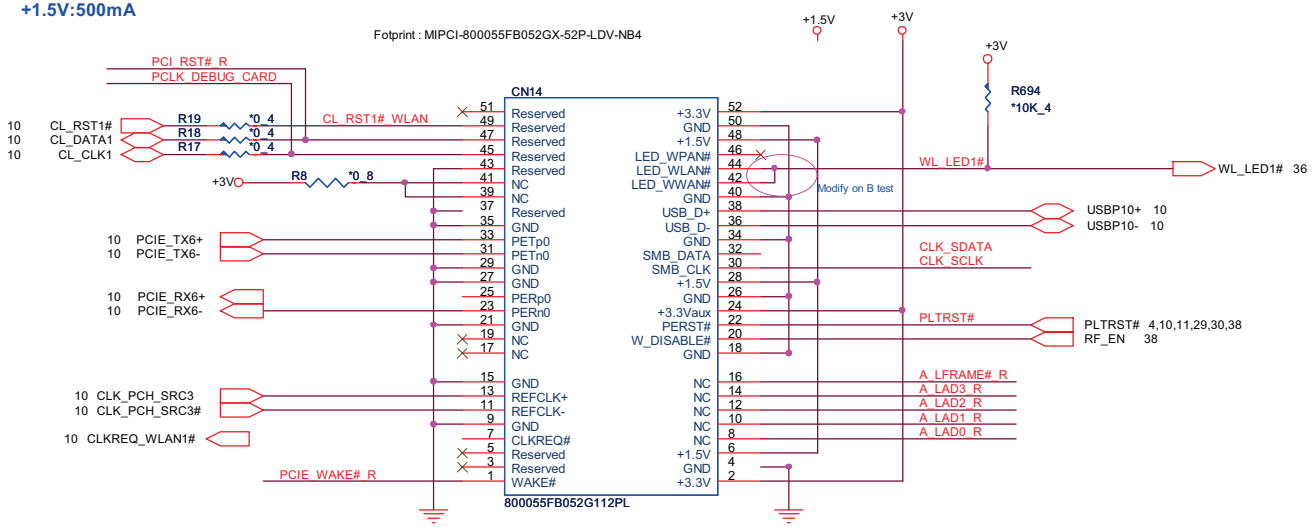

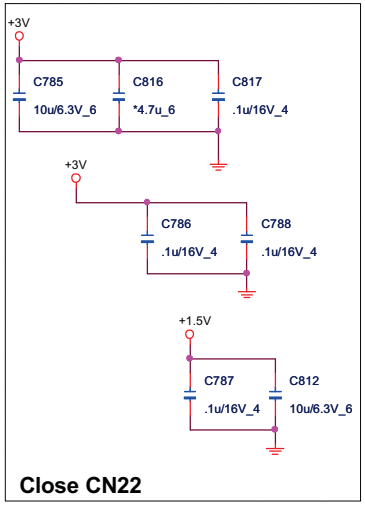

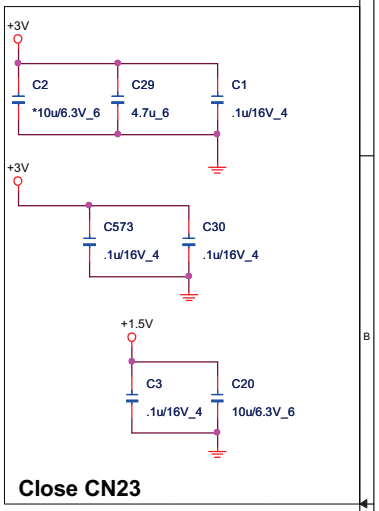

Wireless 2 (MPC)

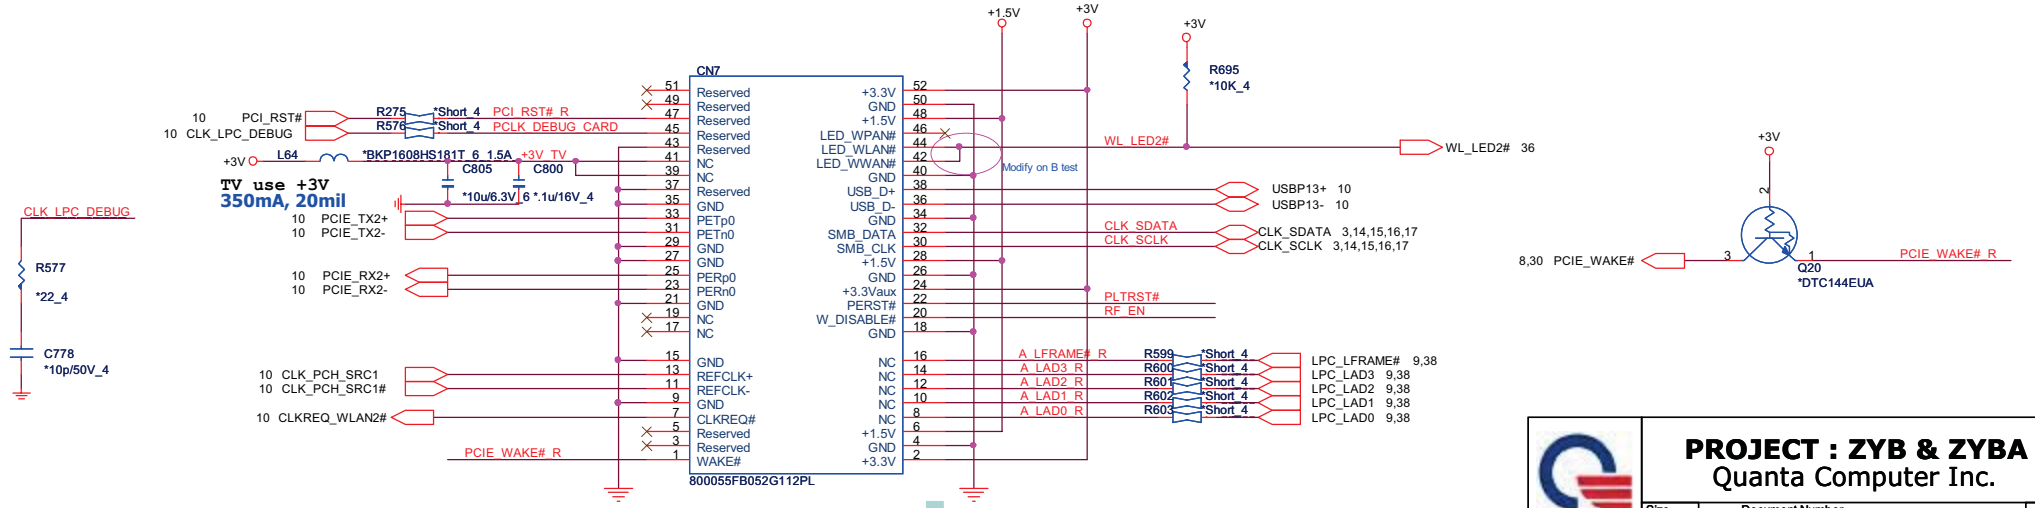

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	MINI PCI-E card	1A
Date: Tuesday, January 19, 2010	Sheet 34 of 51	

USB(USB)

GMT, AL000547000
Richtek, AL009711003

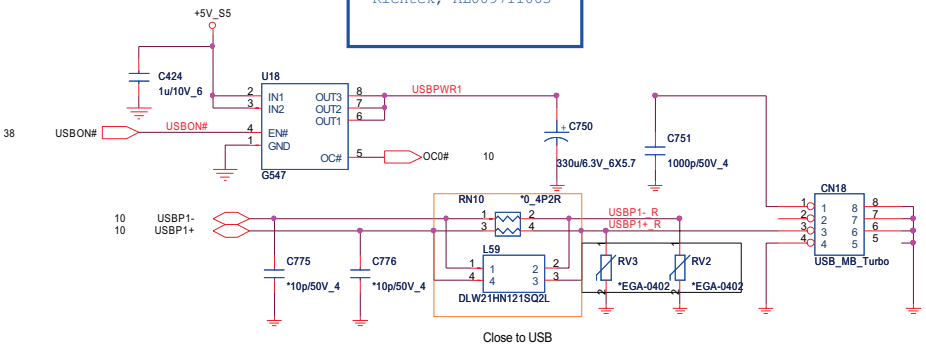

USB/B

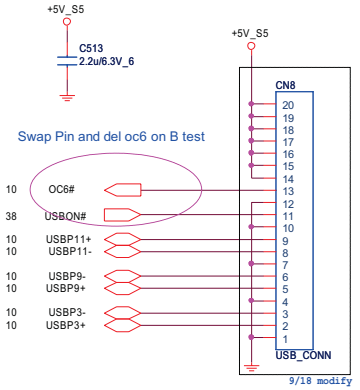

35

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	INT USB/ EXT USB	1A
Date: Tuesday, January 19, 2010	Sheet 35 of 51	

POWER BOARD(UIF)

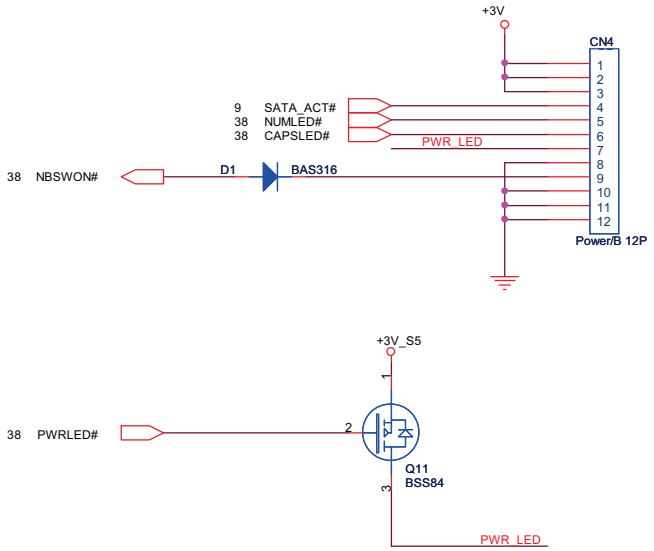

SW/B(UIF)

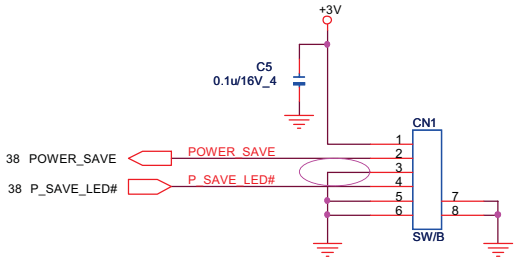

M/B(Battery) LED(uif)

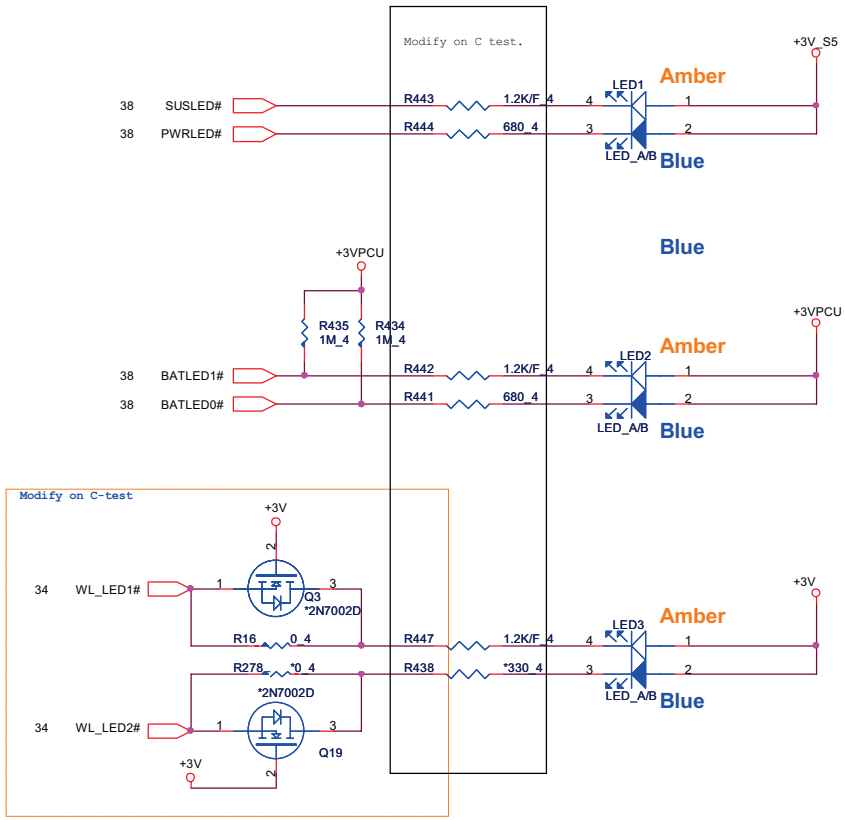

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	POWER/LAUNCH/LED	1A
Date: Tuesday, January 19, 2010	Sheet 36 of 51	

INT K/B(KBC)

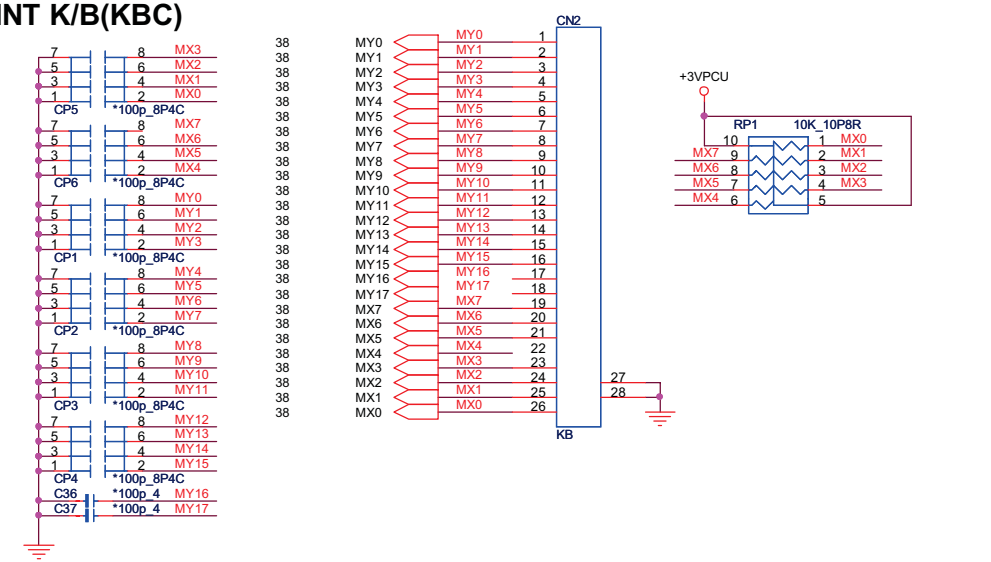

TOUCHPAD(TPD)

37

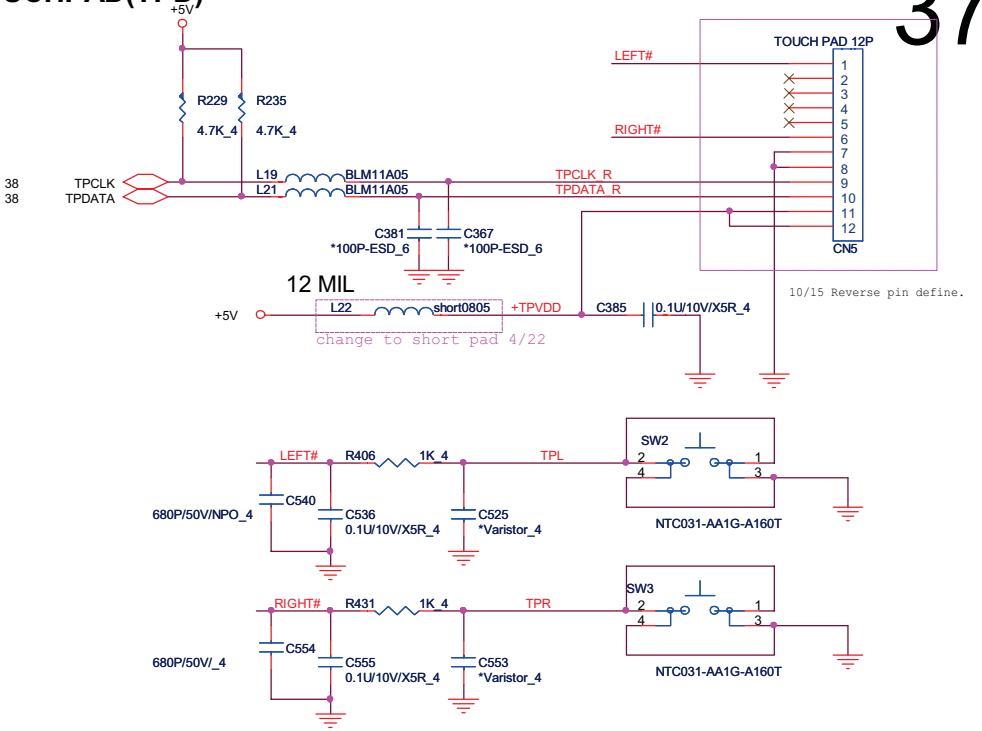

BLUETOOTH CONNECTOR(BTM)

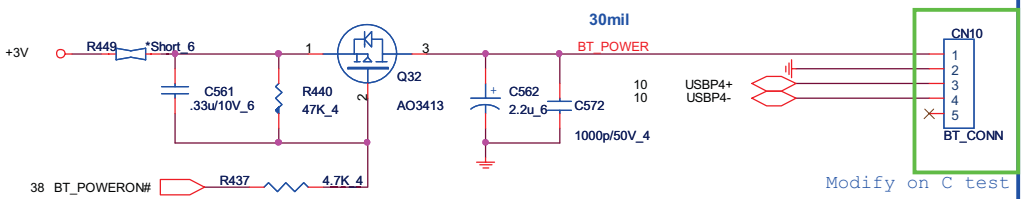

CPU FAN(THM)

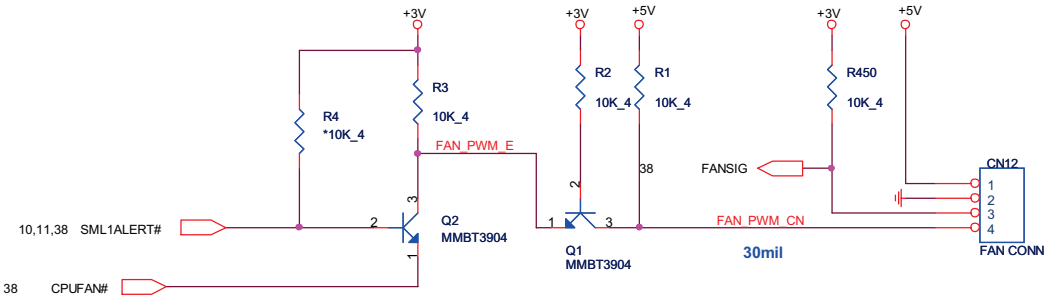

PROJECT : ZYB & ZYBA Quanta Computer Inc.		
Size	Document Number KB/FAN/TP/BT	Rev 1A
Date: Tuesday, January 19, 2010	Sheet 37 of 51	

EC(KBC)

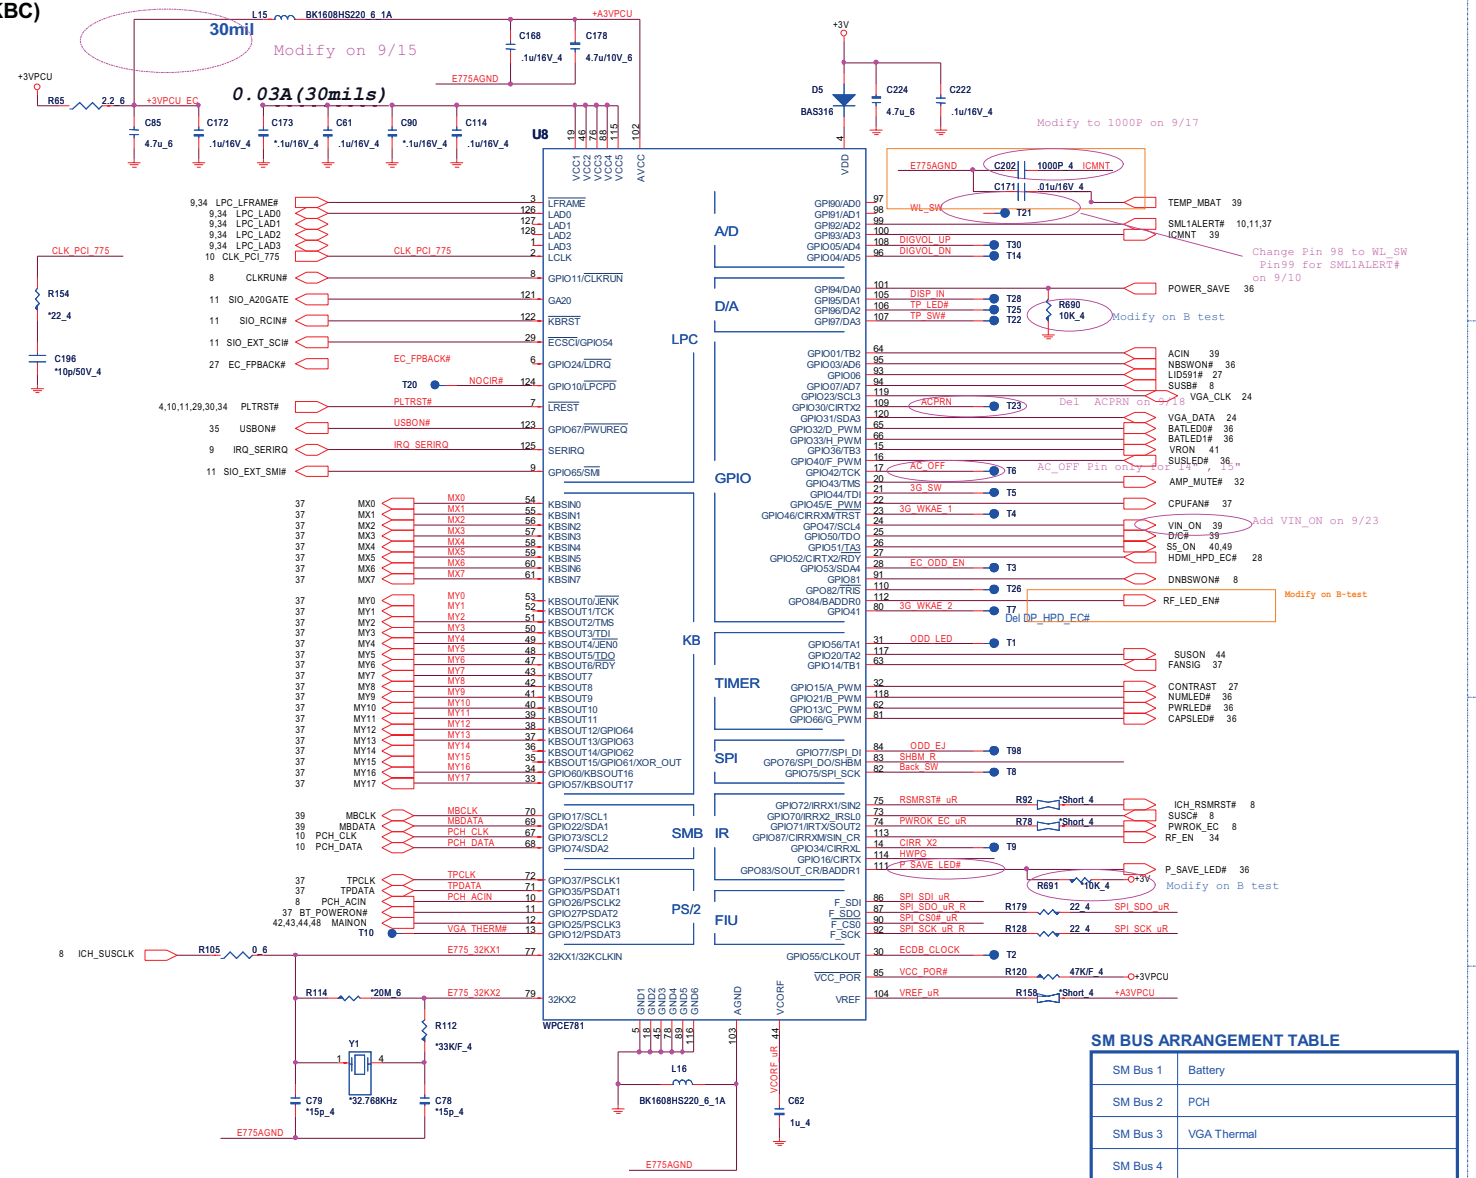

I/O ADDRESS SETTING

SHBM=0: Enable shared memory with host BIOS

SHBM R118 10K_4

1/13 Comfirm by vendor mail :
Disabled ('1') if using FWH device on LPC.
Enabled ('0') if using SPI flash for both system BIOS and EC firmware

SM BUS PU

Change pull-up resistor (R148 /R154) from 10K to 4.7Kohm

MBCLK R77 4.7K_4
MBDATA R73 4.7K_4

PCH_CLK R67 10K_4
PCH_DATA R66 10K_4

VGA_CLK R152 2.2K_4
VGA_DATA R153 2.2K_4

Modify on 9/10

SPI FLASH

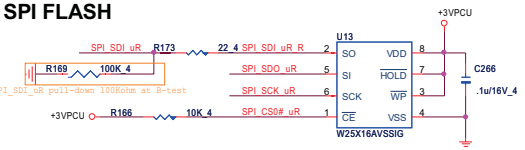

1/13 Comfirm by vendor mail :
If the Southbridge enables 'Long Wait Abort' by default, the flash device should be 50MHz (or faster)

At 11/24 add

Winbond	W25X16AVSSIG	AKE38FP0N01
MXIC	MX25L1605DM2I-12G	AKE38FP0Z00
AMIC	A25L016M-F	AKE38ZN0800

HWPG

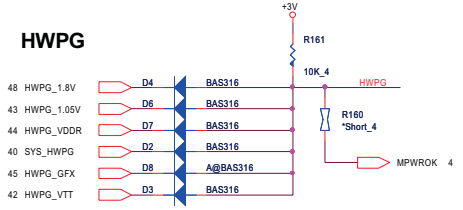

SM BUS ARRANGEMENT TABLE

SM Bus 1	Battery
SM Bus 2	PCH
SM Bus 3	VGA Thermal
SM Bus 4	

VR Cap.

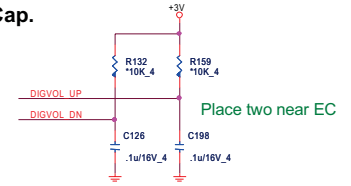

POWER-ON Switch

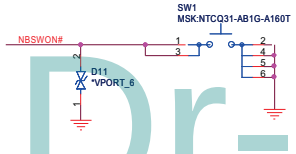

INTERNAL KEYBOARD STRIP SET

MY0 R68 10K_4

PROJECT : ZYB & ZYBA		
Quanta Computer Inc.		
Size	Document Number: WPCE81 & FLASH	Rev: 1A
Date: Tuesday, January 19, 2010	Sheet 38 of 51	

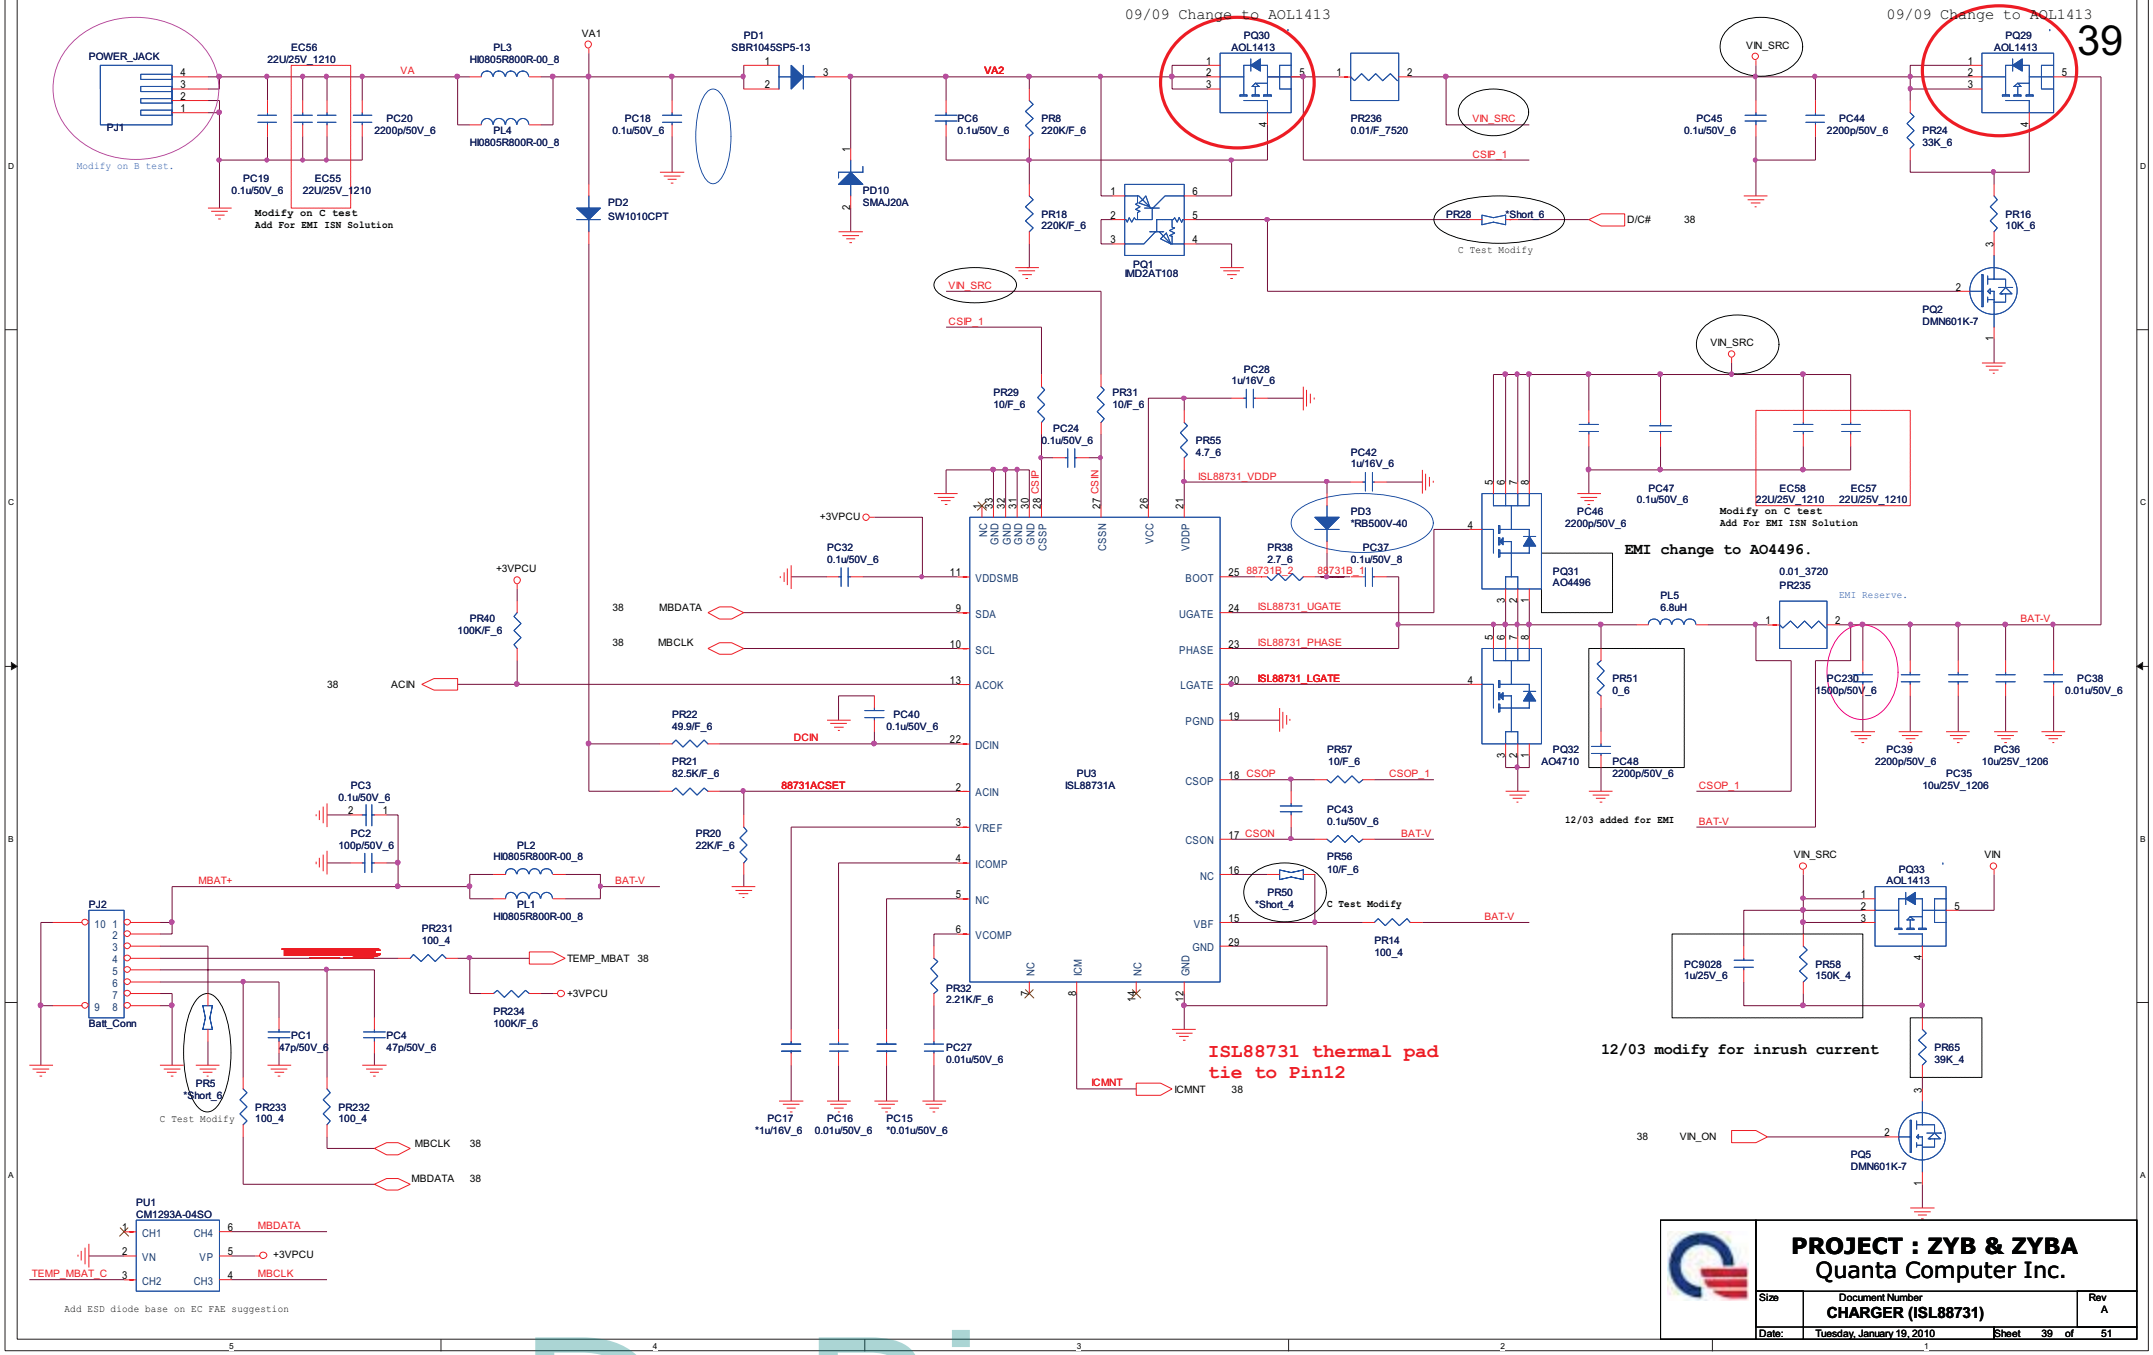
09/09 Change to AOL1413
09/09 Change to AOL1413
39
POWER_JACK
PJ1
Modify on B test.
EC56 22U/25V_1210
PC20 2200p/50V_6
PC19 0.1u/50V_6
EC55 22U/25V_1210
Modify on C test
Add For EMI ISN Solution
VA
PL3 HI0805R800R-00_8
PL4 HI0805R800R-00_8
VA1
PC18 0.1u/50V_6
PD1 SBR1045SP5-13
PD2 SW1010CPT
PD10 SMAJ20A
VA2
PC6 0.1u/50V_6
PR8 220K/F_6
PR18 220K/F_6
PQ30 AOL1413
PR236 0.01/F_7520
VIN_SRC
CSIP_1
PQ1 IMD2AT108
PR28 *Short_6
C Test Modify
D/C# 38
PC45 0.1u/50V_6
PC44 2200p/50V_6
PQ29 AOL1413
PR24 33K_6
PR16 10K_6
PQ2 DMN601K-7
PC28 1u/16V_6
PR29 10/F_6
PR31 10/F_6
PC24 0.1u/50V_6
PR55 4.7_6
ISL88731_VDDP
PC42 1u/16V_6
PD3 *RB500V-40
PC37 0.1u/50V_8
+3VPCU
PC32 0.1u/50V_6
PR40 100K/F_6
38 MBDATA
38 MBCLK
38 ACIN
PR22 49.9/F_6
DCIN
PC40 0.1u/50V_6
PR21 82.5K/F_6
88731ACSET
PR20 22K/F_6
PU3 ISL88731A
NC GND GND GND GND CSSP CSSN VCC VDDP
VDDSMB SDA SCL ACOK DCIN ACIN VREF ICOMP NC VCOMP
BOOT UGATE PHASE LGATE PGND CSOP CSON NC VBF GND
ISL88731_UGATE
ISL88731_PHASE
ISL88731_LGATE
PR38 2.7_6
PR57 10/F_6
PC43 0.1u/50V_6
PR56 10/F_6
PR50 *Short_4
C Test Modify
PR14 100_4
BAT-V
PR32 2.21K/F_6
PC27 0.01u/50V_6
PC17 *1u/16V_6
PC16 0.01u/50V_6
PC15 *0.01u/50V_6
ICMNT
ICMNT 38
ISL88731 thermal pad tie to Pin12
PQ31 AO4496
PQ32 AO4710
EMI change to AO4496.
PC46 2200p/50V_6
PC47 0.1u/50V_6
EC58 22U/25V_1210
EC57 22U/25V_1210
Modify on C test
Add For EMI ISN Solution
PL5 6.8uH
0.01_3720 PR235
EMI Reserve.
PR51 0_6
PC48 2200p/50V_6
12/03 added for EMI
PC230 1500p/50V_6
PC39 2200p/50V_6
PC36 10u/25V_1206
PC35 10u/25V_1206
PC38 0.01u/50V_6
PC3 0.1u/50V_6
PC2 100p/50V_6
PL2 HI0805R800R-00_8
PL1 HI0805R800R-00_8
MBAT+
PJ2 Batt_Conn
PR231 100_4
TEMP_MBAT 38
PR234 100K/F_6
PR5 *Short_6
C Test Modify
PC1 47p/50V_6
PC4 47p/50V_6
PR233 100_4
PR232 100_4
MBCLK 38
MBDATA 38
PU1 CM1293A-04SO
CH1 CH4 VN VP CH2 CH3
MBDATA
+3VPCU
MBCLK
TEMP_MBAT_C
Add ESD diode base on EC FAE suggestion
12/03 modify for inrush current
PC9028 1u/25V_6
PR58 150K_4
PQ33 AOL1413
PR65 39K_4
38 VIN_ON
PQ5 DMN601K-7
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Size
Document Number
CHARGER (ISL88731)
Rev A
Date: Tuesday, January 19, 2010
Sheet 39 of 51

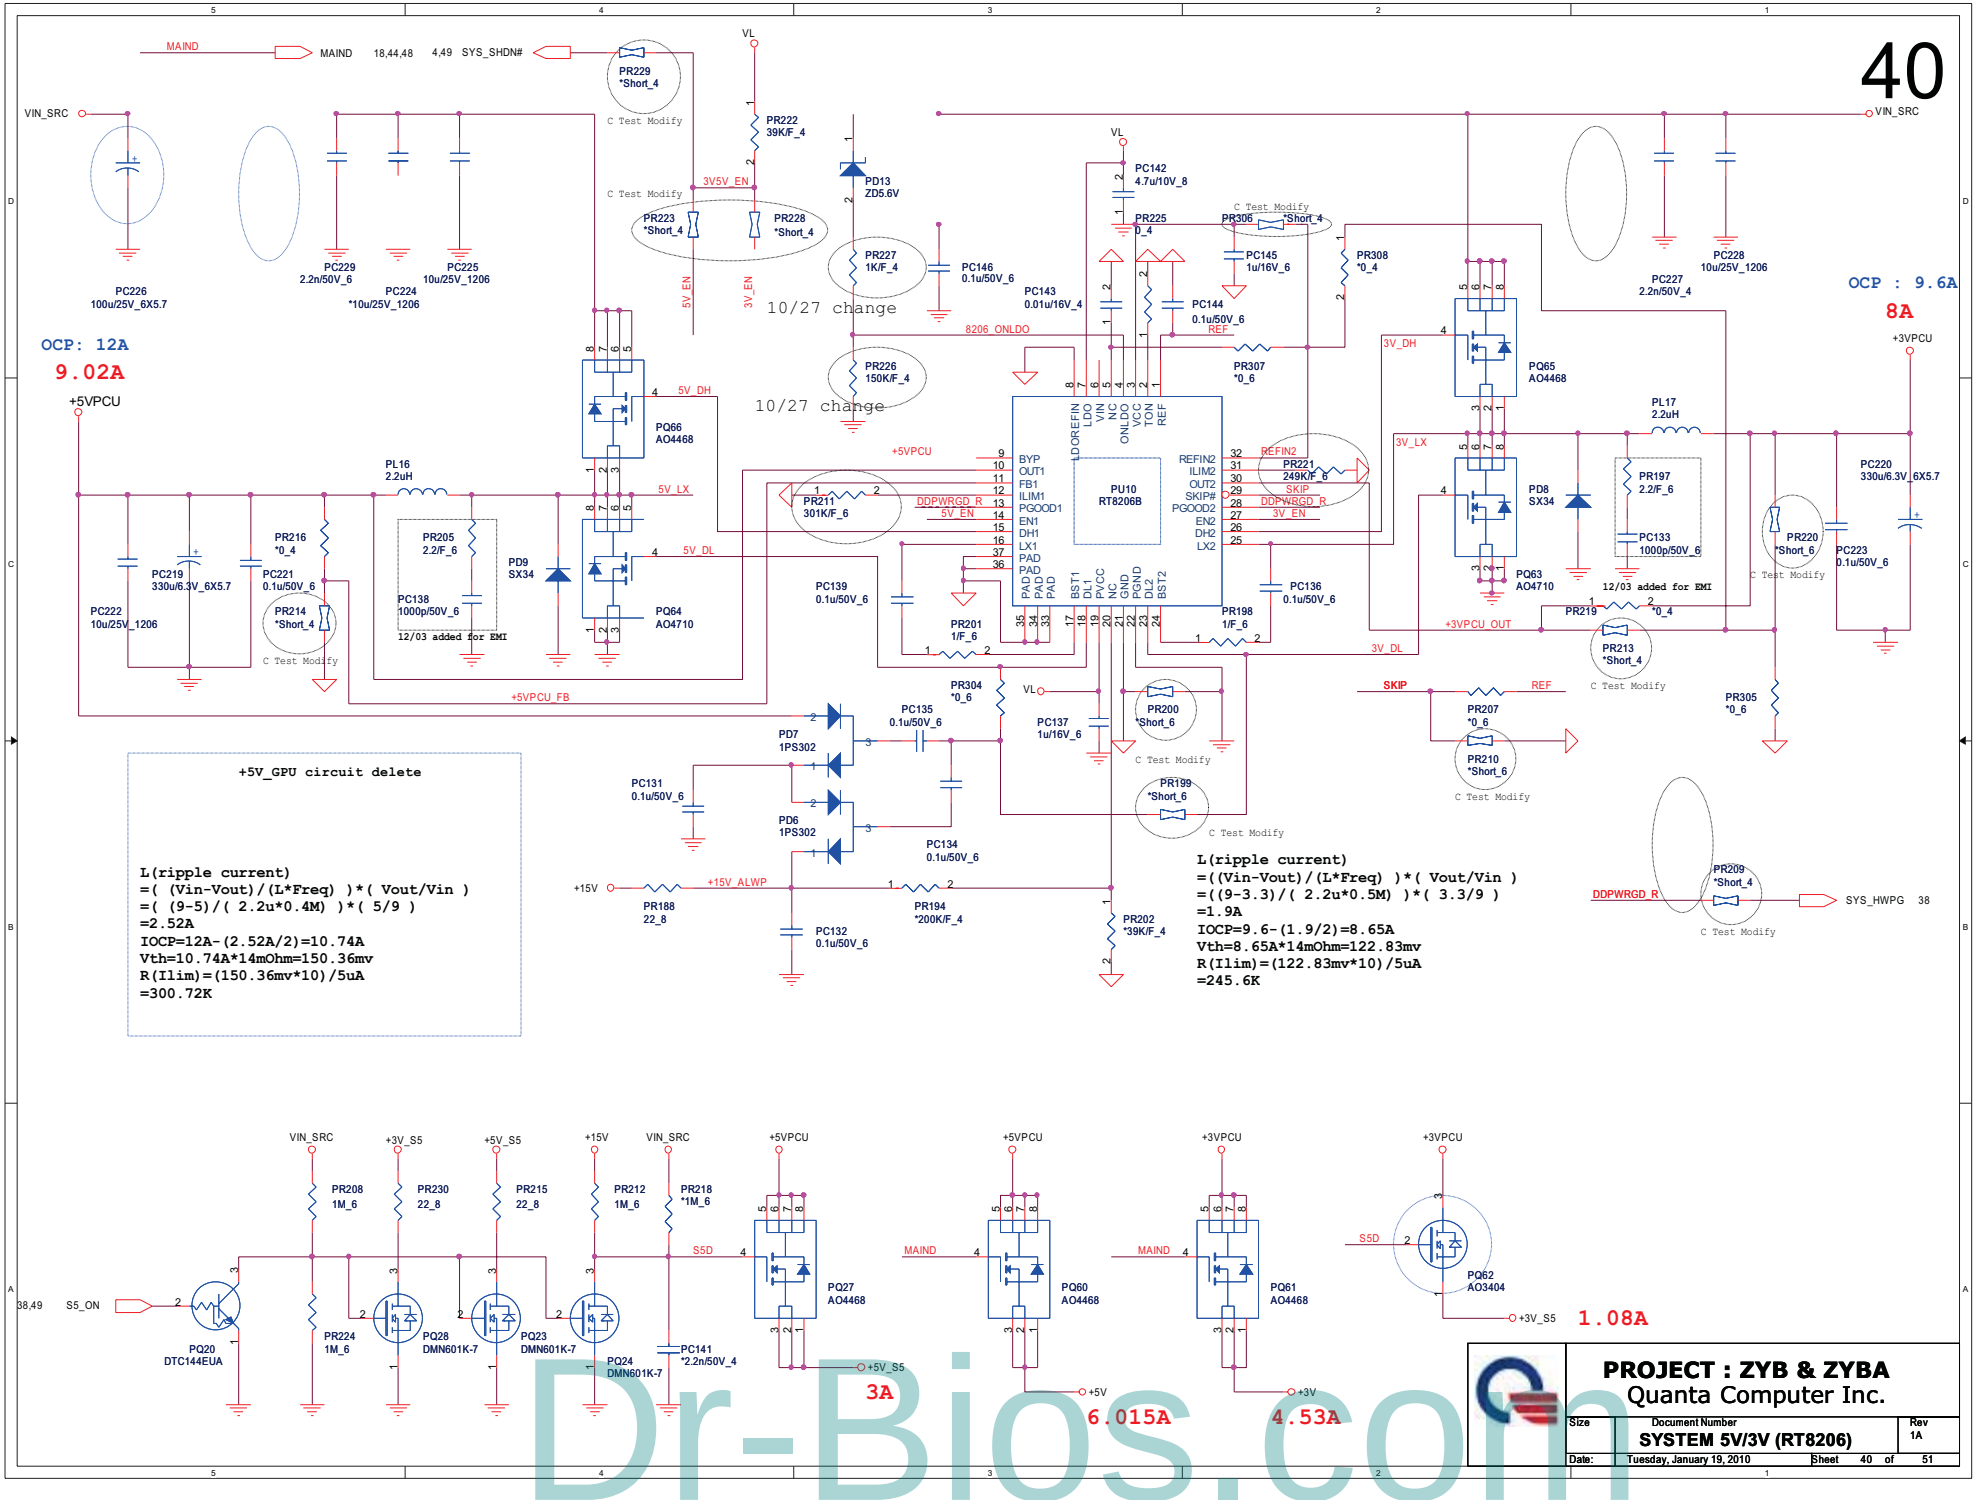
MAIND
SYS_SHDN#
VIN_SRC
+5VPCU
+3VPCU
VL
OCP: 12A
9.02A
OCP : 9.6A
8A
10/27 change
10/27 change
12/03 added for EMI
12/03 added for EMI
C Test Modify
+5V_GPU circuit delete
L(ripple current)
=((Vin-Vout)/(L*Freq))*(Vout/Vin)
=((9-5)/(2.2u*0.4M))*(5/9)
=2.52A
IOCP=12A-(2.52A/2)=10.74A
Vth=10.74A*14mOhm=150.36mv
R(Ilim)=(150.36mv*10)/5uA
=300.72K
L(ripple current)
=((Vin-Vout)/(L*Freq))*(Vout/Vin)
=((9-3.3)/(2.2u*0.5M))*(3.3/9)
=1.9A
IOCP=9.6-(1.9/2)=8.65A
Vth=8.65A*14mOhm=122.83mv
R(Ilim)=(122.83mv*10)/5uA
=245.6K
PU10 RT8206B
PQ65 AO4468
PQ66 AO4468
PQ64 AO4710
PQ63 AO4710
PD8 SX34
PD9 SX34
PD7 1PS302
PD6 1PS302
PD13 ZD5.6V
PL16 2.2uH
PL17 2.2uH
8206_ONLDO
3V5V_EN
5V_EN
3V_EN
5V_DH
5V_LX
5V_DL
3V_DH
3V_LX
3V_DL
DDPWRGD_R
REF
REFIN2
SKIP
+5VPCU_FB
+3VPCU_OUT
+15V_ALWP
S5D
MAIND
SYS_HWPG
38
PQ20 DTC144EUA
PQ24 DMN601K-7
PQ23 DMN601K-7
PQ28 DMN601K-7
PQ27 AO4468
PQ60 AO4468
PQ61 AO4468
PQ62 AO3404
+5V_S5
+3V_S5
+5V
+3V
3A
6.015A
4.53A
1.08A
PROJECT : ZYB & ZYBA
Quanta Computer Inc.
SYSTEM 5V/3V (RT8206)
Size
Document Number
Rev
1A
Date: Tuesday, January 19, 2010
Sheet 40 of 51

[PWM]

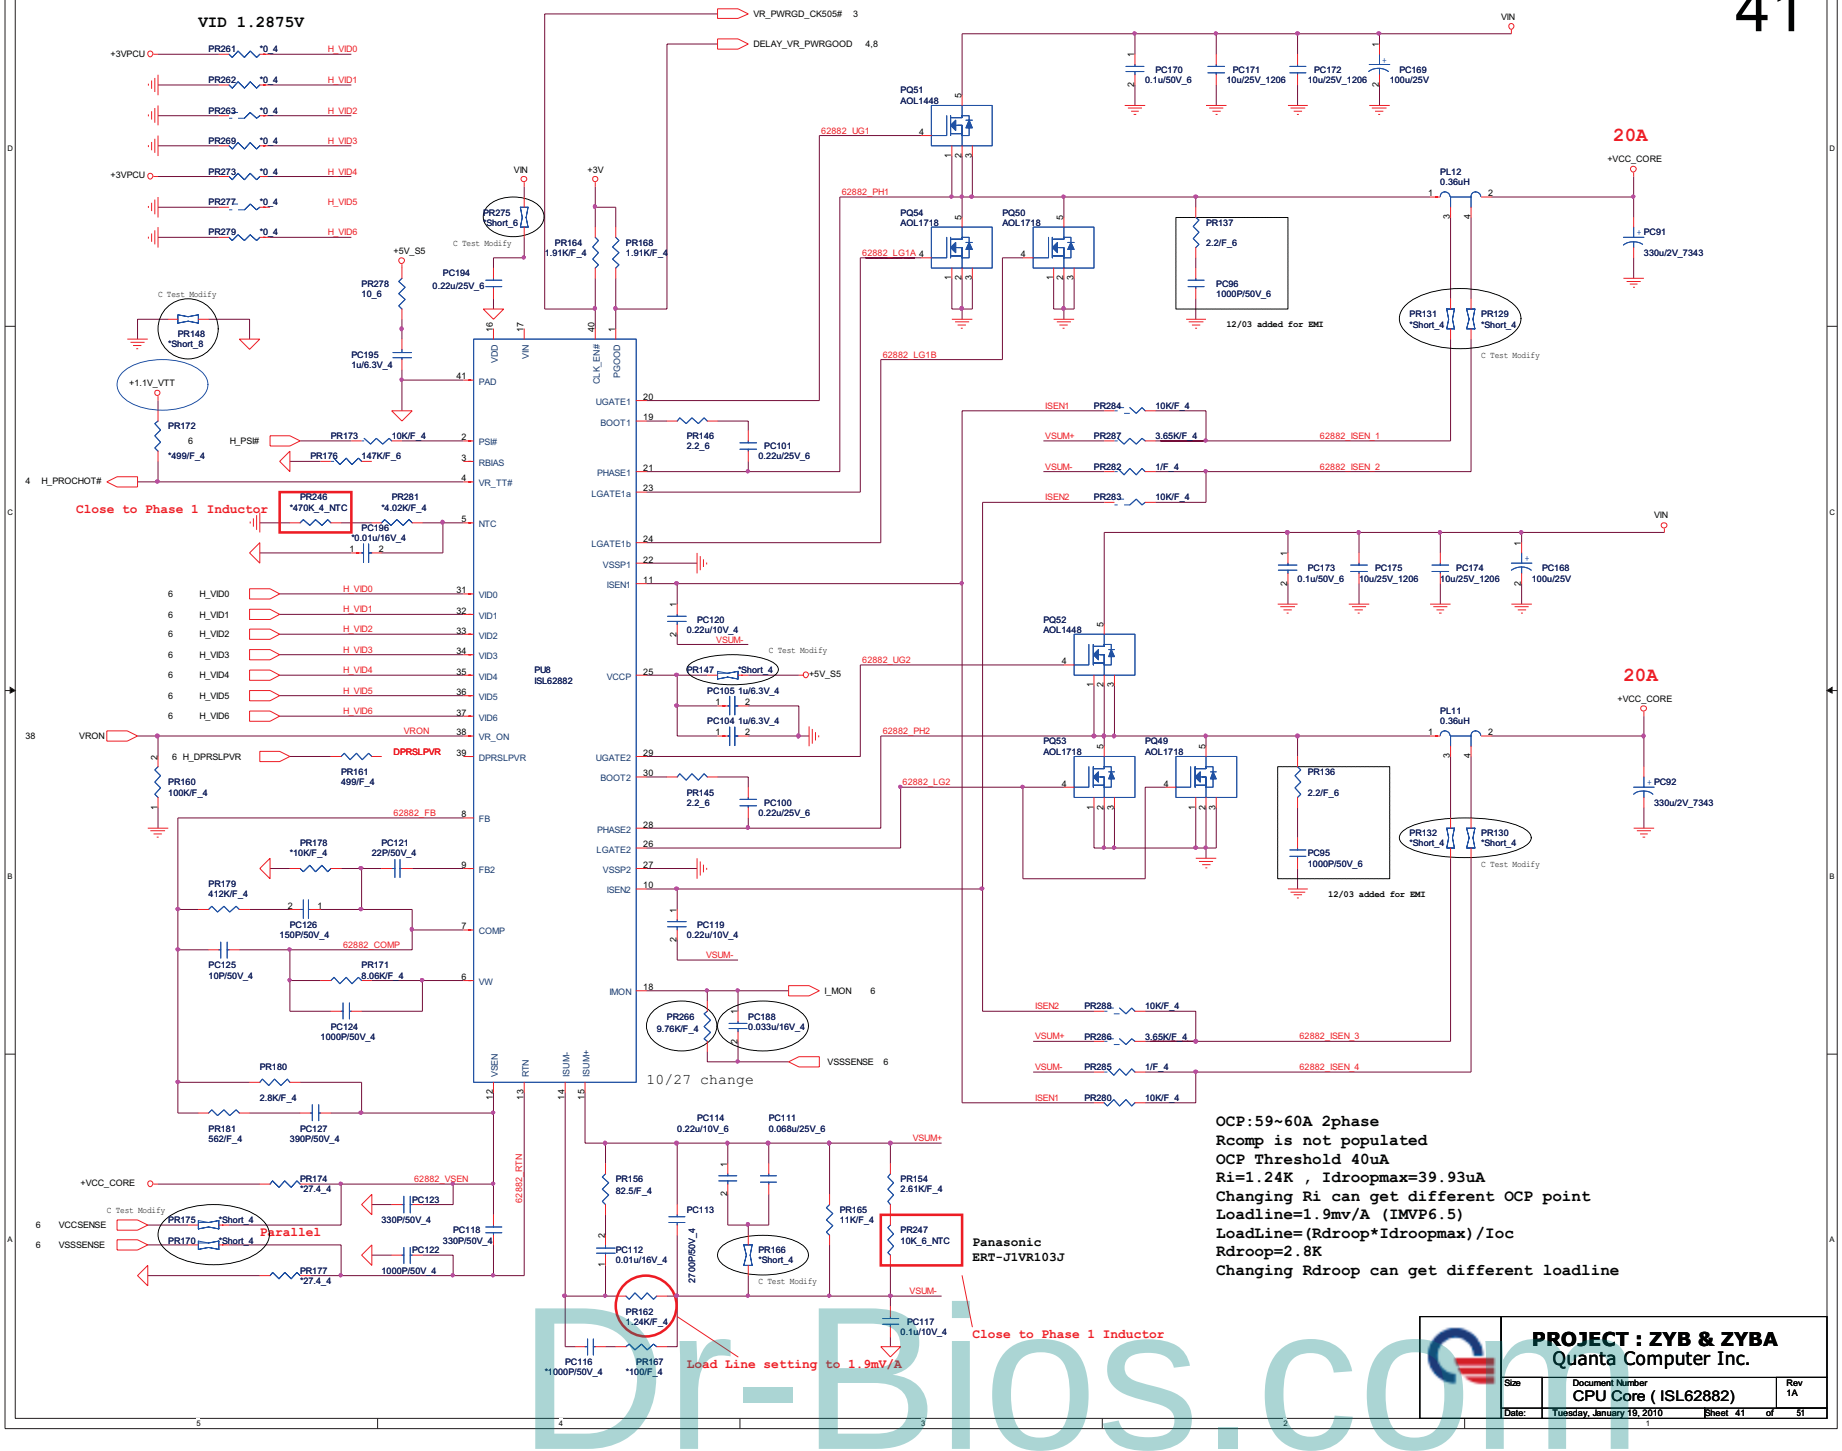

[PWM]

42

OCP: 18A
1.1V/13.5A

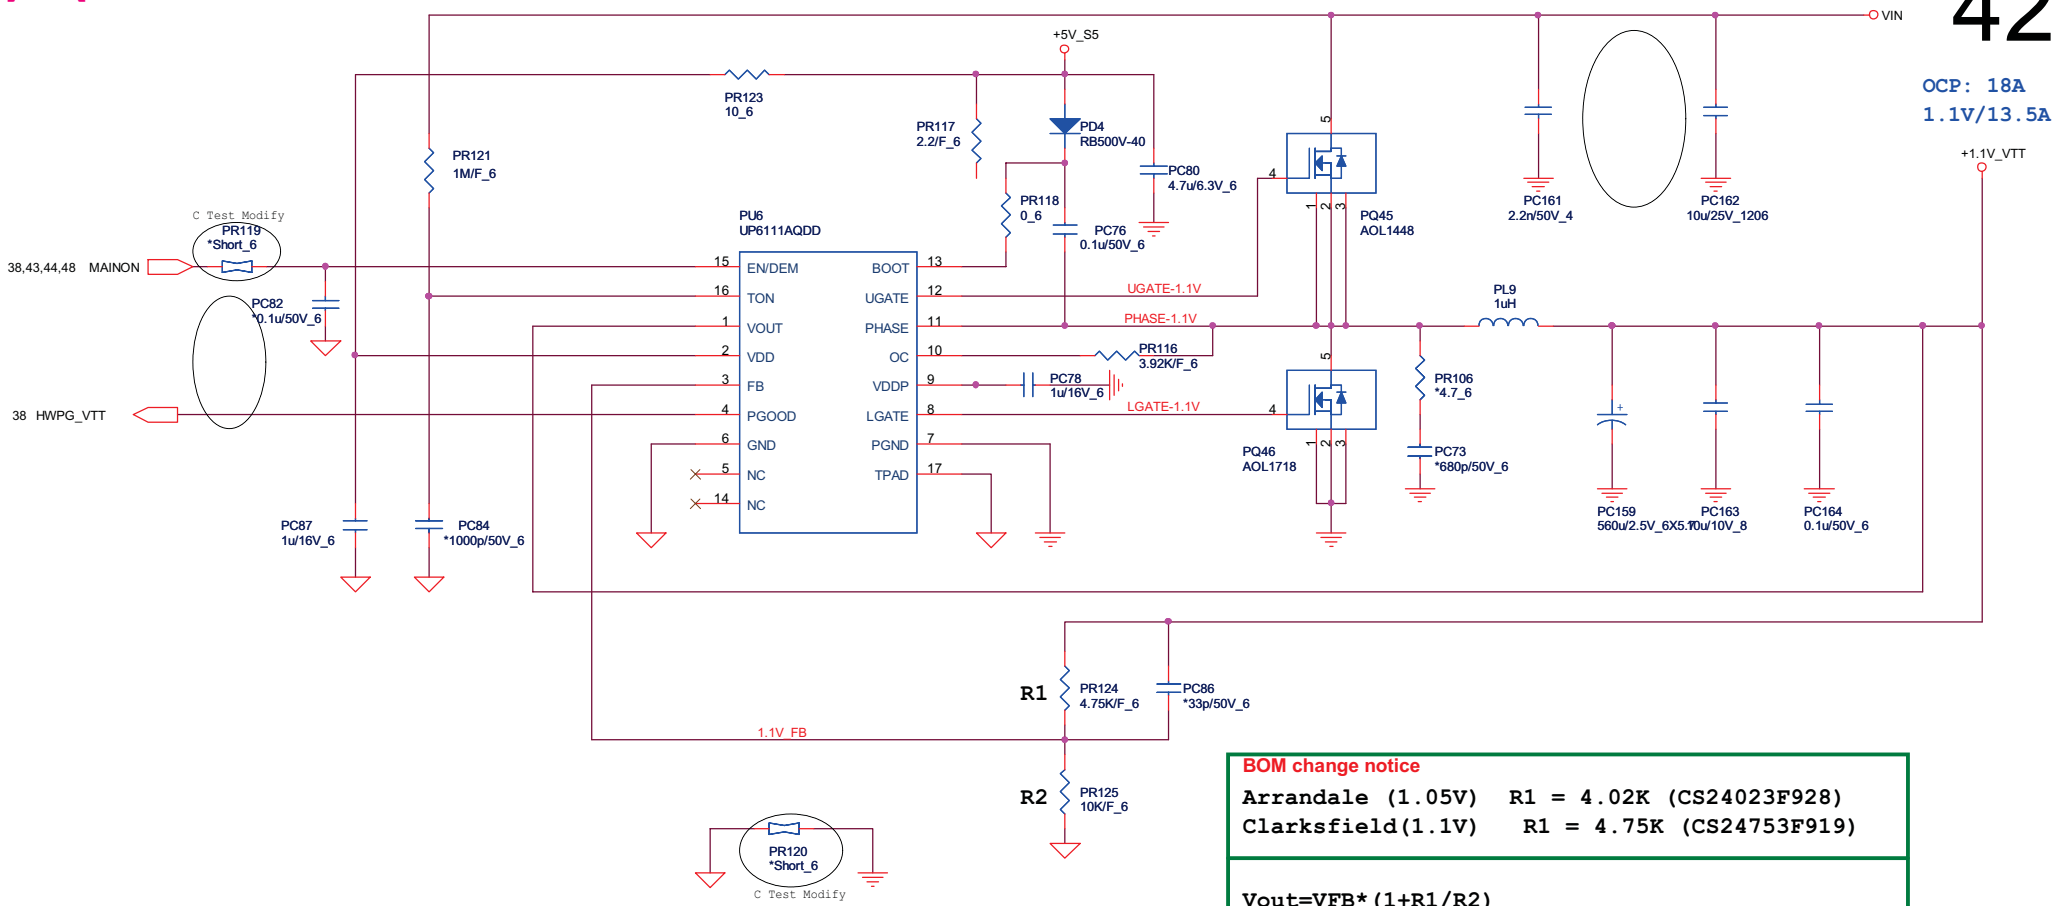

BOM change notice

Arrandale (1.05V) R1 = 4.02K (CS24023F928)
Clarksfield(1.1V) R1 = 4.75K (CS24753F919)

Vout=VFB*(1+R1/R2)
VFB=0.75V

TON=3.85p*RTON*Vout/(Vin-0.5)

Frequency=Vout/(Vin*TON)

TON=3.85p*1M*1/(Vin-0.5)

Frequency=1/(0.0036767)=272K

AO1718 Rdson=3~4.3mOhm
L(ripple current)
=(19-1.1)*1.1(1u*272k*19)
~3.81A

4.3m*18=RILIM*20uA
RILIM=3.87K --- 3.92K

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	+VTT (UP6111A)	1A
Date: Tuesday, January 19, 2010	Sheet 42 of 51	

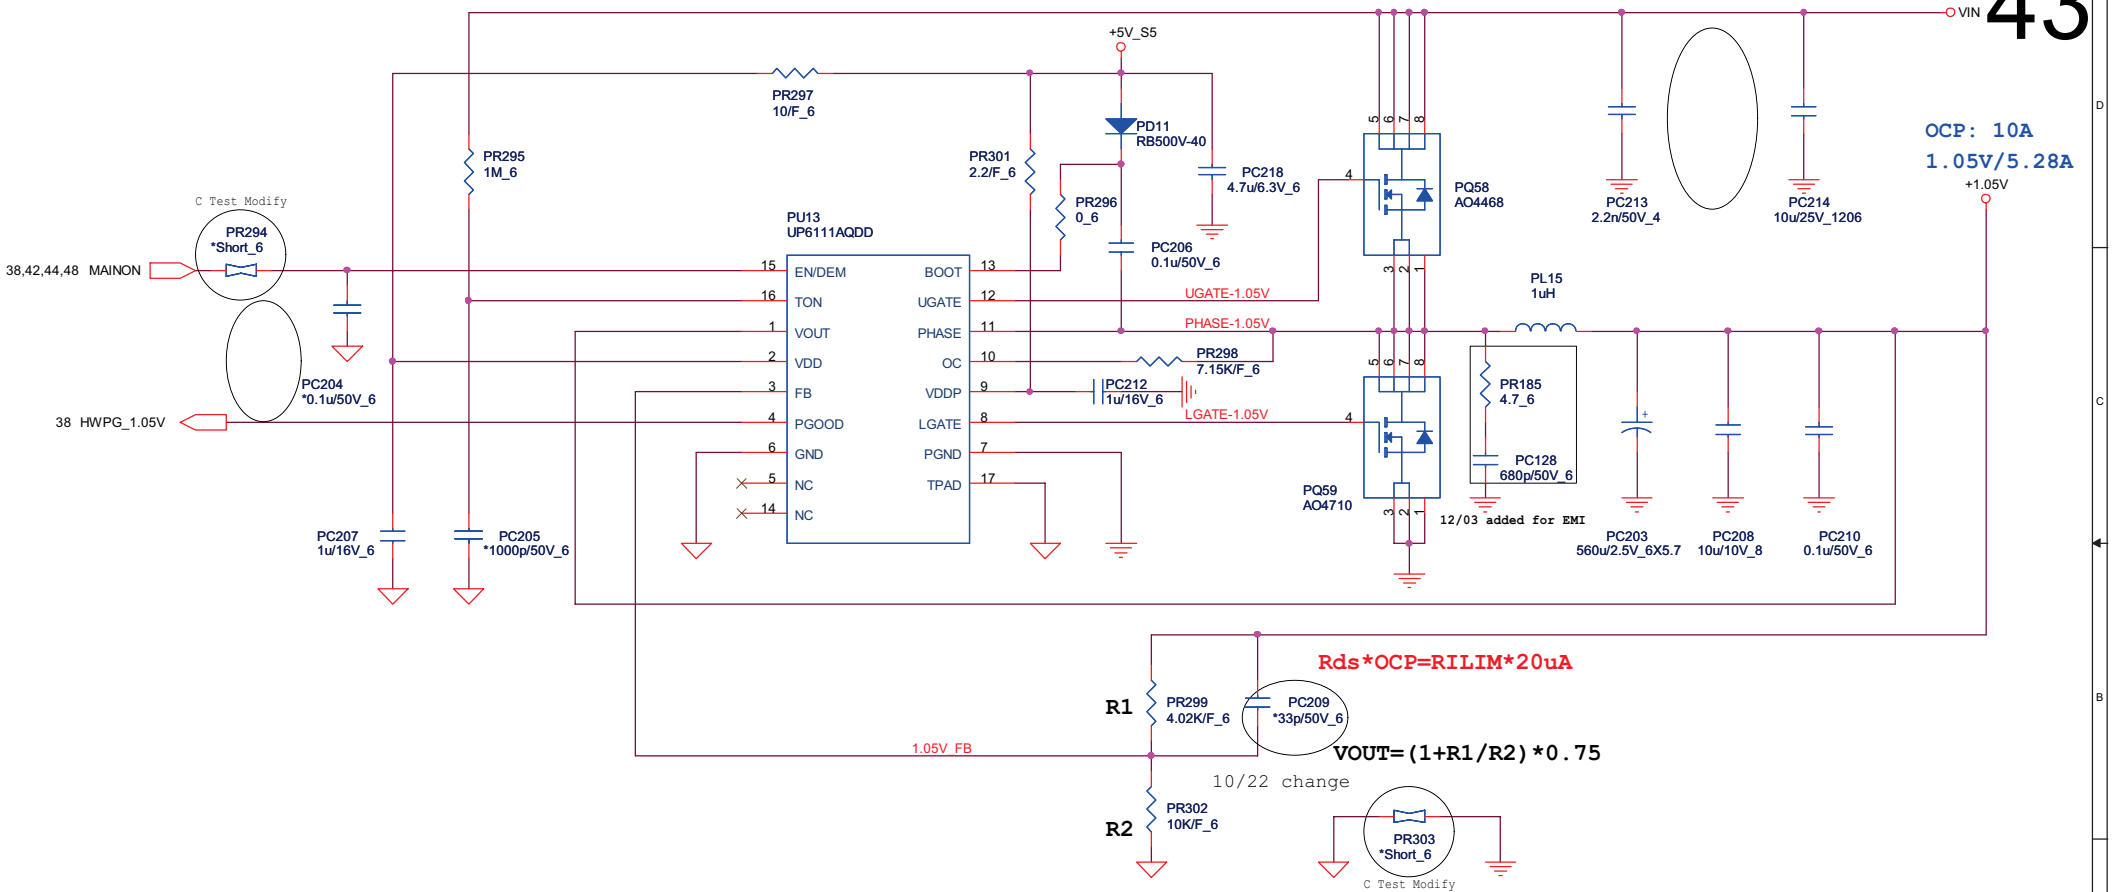

TON=3.85p*RTON*Vout/(Vin-0.5)

Frequency=Vout/(Vin*TON)

TON=3.85p*1M*1/(Vin-0.5)

Frequency=1/(0.0036767)=272K

AO4710 Rdson=11.7~14.2mOhm

L(ripple current)
=(19-1.05)*1.05/(1u*272k*19)
~3.646A

14.2m*10=RILIM*20uA
RILIM=7.1K--- 7.15K

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	VCCP +1.05V (UP6111A)	1A
Date: Tuesday, January 19, 2010	Sheet 43 of 51	

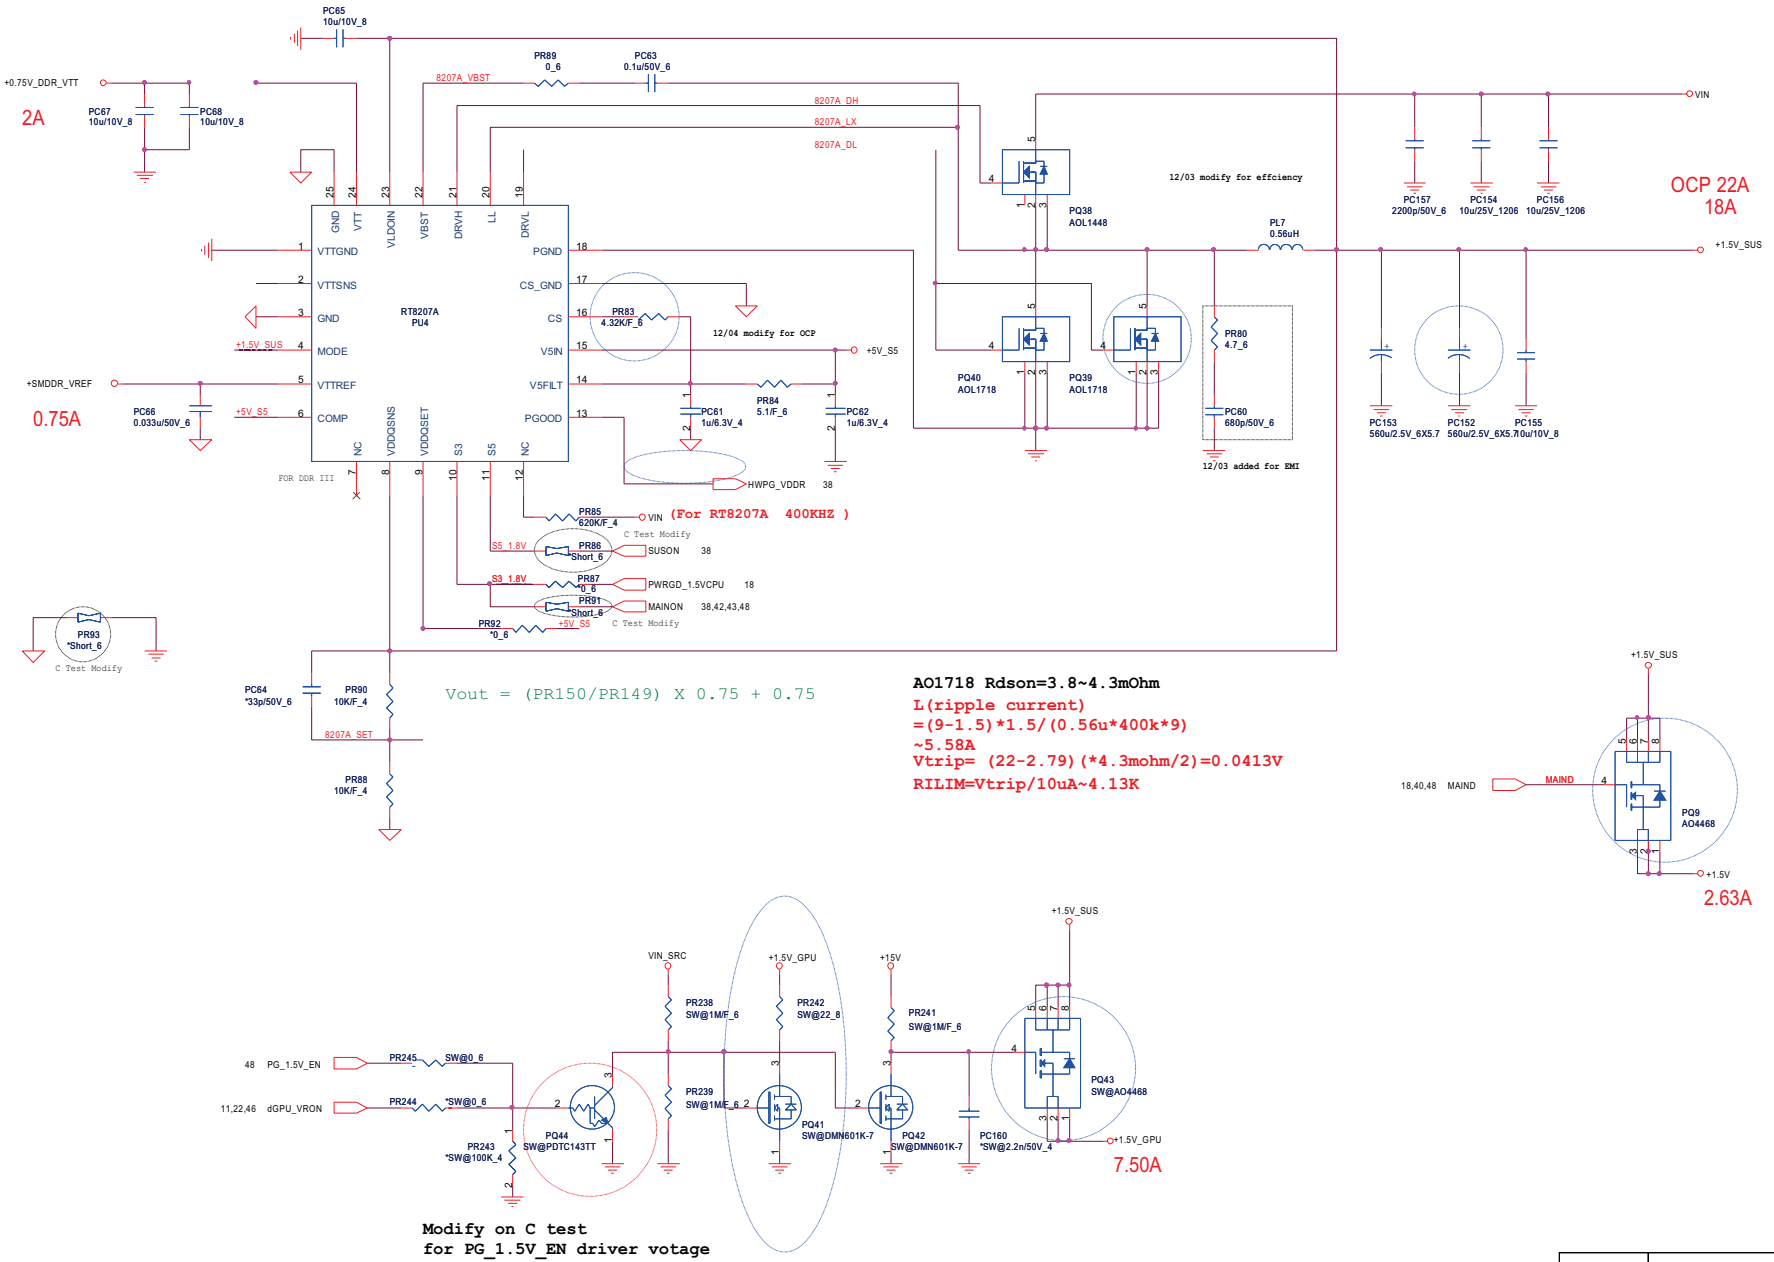

Quanta Computer Inc.	PROJECT : ZYB & ZYBA	
Size	Document Number	Rev
	DDR 1.5V(TPS51116)	1A
Date: Tuesday, January 19, 2010	Sheet 44 of 51	

UMA &SG => +VGFX_AXG Exist
Discrete =>+VGFX_AXG del

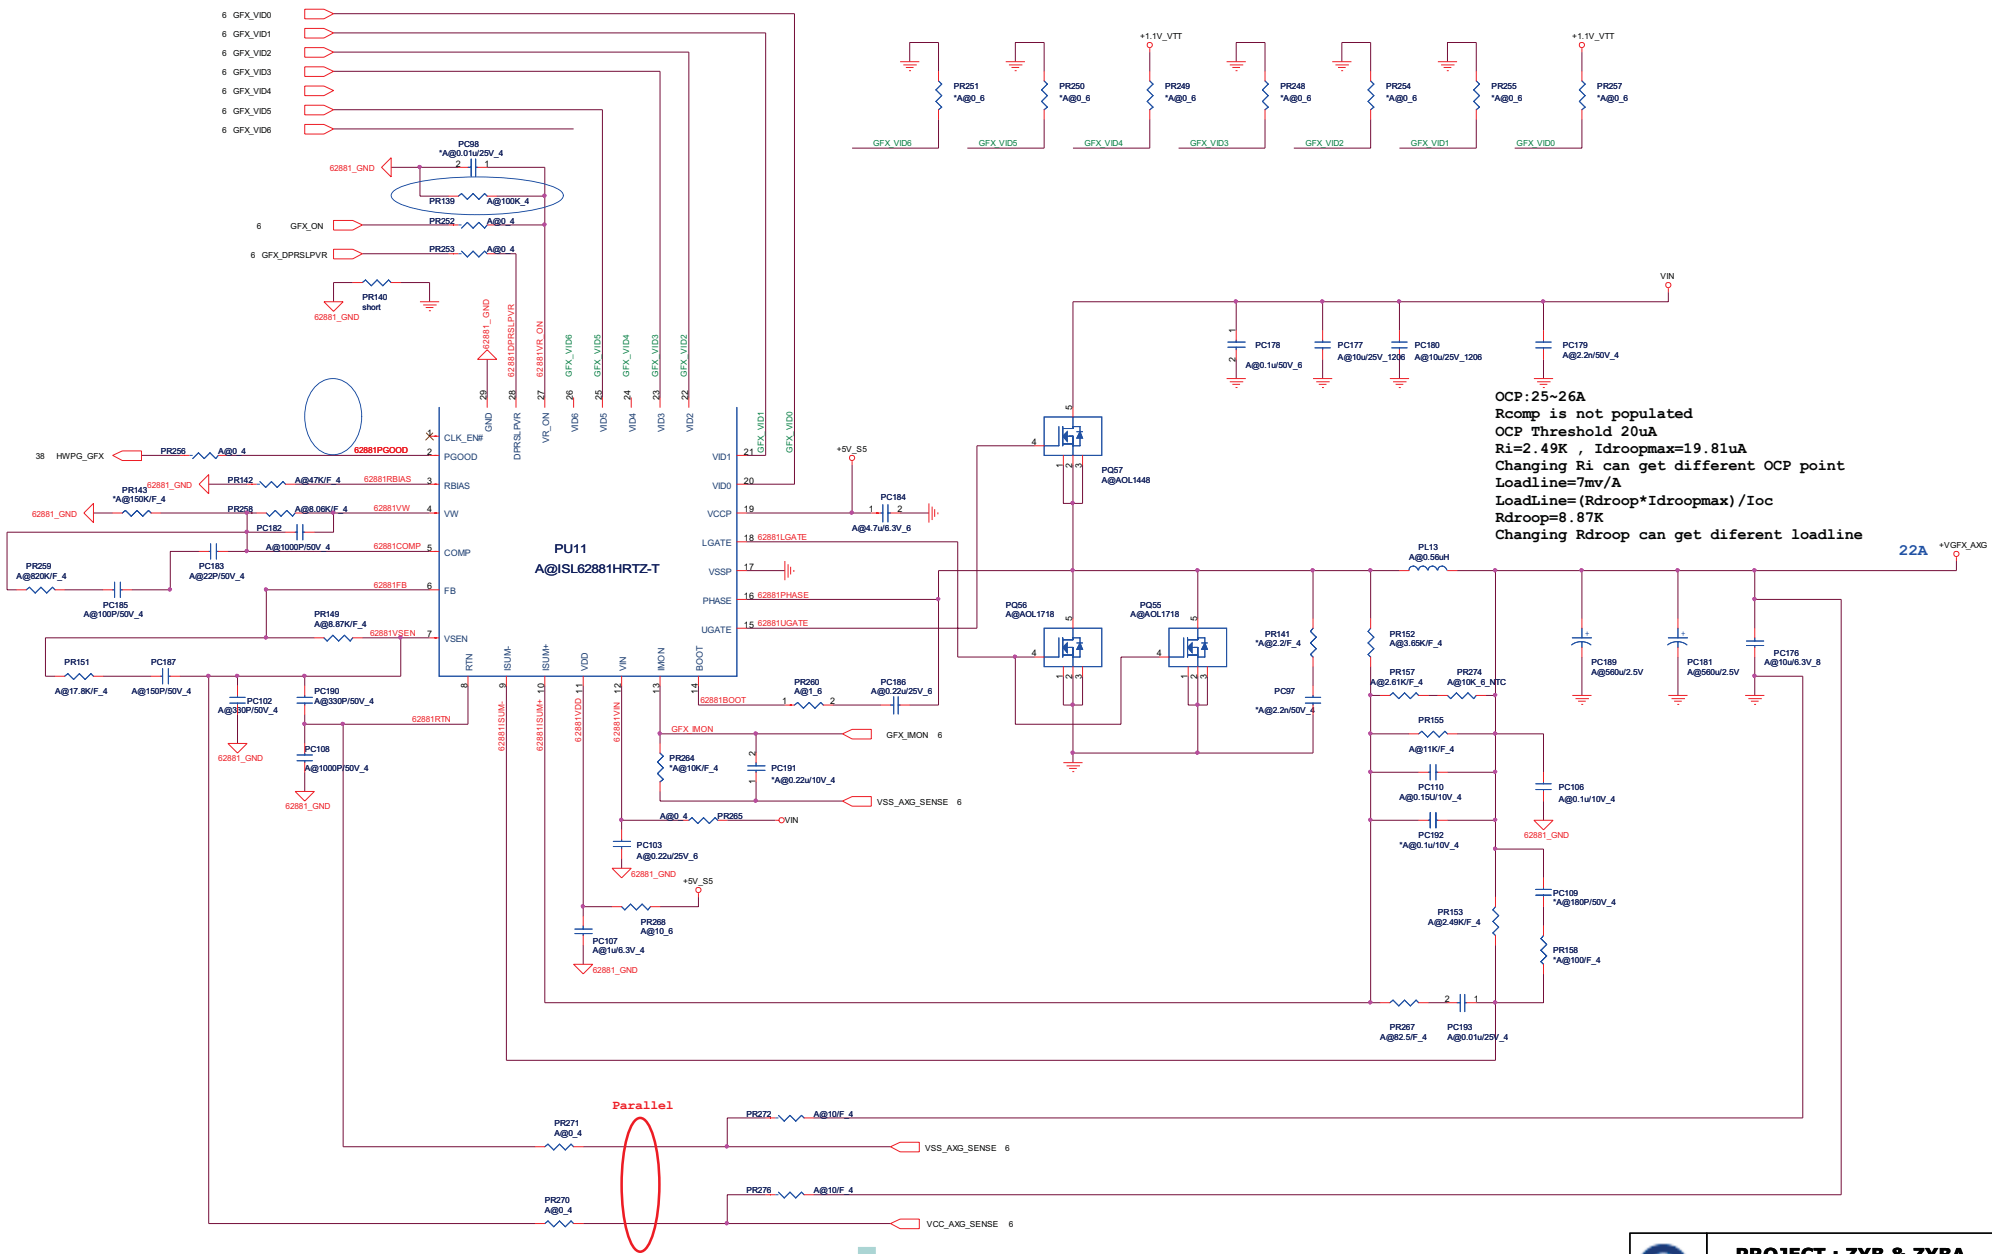

1.Level 1 Environment-related Substances Should NEVER Be Used.
2.Purchase ink, paint, wire rods, and Molding resins only from the Business Partners that Sony approves as Green Partners.

PROJECT : ZYB & ZYBA Quanta Computer Inc.		
Size	Document Number +VGFX_AXG (ISL62881)	Rev 1A
Date: Tuesday, January 19, 2010	Sheet 45 of 51	

GPU_VID1	GPU_VID2	GPU_VID3	+VGPU_Core
0	0	0	1.15V
1	0	0	1.1V
1	1	0	1.0V
0	0	1	0.95V
1	0	1	0.9V
0	1	1	0.85V
1	1	1	0.8V

12/03 modify for VID0

Note: VID[5:0]=011010=0.9V
VID[5:0]=010110=1.0V

10/27 change

10/27 change to ESR 6mohm

10/28 change for load line and ocp

Iocset*Roc=Iocp*Rdroop
OFFSET=1.2V*RCIN/ROFS=30.6mv
Where :
ROFS=39.2K , RCIN=1K
Roc=1.82K
Rdroop =0.44mv/A for Rs=10K,Rdrp2=348 Ohm
T=25 degree C
Iocp is desire max over current 40A
Iocset is recommendation 10uA from Rbias

Panasonic
ERT-J1VR103J
Close to Phase 1 Inductor

Parallel

PROJECT : ZYB & ZYBA
Quanta Computer Inc.
Size
Document Number: +VGPU_Core (ISL6264)
Rev 1A
Date: Tuesday, January 19, 2010
Sheet 46 of 51

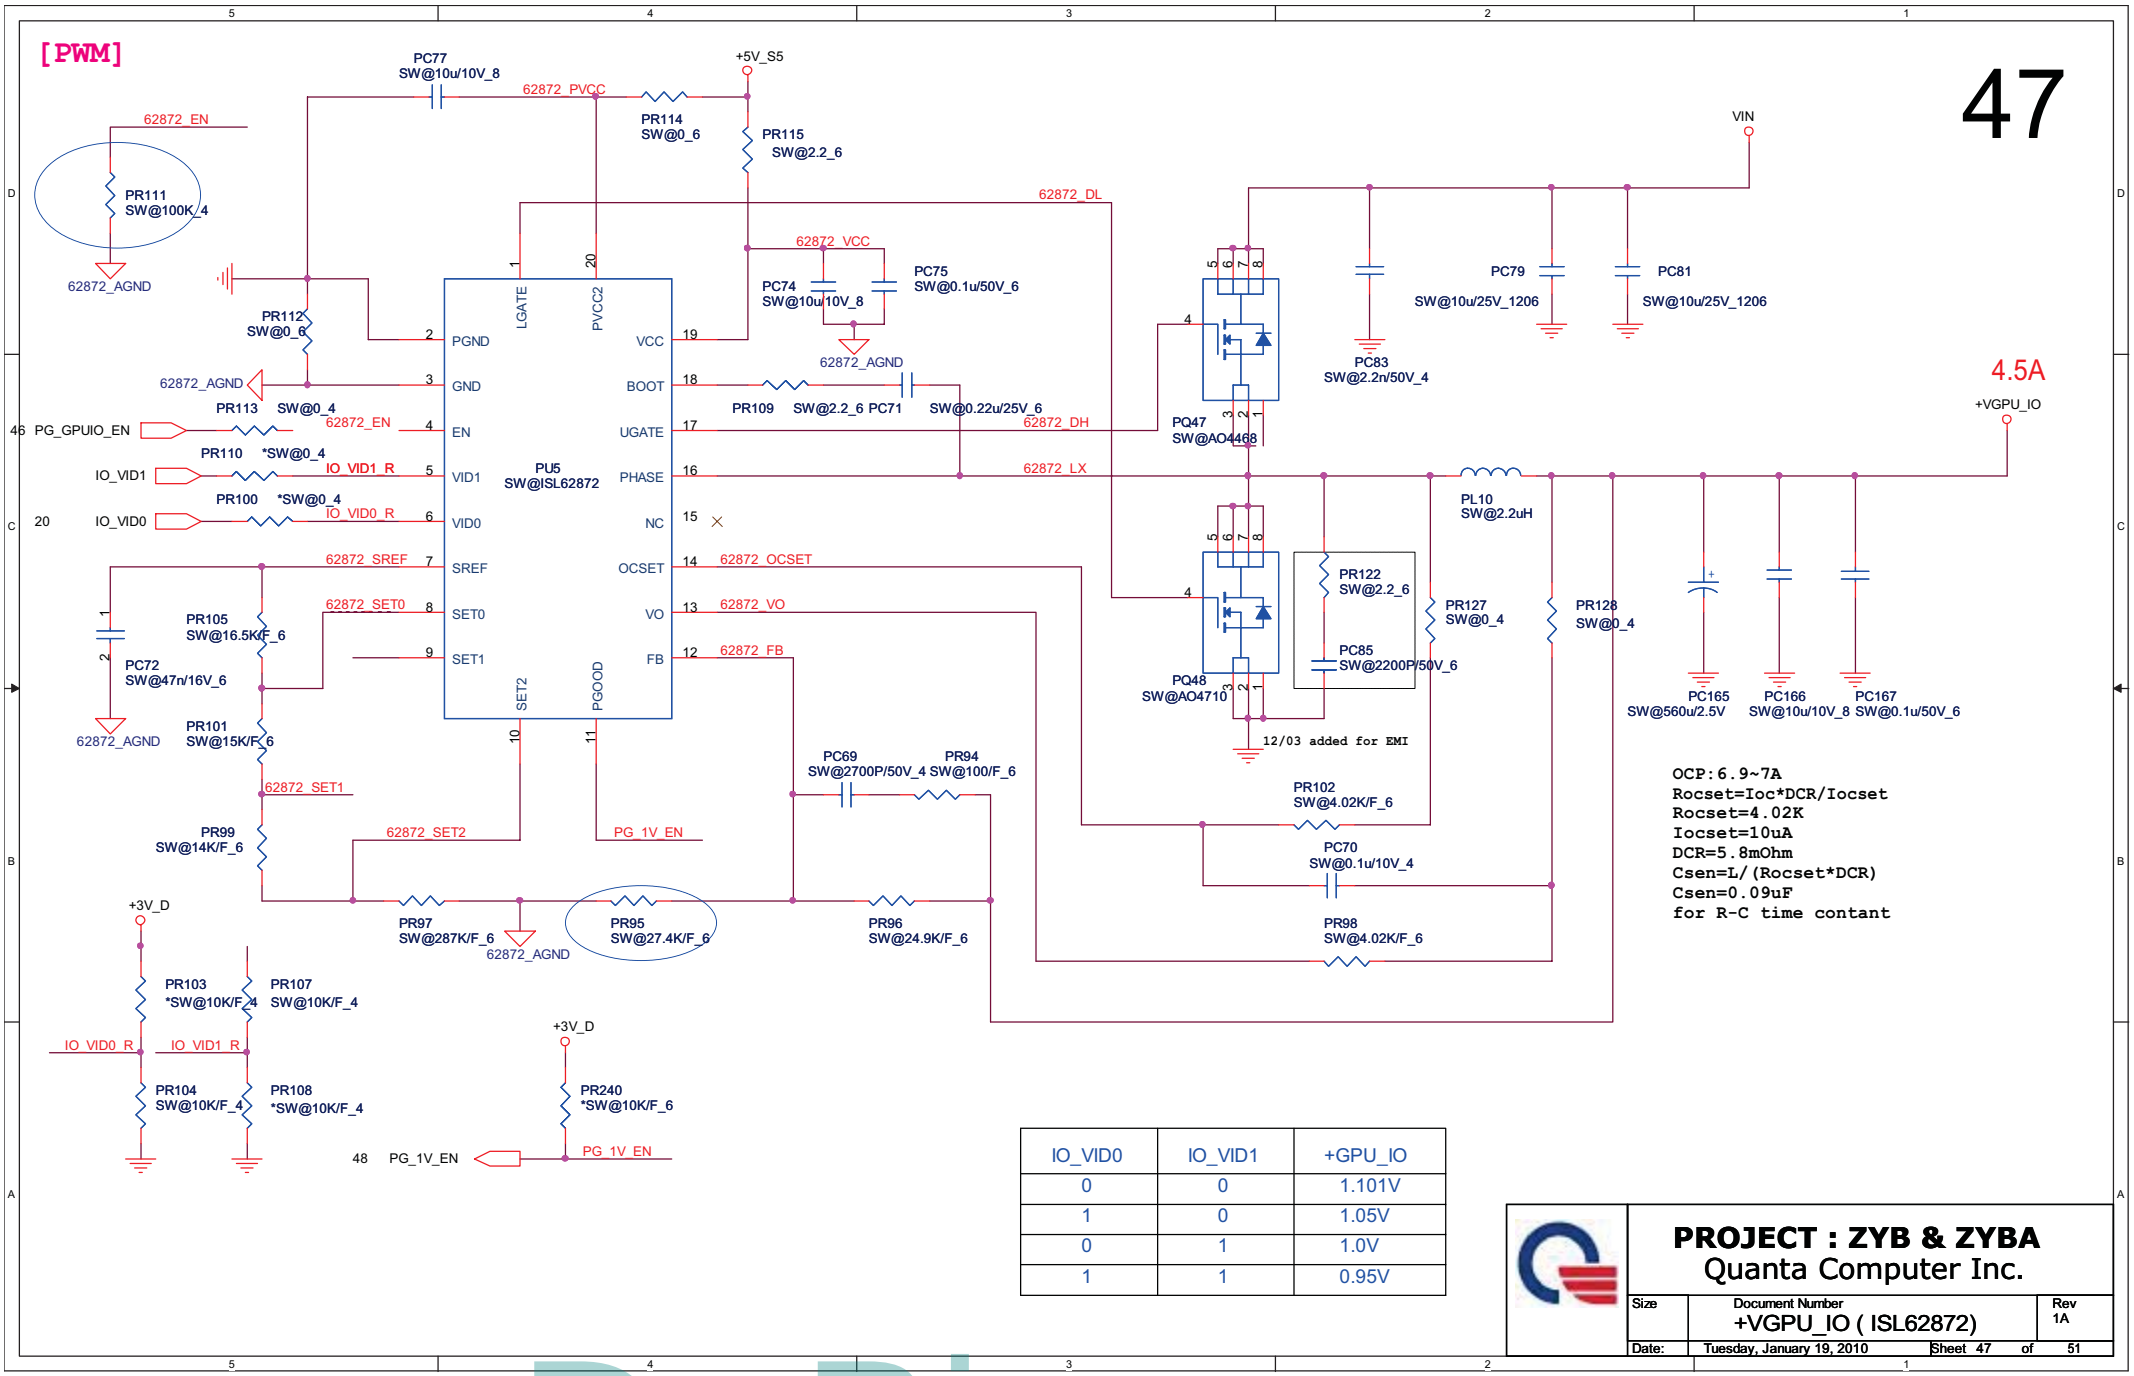

IO_VID0	IO_VID1	+GPU_IO
0	0	1.101V
1	0	1.05V
0	1	1.0V
1	1	0.95V

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	+VGPU_IO (ISL62872)	1A
Date: Tuesday, January 19, 2010	Sheet 47 of 51	

2.55A

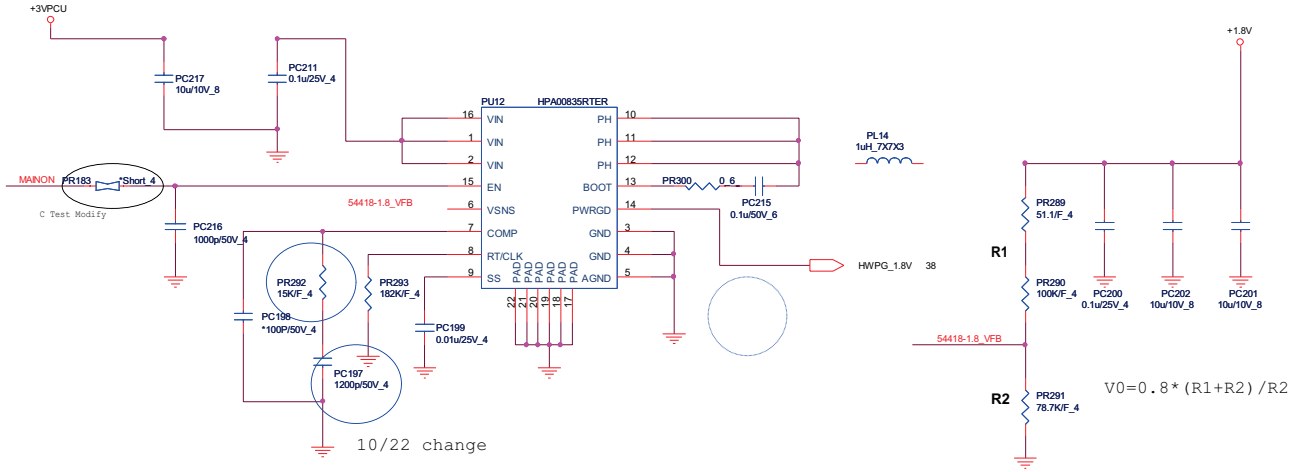

9/7 change

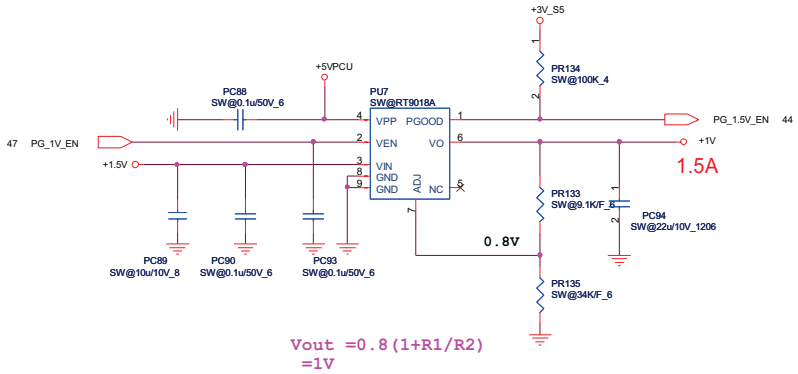

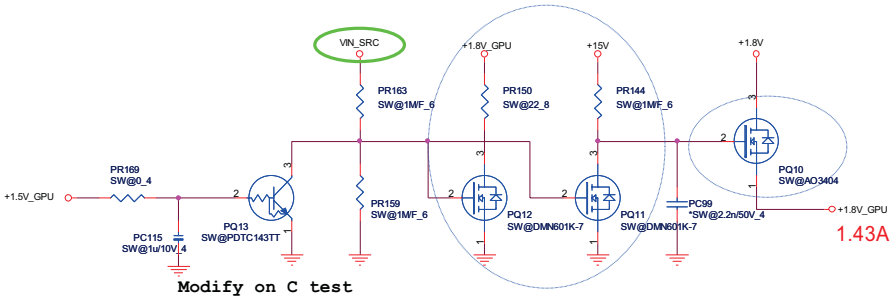

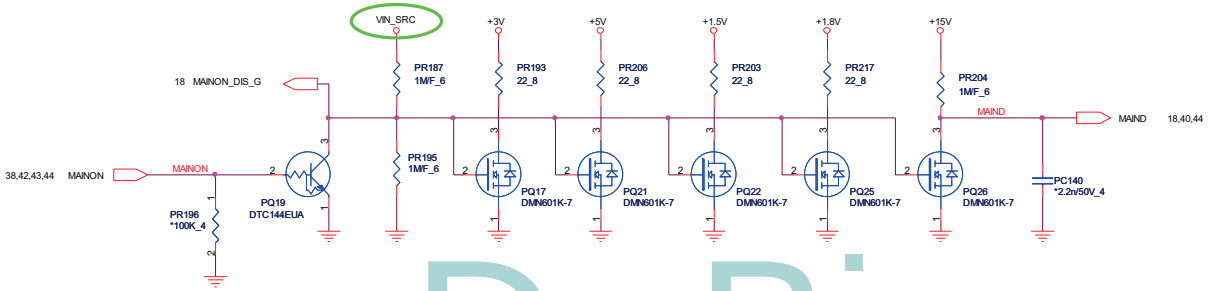

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Discharge/1.8V)	1A
Date: Tuesday, January 19, 2010	Sheet 48 of 51	

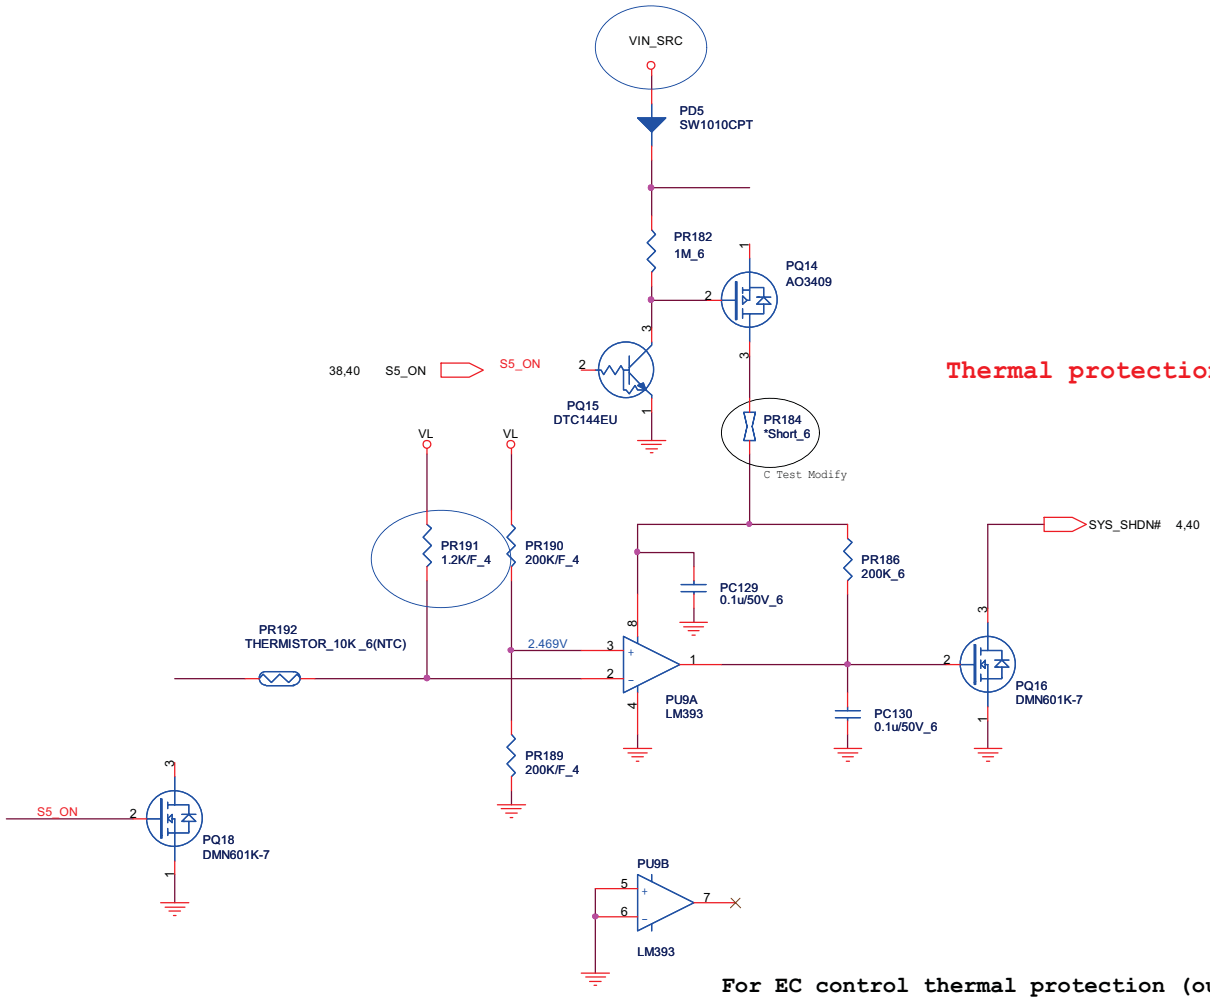

Thermal protection

For EC control thermal protection (output 3.3V)

PROJECT : ZYB & ZYBA Quanta Computer Inc.		
Size	Document Number **Thermal protect**	Rev 1A
Date: Tuesday, January 19, 2010	Sheet 49 of 51	

MODEL:	REV	CHANGE LIST
ZYB MB	A	***First release***
	B	***Page10: USB_OC6# connect to OC1.*** ***Page21: Change R94 from 680ohm => 51ohm(CS05102FB09) for AMD suggestion.*** ***Page32: Modify Audio LINE_JD# circuit ,ADD R658 -shot pad and PD12(BC001010Z17) , and del R641 , Q39 .*** ***Page27: Change R130,R131 from 0 ohm => 15 ohm(CS01502JB12).*** ***Page28: Change Q14 footprint => UMT_213-3-1_3*** ***Page29: Change R617 and R621 from 0 ohm => 120 ohm Bead(CX05T121000) for SD card EMI issue.*** ***Page35: Swap CN32 Pin define and del oc6 on B test*** ***Page32:Change R334 and R422 from 47ohm => 56ohm(CS05602JB17) for Audio suggestion on B test..*** ***Page38:add R690(CS31002JB28) pull low for power saving and reserve R691 for LED pin.*** ***Page34:CN7 and CN14 Pin42 connect to RFLED#*** ***Page34:Change 2nd HDD conn footprint (sata-ld2822f-saq16-22p-r)and P/N(DFHS22FR239).*** ***Page36:Reserve Q3 , Q19(BAM00840001) and pop R16 ,depop R278 (CS00002JB38) to meet acer 2010 spec , only EC control.*** ***Page32:Del R598(CS41002JB20) PU Res for AMP.*** ***Page32:Tune SUB AMP Gain to 20 db => del R286 , add R291 , and add R320 ,R696 to 0 ohm(CS00003J951) on AMP Pin 11 and 12,*** ***Page22: POP C378 330U(CH733RM8831) fot +VGPU_CORE.*** ***Page03: Reserve C855(CH41003ZB35) and C856(CH61001ME96) on U21 Clock Gen 1.5V .*** ***Page :0 ohm short for cost down*** ***R78,R92,R158,R160,R199,R205,R206,R207,R208,R248,R249,R250,R255,R275,R282,R283,*** ***R284,R285,R382,R383,R396,R408,R410,R415,R430,R514,R546,R576,R578,R583,R590,R591,R599,R600,R601.R602,R603,*** ***R637,R643,R658,R660,R665,R671,R676,R679,R681,R685,R686*** ***Page35: Change C424 p/n => CH51002M930.*** ***Page39: Add PC9028(CH5104K9906) , change PR58 from 33k => 150k(CS41502JB10) and change PR65 from 10k => 39K(CS33902JB01) for inrush current issue.*** ***Page39: Add PR51/ 0ohm(CS00003J951) and PC48/2200p(CH22206K917) for EMI suggestion.*** ***Page39:Change PJ1 pin define , Pin1, 2 =>GND , Pin3, 4=>Vin .*** ***Page39: Change PQ31 from P/N BAM44680003 =>BAM44960000.*** ***Page39: Reserve PC230/1000p(CH21006K917)for EMI suggestion.*** ***Page40: Add PR197,PR205 2.2ohm(CS-2203F911) and PC133 ,PC138 1000p(CH21006K917) for EMI suggestion.*** ***Page41: Add PR137,PR136 /2.2ohm(CS-2203F911) and PC96,PC95/1000p(CH21006K917) for EMI suggestion.*** ***Page41: Change PU8 footprint QFN40-5X5-4-41P-0_75H => qfn40-5x5-4-41p-0_75h-smt .*** ***Page43: Add PR185 /4.7ohm(CS-4703J917) and PC128/680p(CH16806J911) for EMI suggestion.*** ***Page44: Add PR80 /4.7ohm(CS-4703J917) and PC60/680p(CH16806J911) for EMI suggestion.*** ***Page44: Change PR83 from 4.02k=>4.32k(CS24323F911) to modify OCP.*** ***Page46: POP PR70(CS31003J941) and depop PR59 for VGPUCORE VID0.*** ***Page46: Change PR41 PN from 39.2k => 60.4K(CS36042FB10).*** ***Page47: Add PR122(CS-2203J913) and PC85(CH22206K917) for EMI issue.*** ***Page48: Change PU12 PN from AL054418000 => AL000835000.***

MODEL / PAGE	ZR6 MB FROM	TO
1	1A	
2	1A	3B
3	1A	
4	1A	
5	2A	
6	1A	
7	1A	
8	1A	
9	3A	
10	3A	
11	1A	3B
12	1A	
13	1A	
14	3A	
15	2A	
16	1A	
17	3A	3B
18	2A	
19	3A	
20	1A	
21	3A	
22	1A	
23	3A	
24	3A	
25	2A	
26	3A	
27	2A	
28	3A	
29	3A	3B
30	1A	
31	3A	
32	2A	
33	2A	
34	2A	
35	2A	3B
36	2A	
37	2A	
38	2A	
39	3A	3B
40		

MB Assy' P/N: 31ZYBMB0000/10/80 | Project :ZYB MB | Document No.:

Approved by : J. C | Drawing by :Jason Twu | DATE: 2009/10/20

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size | Document Number: **Change list** | Rev: 1A

Date: Tuesday, January 12, 2010 | Sheet 51 of 51

MODEL:	REV
ZYB MB	C

CHANGE LIST

Page12: Change C443 from 10u/0603 =>22u/0603(CH6221M9900) for CRT Flicker issue.
Page20 : Change C169,C66 from 10u/0603 =>22u/0603(CH6221M9900) for CRT Flicker issue.

Page27: Del R459,R460 Add L69 for Mic EMI issue.

Page03: Add R464 Reserve CPU_SEL PIN PU to +3V.

Page08,21:Change R309 C759 Footprint from RC0402-C , CC0402-C =>RC0402 , CC0402

Page29:Change CN11 => DFHD36MS012(4in1-r015-212-lm-42p-h-nb4).

Page27:Add Fuse F1(DK100TPU028) on CRT VCC for safty requirement.

Page28:Add Fuse F2(DK100TPU028) on HDMI VCC for safty requirement.

Page:0805- R596,R593,R387,R276,R277,R10,R21,R191,R198,R239,R439,R455,R458
0603- R321,R335,R296,R323,R352,R319,R333,R336,R404,R310,R613,R302,R315,R401,R579,R449,R375
0402- R317,R597,R568,R536,R535,R291,R292,R54

Page37:Change CN10 => DFWF05MR027 (87213-05XX-5P-L)

Page27:Reserve 2 varistor(RV4,RV5) for DMIC_CLK , DMIC_DATA to solve ESD, Add R320,R459 for EMI request.

Page27:Change LvdS SW circuit to solve leakage current , del R464 and PD R451 100K/0402(CS41002JB20).

Page32 : remove R320,R696 cost down , change R326 and R313 to 1K_4(CS21002JB34) to meet vender spec.

Page32 : Change L24~L29 to CX60808T012 EMI FILTER SBK160808T-221Y-N(200MA) for EMI Request.

Page36 : Change Q3,Q19 connector to WLAN For Acer LES spec V3.4

Page36 : Change Q3,Q19 connector to WLAN For Acer LES spec V3.4
Page39:Change R443,R442,R447 to 1.2K(CS21202FB13) and R444,R441 to 680(CS16802JB27) ohm to meet Acer LED Spec.

Page39:Add EC55,EC56,EC57,EC58 22u/25V 1210(CH6224K9300) for EMI ISN solution

Page39:Change PC147 to EC58

Page39:Change PU3 footprint QFN28-5X5-5-33P => QFN28-5X5-5-33P-SMT

Page44:Change PQ44 PN from BA144EUAZ04 to BA001430Z49.

Page45:Change PU11 footprint qfn28-4x4-4-31p => QFN28-4X4-4-29P-SMT

Page48:Change PQ13 PN from BA144EUAZ04 to BA001430Z49

Page:0805- PR148
0603- PR28,PR5,PR220,PR210,PR200,PR199,PR275,PR119,PR120,PR294,PR303,PR93,PR86,PR91,PR184
0402- PR50,PR213,PR209,PR306,PR228,PR223,PR229,PR214,PR131,PR129,PR132,PR130,PR147,PR175,PR170,PR166,PR183,PR166

MODEL / PAGE	ZR6 MB FROM	TO
1	1A	
2	1A	3B
3	1A	
4	1A	
5	2A	
6	1A	
7	1A	
8	1A	
9	3A	
10	3A	
11	1A	3B
12	1A	
13	1A	
14	3A	
15	2A	
16	1A	
17	3A	3B
18	2A	
19	3A	
20	1A	
21	3A	
22	1A	
23	3A	
24	3A	
25	2A	
26	3A	
27	2A	
28	3A	
29	3A	3B
30	1A	
31	3A	
32	2A	
33	2A	
34	2A	
35	2A	3B
36	2A	
37	2A	
38	2A	
39	3A	3B
40		

MB Assy' P/N: 31ZYBMB0000/10/80
Approved by : J. C

Project :ZYB MB
Drawing by :Jason Twu

Document No.:
DATE: 2009/10/20

PROJECT : ZYB & ZYBA
Quanta Computer Inc.

Size	Document Number	Rev
	Change list	1A
Date: Tuesday, January 19, 2010	Sheet 51 of 51	